

KOMBI HAUS VW & AUDI SPECIALIST

2635 34th St.

Sacramento, CA 95817-2047

Shop Phone: (916) 456-5615

Email: info@kombihaus.com

Web Address: www.KombiHaus.com

Invoice

36508

Estimate Ref #0

Date Printed: 01/31/2022


Printed Time: 4:33 pm

BAR # 277021

EPA # CAL000269270

Time Promised: 1/14/2022 5:00:47 PM

Ha/Ref:

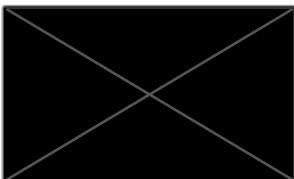

1969 VOLKSWAGEN BEETLE H4 1.5L 1457CC 92CID CARB GAS N H

VIN:

License: 6CCL219

Unit #

Mileage In: 83,762

Mileage Out: 83,779

DOM:

Date Written: 12/06/2021

Written By: Justin C

Save Old Parts: No



Job Name	Description	Technician	Qty	List	Extended
Vehicle Inspection - Bug/Bu... Labor Rate 1	Vehicle Inspection. Work Requested - TOW IN Dead Battery	Daniel O	3.00	135.00	405.00

Vehicle Inspection. Vehicle is having a hard time starting

Work Performed - Vehicle inspection- See attached notes.

Charged battery for an extended amount of time and is testing bad with 335/500CCA

Found fuel pump pivot rod missing.

Installed temporary bolt to get engine to run.

Test drove vehicle 5 miles on freeway and on surface streets. Clutch is slipping.

Recommendations

Clutch pedal, reset brake pedal return spring. Adjust and recheck clutch for slipping. Replace clutch as needed.

Replace mismatched cracked tires.

Stock muffler Oil sending unit. Replace fuel hoses under fuel tank. Fuel pump for Generator.

Speed-o illumination lights.

Front left brake drum, shoes, wheel cylinders, and hoses.

Rear brake drums and wheel cylinders. Right side tie rod assembly. Battery.

Part BR6HS	Spark Plug - NGK 3922		4.00	6.44	25.76
------------	-----------------------	--	------	------	-------

Note/Title

Inspection Notes:

Test Drive:

No smoke upon start up

No alignment, steering or suspension issues

Clutch pedal- clutch is slipping adjustment tight

Idle and acceleration OK

Brakes are soft

Shifting is OK

General ride is OK

Speedo/ODO/ trip are working

Driven 5 miles during test drive

Tires:

Tire condition is WORN and Cracked- All tires are OVER the 5 year safety

Tire PSI fronts 13 psi rears 18 psi

Spare tire- yes- old and cracked on sidewall- 10PSI

Tread Depth Front left 8/32nds front right 5/32nds rear left 4/32nds, rear right 8/32nds

All tires are mismatched brands and dates

165/R15

Note/Title

KOMBI HAUS VW & AUDI SPECIALIST

2635 34th St.

Sacramento, CA 95817-2047

Shop Phone: (916) 456-5615

Email: info@kombihaus.com

Web Address: www.KombiHaus.com

Invoice

36508

Estimate Ref #0

Date Printed: 01/31/2022


Printed Time: 4:33 pm

BAR # 277021

EPA # CAL000269270

Time Promised: 1/14/2022 5:00.47 PM

Hal/Ref

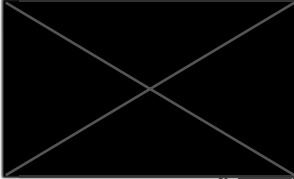

1969 VOL.KSWAGEN BEETLE H4 1.5L 1457CC 92CID CARB GAS N H

VIN:

License: 6CCL219

Unit #:



Mileage In: 83,762

Mileage Out: 83,779

DOM:

Date Written: 12/06/2021

Written By: Justin C

Save Old Parts: No

Engine:

At start up there is some internal noise that goes away after oil gets cycled
Oil leaks at the Sump plate
Valve covers, oil pump pushrod tubes are all OK at this time
Oil level and condition OK
Motor mounts are OK
General condition is OK

Tune Up components:

Vacuum lines are OK
Distributor type is vacuum- single
Distributor condition- OK but its missing metal tube for vacuum hose to carb.
Distributor cap and rotor are OK
Spark plugs are worn. Replaced with new BR6HS plugs
Spark plug wires are OK
Points and condensor are OK
Air filter OK
No damaged wiring found at this time

Note/Title

Exhaust system:

General condition is rusty
Stock muffler is rusty- needs replacement
Heater boxes are OK
Tail pipes are OK

Charging System:

12V System
Generator
Charge harness is OK
Alt/Gen light is working
Charging voltage is Idle: 12V High 12.8V
Belt is OK but loose
Battery is Dead- no date - CCA 500 Voltage 9.6V

Electrical System:

All exterior lighting is working as intended.
Dash lights are INOP- oil light INOP- needs oil sending unit
Interior lighting is working
Wiper operation OK

Note/Title

KOMBI HAUS VW & AUDI SPECIALIST

2635 34th St.

Sacramento, CA 95817-2047

Shop Phone: (916) 456-5615

Email: info@kombihaus.com

Web Address: www.KombiHaus.com

Invoice

36508

Estimate Ref #0

Date Printed: 01/31/2022

Printed Time: 4:33 pm

BAR # 277021

EPA # CAL000269270

Time Promised: 1/14/2022 5:00:47 PM

Ha/Ref:

1969 VOLKSWAGEN BEETLE H4 1.5L 1457CC 92CID CARB GAS N H

VIN:

License: 6CCL219

Unit #:

Mileage In: 83,762

Mileage Out: 83,779

DOM:

Date Written: 12/06/2021

Written By: Justin C

Save Old Parts: No

Brake System:

Brake fluid level is low
Condition is OK
Master Cylinder is Ok at this time
No pedal fade
Brake main line is OK

Front Brakes:

Drum/rotor measurements Left 5mm Right 9.113
Brake flex hose is bubbled on the right side
Brake hard line is OK
Front wheel bearings are OK
Brake hardware is flipped upside down
Wheel cylinders are leaking and siezed
Note: Left side brake shoes are grooved and left drum has deep grooves

Note/Title

Rear Brakes:

Drum measurements are Left 9.175 Right 9.132
Wheel cylinders are leaking
Shoe condition is OK
Shoes Left 4mm Right 4mm
Brake flex hose and hard line are OK
Brake hardware was upside down (fixed it)
Backing plates are OK
E-brake and adjustment are OK
Note: Right rear drum has worn splines

Front suspension:

Front shocks OK
Steering box has play
Steering dampener is OK
Tie rods. Right outer bad
Front axle beam OK
Jamb nuts and lock plates are OK
Axle nuts/Threads OK
Upper and lower ball joints OK
Sway bar OK

Note/Title

KOMBI HAUS VW & AUDI SPECIALIST

Invoice

2635 34th St.

Sacramento, CA 95817-2047
 Shop Phone: (916) 456-5615


Email: info@kombihaus.com
 Web Address: www.KombiHaus.com

36508

Estimate Ref #0
 Date Printed: 01/31/2022
 Printed Time: 4:33 pm
 BAR # 277021
 EPA # CAL000269270

Time Promised: 1/14/2022 5:00:47 PM

Ha/Ref:

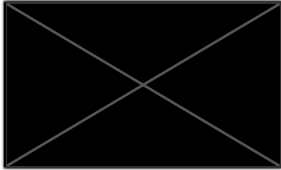

1969 VOLKSWAGEN BEETLE H4 1.5L 1457CC 92CID CARB GAS N H

VIN:

License: 6CCL219

Unit #:

Mileage In: 83,762

Mileage Out: 83,779

DOM:

Date Written: 12/06/2021

Written By: Justin C

Save Old Parts: No

Rear End:

Clutch pedal is broken@ pin
 Brake pedal return spring not on pedal
 Clutch cable and bowden tube is OK
 Shift operation is OK
 Shift rod bushings and coupler are OK
 Fluid level and condition are OK
 No transmission leaks at this time
 Axle boots are OK
 Mount condition OK
 Spring plates are OK

Fuel System:

No fuel leaks at this time
 Engine bay fuel lines are OK
 Clamps OK
 Under body fuel lines are original. Under tank hose is old
 Carburator is Solex 30/31 Condition is OK
 Throttle shaft OK
 Air filter/ Oil bath OK

Discount: 60.75
 Job Total: 370.01

Battery - Bug	Replace battery	Daniel O			
Labor Rate 1	Work Requested - Replace battery		0.30	135.00	40.50
Work Performed - Replaced battery.					
Part MT-42	Interstate Battery - Megatron - 75 month		1.00	135.95	135.95
Misc Batt	Work Requested - California Battery Charge		1.00	1.00	1.00
			Job Total:		177.45

Clutch pedal repairs	Daniel O				
Labor Rate 1	Work Requested - Clutch pedal repair. Pedal is breaking. Clutch too tight		2.00	135.00	270.00
Work Performed - Removed clutch pedal assembly, replaced clutch pedal arm. Set return spring on brake pedal that was loose.					
Test drove vehicle to check for clutch slipping. the clutch pressure plate feels very week and engages the clutch with very little pressure applied. no significant slipping during 8 mile test drive.					
Noise coming from trans when clutch peddle is depressed. Would replace T/O bearing and needle bearing in gland nut.					
Recommending Clutch kit, Glad nut and needle bearing and inspect gear oil for drain and refill as needed					
Part 113 721 315C	Clutch Pedal - Bug 66-78/Ghia		1.00	31.39	31.39
			Job Total:		301.39

Tires -	Daniel O				
Labor Rate 1	Work Requested - Mount and Balance.		4.00	15.00	60.00
Work Performed - replaced, mounted and balanced 4 tires.					
Part VALSTE	Valve Stem, Tire		4.00	3.20	12.80
Misc DISP	Work Requested - Tire disposal		4.00	3.00	12.00
Misc CATAx	Work Requested - CA RECYCLE TAX		4.00	1.75	7.00
Part 165/80R15	165/80R15 NEX BW SB02 87T 0		4.00	96.00	384.00

KOMBI HAUS VW & AUDI SPECIALIST

2635 34th St.

Sacramento, CA 95817-2047
 Shop Phone: (916) 456-5615

Email: info@kombihaus.com
 Web Address: www.KombiHaus.com


Invoice

36508

Estimate Ref #0
 Date Printed: 01/31/2022
 Printed Time: 4:33 pm
 BAR # 277021
 EPA # CAL000269270

Time Promised: 1/14/2022 5:00:47 PM

Ha/Ref:

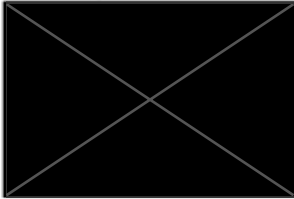

1969 VOLKSWAGEN BEETLE H4 1.5L 1457CC 92CID CARB GAS N H

VIN:

License: 6CCL219

Unit #:

Mileage In: 83,762

Mileage Out: 83,779
 DOM.

Date Written: 12/06/2021

Written By: Justin C
 Save Old Parts: No

Job Total: 475.80

Muffler T-1 Dual port

Andrew R

Labor Rate 1	Work Requested - Replace muffler and tail pipes	2.00	135.00	270.00
Work Performed - Installed tail pipes and tail pipe clamp kits in exhaust				
Part 111 298 051A	Tail Pipe Clamp Kit	2.00	8.76	17.52
Part 111 298 009B	Exhaust mounting kit	1.00	27.64	27.64
Part 113 251 053BJ	Muffler - T-1 Dual Port - Bosal	1.00	173.40	173.40

Job Total: 488.56

Oil Pressure Switch

Daniel O

Labor Rate 1	Work Requested - Oil pressure switch replacement	0.40	135.00	54.00
Work Performed - Replaced oil pressure switch and female electrical connector. OK				
Part 021 919 081B	Oil Pressure Sender	1.00	14.43	14.43

Job Total: 68.43

Front brakes

Andrew R

Labor Rate 1	Work Requested - Replace front L&R brake shoes, drums & wheel cylinders	2.00	135.00	270.00
Work Performed - Replaced both front brake shoes, wheel cylinders, brake hoses and brake drums. Adjusted front brakes and bled front brake system.				
Removed and replaced master cylinder reservoir feed hoses due to leak and swollen hoses, using 1 ft of brake hose.				
Part WS 315	Brake Shoe Set - Front or Rear - Obtec	1.00	34.10	34.10
Part 111 405 615D	Brake Drum, Front	2.00	70.87	141.74
Part 131 611 057	Wheel Cylinder, Front - Bug 65-78 - ATE	2.00	35.87	71.74
Labor Rate 1	Work Requested - Front brake hoses	0.50	135.00	67.50
Part 113 611 701D	Brake Hose, Front - Type 1 59-79	2.00	11.70	23.40
Part DOT 3	Brake Fluid DOT 3 per liter	1.00	11.90	11.90

Job Total: 620.38

Rear brakes

Replace rear L&R brake shoes, drums & wheel c...

Andrew R

Labor Rate 1	Work Requested - Replace rear L&R brake shoes, drums & wheel cylinders	2.00	135.00	270.00
Work Performed - Replaced both rear wheel cylinders, brake shoes and brake drums. Adjusted rear brake shoes and e-brake cables and bled rear brake system.				
Part WS 315	Brake Shoe Set - Front or Rear	1.00	34.10	34.10
Part 113 611 053B	Wheel Cylinder, Rear - Bug 68-78	2.00	29.62	59.24
Part 113 501 615 JBR	Brake Drum Rear 4 Lug	2.00	94.57	189.14
Part BF	Brake Fluid	1.00	6.75	6.75

Job Total: 559.23

Steering Box

Andrew R

Labor Rate 1	Work Requested - Replace steering box	2.00	135.00	270.00
Work Performed - Removed and replaced steering box and set steering wheel straight.				
Part 113 415 061 C	Steering Box - Bug 47-78 - TRW	1.00	237.98	237.98

Job Total: 507.98

KOMBI HAUS VW & AUDI SPECIALIST

2635 34th St.
 Sacramento, CA 95817-2047
 Shop Phone: (916) 456-5615

Email: info@kombihaus.com
 Web Address: www.KombiHaus.com


Invoice

36508

Estimate Ref #0
 Date Printed: 01/31/2022
 Printed Time: 4:33 pm
 BAR # 277021
 EPA # CAL000269270

Time Promised: 1/14/2022 5:00:47 PM

Ha/Ref:

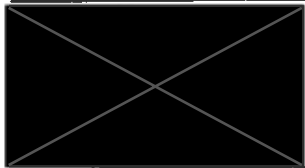

1969 VOLKSWAGEN BEETLE H4 1.5L 1457CC 92CID CARB GAS N H

VIN:

License: 6CCL219

Unit #:

Mileage In: 83,762

Mileage Out: 83,779

DOM:

Date Written: 12/06/2021

Written By: Justin C

Save Old Parts: No

Right tie rod end	Right outer tie rod	Andrew R			
Labor Rate 1	Work Requested - Right outer tie rod		0.70	135.00	94.50
Work Performed - Replaced passenger outer tie rod and reset toe adjustment and verified correct toe was set.					
Part 311 415 812 C	Tie Rod End - Inner/Outer; RHT - Bug/Bus 68-79		1.00	21.36	21.36
Labor Rate 1	Work Requested - Set toe		0.70	135.00	94.50
					Job Total: 210.36

Fuel Pump		Daniel O			
Labor Rate 1	Work Requested - Replace fuel pump		0.50	135.00	67.50
Work Performed - Replaced fuel pump.					
Part 113 127 025 DY	Fuel Pump		1.00	65.36	65.36
					Job Total: 132.86

Fuel hose under tank	Fuel hose under fuel tank	Daniel O			
Labor Rate 1	Work Requested - Fuel hose under fuel tank		0.30	135.00	40.50
Work Performed - Replaced 7" of 5.5mm rubber fuel hose under tank.					
Part FH5	Fuel Hose 5mm - per ft.		0.70	4.62	3.23
					Job Total: 43.73

Valve Adjustment		Daniel O			
Labor Rate 1	Work Requested - Adjust valves & torque lower head studs		0.80	135.00	108.00
Work Performed - Performed valve adjustment service					
Part 113 101 481F	Valve Cover Gasket		2.00	2.70	5.40
					Job Total: 113.40

Revision History

Revision#	Date	Authorized By	Phone # / In Person
25,714	1/19/2022 4:34:15 PM	Joshua	(916) 296-4382
Reason: battery			Additional Cost \$ 3,854.81
Original Estimate: \$ 439.54		Total Revisions: \$ 3,854.81	Current Estimate: \$ 4,235.72

Warranty:
 All parts and service work guaranteed 12 months or 12,000 miles or whichever comes first unless otherwise stated or unless caused by misuse, abuse, neglect or personal damage, we will replace at our option any defective parts or labor. All new engines installed by Kombi Haus Motors require a shorter service interval for the break in cycle. Customers are required to check their own oil between said services. Break in cycle will be performed at 300, 1000 and 3000 miles after new engine is installed. There after customer is required to service vehicle every 3000 miles to maintain warranty.

It is understood that Kombi Haus and its employees will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond their control. All charges for repair are due and payable simultaneously with the delivery of the within described vehicle, or prior to delivery. STORAGE OF \$75 PER DAY WILL BE CHARGED 48 HOURS AFTER REPAIRS ARE COMPLETED. In the event legal action is necessary to enforce this contract, I will pay reasonable attorney's fees & court costs. WARRANTY: All parts and service work guaranteed 12 months or 12,000 miles or whichever comes first unless otherwise stated unless caused by misuse, abuse, drivers neglect or personal damage. Kombi Haus Motors recommends customers to check their oil between service intervals (Every 3000 miles on all vehicles we service). WARRANTY will be VOID if oil change intervals are not upheld or followed per Kombi Haus Motors terms. We will repair or replace at our option any defective parts or labor, after verification of warranty repair. Any warranties on products sold hereby are those made by the product manufacture. THERE IS NO WARRANTY ON USED OR CUSTOMER SUPPLIED PARTS. There is no warranty on vehicles with inoperative odometer. WARRANTY WORK MUST BE PERFORMED AT THIS SHOP. By signing this disclaimer I am authorizing the above revised dollar amount. Not responsible for towing costs.

KOMBI HAUS VW & AUDI SPECIALIST

2635 34th St.
 Sacramento, CA 95817-2047
 Shop Phone: (916) 456-5615

Email: info@kombihaus.com
 Web Address: www.KombiHaus.com


Invoice

36508

Estimate Ref #0
 Date Printed: 01/31/2022
 Printed Time: 4:33 pm
 BAR # 277021
 EPA # CAL000269270

Time Promised: 1/14/2022 5:00:47 PM

Ha/Ref:

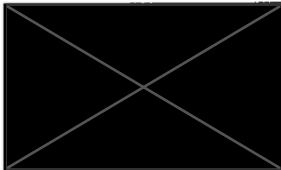

1969 VOLKSWAGEN BEETLE H4 1.5L 1457CC 92CID CARB GAS N H

VIN:

License: 8CCL219

Unit #:

Mileage In: 83,762

Mileage Out: 83,779

DOM:

Date Written: 12/06/2021

Written By: Justin C

Save Old Parts: No

1. All rebuildable vehicles are sold "AS IS"
2. Without exception, the seller will not pay any amount for the repair(s) of part(s) sold to buyer, nor will pay any labor costs incurred by buyer in removing, replacement or repairing part(s) sold.
3. No refund(s) on electrical part(s).
4. Sheet metal parts & cuts are sold "AS IS"
5. All returns or exchanges must be accompanied by the original receipt.
6. No refunds/exchanges after 30 days.

Payment Date	Type	Method	Amount
1/31/2022	Credit	Visa	4,253.44
Payment Totals:			\$4,253.44

Parts: \$1,728.33
 Labor: \$2,382.00
 Sublet: \$0.00
 Misc: \$20.00
 Discount: \$60.75
 Hazmat: \$0.00
 Supplies: \$30.00

Tax Total: \$153.86

Invoice Total: \$4,253.44

Less Paid: 4,253.44

Balance Due: \$0.00

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.

Authorized By _____

Date _____

Time _____