PDFMAILER.COM

Precision Motorcars

Service Invoice: 23155

Heme Washington Courthous, OH 4318 Hat# V.I.N. # 113043 Chassis 113.043 Checked By Fage# 1740.335.0892 x1318 V.I.N. # 113043 Checked By Fage# 1740.335.0892 x1318 V.I.N. # 113043 Checked By Fage# 1740.335.0892 x1318 V.I.N. # 113043 Checked By Fage# 1740. Total Labor Parts 4. V.I.N. # 113043 Checked By Fage# 1740. Total Labor Parts 4. V.I.N. # 113043 Checked By Fage# 1740. Total Labor Parts 4. V.I.N. # 113043 Checked By Fage# 1740. Total Labor Parts 4. V.I.N. # 113043 Checked By Fage# 1740. Total Labor Parts 4. V.I.N. # 113043 Checked By Fage# 1740. Total Labor Parts 4. V.I.N. # 113043 Checked By Fage# 1740. Total Labor Parts 4. V.I.N. # 113043 Checked By Fage# 1740. Total Labor Fage 1740. Total Labor Fage 1740. Total Labor Fage 1740. Total Labor Parts 4. V.I.N. # 113043 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total 1340 Checked By Fage 1740. Total Labor Parts 5. V.I.N. # 113043 Checked By Fage 1740. Total 1340 Checked B	FIELI	Sion Motorcar	5				2	ervice	HINVOIC	e: 2515
Service Request / Information Line Total Labor Parts Sublets 2. Steering wheel is not centered. 3. Vehicle does not hold PARK 4. Parking brake does not feel like it's connected. Part Number Fuel Part Number Fuel Part Number Fuel Description CTY List Fach Fuel Total Fuel Comprehensive checkover of vehicle & additional minor needs that had to be addressed during the course of repair: Engine appears to have been rebuilt Sublets Exhaust is incorrect. Should eventually have correct system litted 3. Vehicle is currenty fitted with KYB shocks (not good) 4. Parking brake is missing parts and is disconnected. (needed parts: left rear cable, front cable, t-connector and spring, adjustment nut and cable boot. 5. Car does not go into park. Needs linkage adjustment and new internal shifter bushings inside shifter. 6. Steering wheel is offset 180 degrees. Would need to check or proper alignment of steering shaft and possible perform a ront end alignment. 7. Vehicle was completely out of fuel. Added fuel. Gas gauge stuck on full. Sending unit may need to be cleaned or eplaced. 8. Adjusted hood so that it will close. Hood hinge bracket bolts to body need work (3 out of 4 are broken. Need to drill and etap)	Address Home Work	2101 Kenskill Ave. Washington Courthous, OH 4316	Address 2 Hat# V.I.N. # Chassis	113043 113.043	k Packing	47. 1	Time Invoiced Advisor Division PO# Checked By	2:31 PM 12/13/2011 Tyler PM	Make Model Lic,# Fleet# Color Miles In	Mercedes-Ben 250 SL Dark Blue 19,271
Service Request / Information 1. Check and advise on very poor running 2. Steering wheel is not centered. 3. Vehicle does not hold PARK 4. Parking brake does not feel like it's connected. Part Number Fuel Pescription OTY List Each Total Fuel Parts Advised Park Ad			J	ob Descri	iption		***			
Comprehensive checkover of vehicle & additional minor needs hat had to be addressed during the course of repair: Line Total hat had to be addressed during the course of repair: Line Total Labor Parts Sublets Line Total Labor Parts Sublets Line Total Labor Parts Labor Parts Sublets Sublets Sublets C. Exhaust is incorrect. Should eventually have correct system in the parts Line Total Labor Parts Labor Parts Sublets Sub	1. Ched 2. Stee 3. Vehi	ck and advise on very pring wheel is not center cle does not hold PARI	red. <		de				Lab Par	or 0.0 ts 40.0
that had to be addressed during the course of repair: 1. Engine appears to have been rebuilt 2. Exhaust is incorrect. Should eventually have correct system fitted 3. Vehicle is currenty fitted with KYB shocks (not good) 4. Parking brake is missing parts and is disconnected. (needed parts: left rear cable, front cable, t-connector and spring, adjustment nut and cable boot. 5. Car does not go into park. Needs linkage adjustment and new internal shifter bushings inside shifter. 6. Steering wheel is offset 180 degrees. Would need to check for proper alignment of steering shaft and possible perform a gront end alignment. 7. Vehicle was completely out of fuel. Added fuel. Gas gauge setuck on full. Sending unit may need to be cleaned or eplaced. 8. Adjusted hood so that it will close. Hood hinge bracket bolts at body need work (3 out of 4 are broken. Need to drill and etap)		nber Description		List						
s stuck on full. Sending unit may need to be cleaned or eplaced. 3. Adjusted hood so that it will close. Hood hinge bracket bolts at body need work (3 out of 4 are broken. Need to drill and etap)	that had to 1. Engine 2. Exhaus itted 3. Vehicle 4. Parking parts: left adjustmer 5. Car do new intern 6. Steerin or proper ront end a	e appears to have been rebuted is incorrect. Should eventual is incorrect. Should eventual is currenty fitted with KYB sets brake is missing parts and rear cable, front cable, t-cont nut and cable boot. The session of the parts of the shifter bushings inside shifter bushings in shi	ourse of repails It ally have contacts hocks (not goes is disconned nector and states had a disconnector and states had a dis	air: prect syste pod) ted. (need spring, tment and ed to che perform a	em ded d ck a				Labo Par	or 135.0
There is no is a service of the serv	s stuck or eplaced. s. Adjuste t body ne etap)	full. Sending unit may need ad hood so that it will close. He dwork (3 out of 4 are broked)	to be clear lood hinge t en. Need to	ned or oracket bo drill and					/	

9. There is noise coming from the front wheels (likely wheel bearings).

10. Throttle linkage needs adjustment

11. Sections of breather hose need to be replaced.

12. Distributor needs to be removed, cleaned, and lubed. Also need to check air filter and fuel filter, and properly set fuel mixture.

13. Left rear heater hose is incorrect.

- 14. Speedometer is inoperative (cable is disconnected)
- 15. Neutral safety cable and switch are missing

16. Needs firewall grommets

1967 Mercedes 250 SL No Cear

5565 Murray Road | Cincinnati, OH 45227-2707 513.271.5565 | Fax 513.271.8588 | <u>www.precisioncinci.com</u>

We charge 10% over Mercedes-Benz list on installed parts. We stand behind every repair that we perform with a 12-month / 12,000 mile (whichever comes first) warranty on parts and labor. Payment is due upon completion of service. This invoice is printed on recycled paper. We at Precision Motorcars **THANK YOU** for your patronage. Help spread the word!

Jeffs Cord Paid 12/13/11

Invoice Total abor \$3,5.

Labor \$3,521.00
Parts \$1,071.15
Sublets \$0.00
Supplies \$24.87
Subtotal \$4,617.02
Tax \$297.51
Total \$4,914.53



Service Invoice: 23155

Name Address	Bateson, Mr. Tim- 2101 Kenskill Ave. Washington Courthous, OH 431	- Company Address 2	Sugarcree	ek Packing		Created Time Invoiced Advisor	10/06/11 2:31 PM	Model	1967- Mercedes-Benz 250 SL
Home		Hat#				Division	Tyler PM	Lic,# Fleet#	
Work Fax	740.335.0892 x1318	V.I.N. # Chassis	113043 113.043			PO#		Calor	Dark Blue
		Eng#	129.982			Checked By Page#	2 of 7	Miles In Miles Out	19,271 19,271
47 1AP			ob Desc	ription					
	s are missing and linkage r start system needs to be ch			otion					
	ds to be sorted out	iecked & Will	ng to inje	Clion					E 2
	proper booster hose								
	r levers are in tact but hard								
21. Gas ga 22. Naads	auge sending unit needs w s a new brake fluid reservoi	ork ir ean	77						
	to top up differential oil leve								
	e runs a little hot (possible		will be						
resolved w	ith a new thermostat)								il .
	ig noise at front when in ge		ed to spe	nd					
more time	determining the source of	this noise.							
——————————————————————————————————————	car not going into park. Adji	ust shifter lin	kane					Line Tota	307.40
	ternal shifter bushings.	act officer iii	nago.					Labo	
Replace int	terrial stiller bustilligs.								270.00
•	ŭ							Part	s 37.40
Replace int Part Numb 112 267 00	per Description	QTY 2	List 18.70	Each 18.70	Total 37.40			Part Sublet	s 37.40

Address issue with engine running poorly. Remove valve cover. Adjust valves (extra time due to tight and rounded adjusters). Check compression. #1 170psi, #2 165psi, #3 160 psi, #4 170psi, #5 170psi, #6 170psi. Replace spark plugs. Had to straighten out 2 cross threaded plugs, straighten out throttle linkage, and replace vacuum line and hose for distributor advance. Set ignition timing (was way off). Cursory set of fuel mixture so that engine will run properly. Change engine oil and filter. Top up underhood fluids and road test. Engine runs well and trans shifts ok.

Part Number	Description	QTY	List	Each	Total	
000 180 00 09	OIL FILTER KIT M130	1	15.40	15.40	15.40	
000 184 33 80	HOUSING SEAL SMALL	1	4.29	4.29	4.29	
002 159 24 03	175T30 PLUG WR7DC+	6	5.17	5.17	31.02	
007603 008303	SEAL RING CAM COVER	10	1.65	1.65	16.50	
072581 025100	FUSE, 25A, SHORT	1	1.84	1.84	1.84	
100 997 00 40	SEAL, F/FILTER M130E	1	4.29	4.29	4.29	
115 159 01 40	S/PLUG WIRE BRACKET	2	4.95	4.95	9,90	
OIL	Mobil 15-40w	6.5	3.20	3,20	20.80	
OIL DISPOSAL FEE				1.95	1.95	

5565 Murray Road | Cincinnati, OH 45227-2707 513.271.5565 | Fax 513.271.8588 | <u>www.precisioncinci.com</u>

We charge 10% over Mercedes-Benz list on installed parts. We stand behind every repair that we perform with a 12-month / 12,000 mile (whichever comes first) warranty on parts and labor. Payment is due upon completion of service. This invoice is printed on recycled paper. We at Precision Motorcars **THANK YOU** for your patronage. Help spread the word!

Invoi	ce Total
Labor	\$3,521.00
Parts	\$1,071.15
Sublets	\$0.00
Supplies	\$24.87
Subtotal	\$4,617.02
Tax	\$297.51
Total	\$4,914.53

Labor

Parts

Sublets

540.00

105.99

0.00




Service Invoice: 23155

Name Address Home	Bateson, Mr. Tim 2101 Kenskill Ave Washington Courthous, OH 4316	Hat#	Sugarcree	ek Packing	-	Created Time Invoiced Advisor Division	10/06/11 2:31 PM Tyler PM	Year Make Model Lic.# Fleet#	1967 Mercedes-Benz 250 SL
Work Fax	740.335.0892 x1318	V.I.N. # Chassis Eng#	113043 113.043 129,982			PO# Checked By Page#	3 of 7	Color Miles In Miles Out	Dark Blue 19,271 19,271
		J	ob Desci	ription					
Part Nur 000 158 121 094 129 016	mber Description 14 35 V/LINE,WHITE/m 02 91 BREATHER HOSE 00 30 BREATHER TUBE	QTY 1.5 1 1	List 5.78 8.25 87.56	Each 5,78 8,25 87,56	Total 8.67 8.25 87.56			Line Tor Lab Par Suble	or 45.00 ts 121.98
that the w Repair will found the start valve	nician found the cold start systiring to the injection pump ne ring as needed. Additional tir ignition system was not sende. Repair wiring at ignition sw toluster gauges to gain acce	stem was indeded to be me was required in the	sorted ou uired as v to the co ed remove	ut. ve old al of	17.50	15		Line Tot Lab Par Suble	or 360.00 ts 41.25
broken. F replaceme repair wiri at center o	ness at the properties of the	junction with sh light to the y, repair bur ination bulb	h cable ne clock, ned up w s as nee	viring ded.	Total 41.25			Line Tot Lab Par Suble	or 135.00 ts 232.10
wiring repart Num 072601 0 113 542 0 During rou pinion sea	ther Description 12800 BULB 2w 17 07 TACH.CABLE Itine inspection the techniciar I to be leaking badly. Drain of th fresh fluid, spray clean are	QTY 3 1 n noted the d	List 3.30 222.20 differentia	Each 3.30 222.20 al inion	Total 9.90 222.20			Line Tota Lab Part Sublet	270.00 78.88
ncorrect.	8 20 6 46 PINION SEAL 108 REAR AXLE FLUID d the left rear heater hose(he Replace with new unit, replace	QTY 7 1 4 ead to heate	List 2,63 24.75 8,93 r core) to	Each 2.63 24.75 8.93 be	Total 18.41 24.75 35.72			Line Tota Labo	or 135.00
eplenishir Part Numi 113 831 0	ng coolant as necessary. Description	QTY 1	List 41.25	Each 41.25	Total 41.25			Part Sublet	

5565 Murray Road | Cincinnati, OH 45227-2707 513.271.5565 | Fax 513.271.8588 | <u>www.precisioncinci.com</u>

Invoic	e Total
Labor	\$3,521.00
Parts	\$1,071.15
Sublets	\$0.00
Supplies	\$24.87
Subtotal	\$4,617.02
T-ax-	\$297.51
Total	\$4,914.53

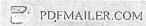

Service Invoice: 23155

-		**************************************					JOH ATO	C THEA OR	UU. 4.	
Name Address	Bateson,-Mr. Tim 2101 Kenskill Ave.	Company Address 2	Sugarcre	ek Packing		Created Time	10/06/11 2:31 PM	Year Make	1967 Mercede	es-Benz
						Invoiced		Model	250 SL	-5 -6112
	Washington Courthous, OH 4316					Advisor	Tyler	Lic.#		
Home		Hat#				Division	РM	Fleet#		
Work	740.335.0892 x1318	V.I.N. #	113043			PO#	I	Color	Dark Blu	ue
Fax		Chassis	113.043			Checked By		Miles in	19,27	1
		Eng#	129.982			Page#	4 of 7	Miles Out	19,27	
		J	ob Desc	ription						
113 997 113 997		1	1.65 7.15	1.65 7.15	1.65 7.15					
Replace a	accelerator pedal with new u	nit. This inc						Line To	tal	338.00
	ning lower anchor bracket.			Ŭ				La	bor	90.00
								Pa	arts	248.00
								Subl	ets	0,00
Part Nun	Vid Table 100 Person	QTY	List	Each	Total					
110 300 0			532.40	248.00	248,00					
Steering v	vheel is off-set 180 degrees. o shaft, checking for proper a	Remove s	teering w	heel				Line To Lai		284.52 270.00
whool are	norty installed shorts in 1-1-1-1	angriment.	vvitti Stee	ing					irts	14.52
wheel pro	perly installed, check vehicle	alignment.	Perform	1 Tour				Subl	2010000	0.00
wneel alig	nment, road test and check	operation, c).K.							
Part Num	=======	QTY	List	Each	Total					
111 464 0		3	4.84	4.84	14.52			11		
venicie ia	n out of fuel (though gauge i	ndicated a t	ruli tank).					Line To	2000	90.00
inspection	revealed the wires at the fue	el level send	ding unit	were				Lat Pa		90.00
reversea.	Correct wiring and check op	eration, o.k						Subl		0.00
								Odbii	510	0.00
 Disassem	ble, clean, and adjust throttle	linkage						Line To	tal	90.00
	,,, <u>-</u> <u>-</u> <u>-</u>							Lat	9388	90.00
								Pa	52511	0.00
								Suble	15000	0.00
			ü							
Ouring roa	d testing the technician note	d a noise in	the front	end				Line To	tall	20.00
similar to v	vorn wheel bearings. Raise	vehicle on I	ift remov	re				Lab	5510all	20.00
nub cans a	and inspect. The technician	found the li	ia nute o	า				Pa		0.00
noth front	wheels to be loose. Remove	all hub as	ig nais Ul	rauc				Suble		0.00
wheels to	spec.	ali nub ca	os and to	rque						
	istributor, clean and lubricate			idle.				Line To		315.00
≺oad test	extensively and set high end	mixture as	weil.					Lab		315.00
								Pai		0.00
								Suble	ets	0.00
Replace e	xternal shifter bushings, lubri	cate linkage	2					Line Tot	al	143.14
CPIGOC 6	mornar stricer bustilligs, lubit	cate illikayt	- .					Lab		135.00
Part Num!	ber Description	QTY	List	Each	Total			Par		8.14
112 268 0		2	4.07	4.07	8.14			Suble	ts	0,00

5565 Murray Road | Cincinnati, OH 45227-2707 513.271.5565 | Fax 513.271.8588 | <u>www.precisioncinci.com</u>

Invoice	Total
Labor	\$3,521.00
Parts	\$1,071.15
Sublets	\$0.00
Supplies	\$24.87
Subtotal	\$4,617.02
Tax	\$297.51
Total	\$4,914.53

PDFMAILER.COM

Precision Motorcars

Service Invoice: 23155

	Between Ma The		To.					ETHAOIC	
Name Address	Bateson, MrTim 2101 Kenskill Ave.	Company Address 2	Sugarcre	ek Packing		Created Time Invoiced	10/06/11 2:31 PM	Year Make Model	1967 Mercedes-Benz 250 SL
	Washington Courthous, OH 43	16				Advisor	Tyler	Lic.#	230 01
Home		Hat#				Division	PM	Fleet#	
Work	740.335.0892 x1318	V.I.N.#	113043			PO#		Color	Dark Blue
Fax	1	Chassis Eng#	113.043 129.982			Checked By	E of 7	Miles In	19,271
						Page#	5 of 7	Miles Out	19,271
The techn	ician noted the brake been		ob Desc					Line Test	400.0
	ician noted the brake boos the wrong brake booster h							Line Tot Lab	100
	ster, replace booster hose							Par	
	load test and check operat		ariit, biee	u				Suble	ts 0,0
	<u> </u>								
	pection the technician note							Line Tot	12.77
intact but v	very difficult to move. Rem	ove radio to 🤅	gain acce	ess				Lab	20
and free-u	p heater lever cables.							Par Suble	
								Ouble	0.0
During roa	id testing the technician no	ted the engin	e operati	ina				Line Tot	al 114,7
temperatu	re to be excessive. Replac	ce thermostat	top off	9				Lab	
	el, road test and check op		, top 011					Par	
								Suble	ts 0.0
Part Num 100 200 0		QTY	List 24.75	Each 24.75	Total 24.75				
	tine inspection the technici				24,10			Line Tot	al 70.4
was out of	adjustment, and contactin	athe lower ra	diator be	110101				Lab	720
	ect alternator belt to bring			J3G.				Par	
oosition.	out altornator port to pring	alternator bat	JK IIILO					Suble	ts 0.00
Part Num	ber Description	QTY	List	Each	Total				
001 997 3	7 92 BELT,10x900	1	24.20	24.20	24.20				
006 997 0		1	19.25	19,25	19.25				
Ineck and	l repair all exterior lighting : except headlamp high bea	as needed. A	III lights a	are				Line Tota Labo	
uncuonan	except neadlamp nigh bea	1115.						Pari	
Part Numi	ber Description	QTY	List	Each	Total			Sublet	127
072601 01		1	2.64	2.64	2.64				
roperly fit	and glue trunk seal into pl	ace.						Line Tota	al 54.00
	· ·							Labo	
								Part	
								Sublet	s 0.00
diust drive	er's door for better fit and c	losing sporet	ion					Line Tota	45.0
wjust urivi	or a good for perfet lif 9110 C	iosing operat	IOI I.					Line rota	
								Part	
								Sublet	

5565 Murray Road | Cincinnati, OH 45227-2707 513.271.5565 | Fax 513.271.8588 | www.precisioncinci.com

Invoice	Total
Labor	\$3,521.00
Parts	\$1,071.15
Sublets	\$0.00
Supplies	\$24.87
Subtotal	\$4,617.02
Tax ·	\$297.51
Total	\$4,914.53

C	Tr •	A A 4 # #
PRIMOP	Invoice:	16100
OF ATPR	THE A CITOO	

Bateson, Mr. Tim	Company	Sugarcreek Packing	Created	10/06/11	Year	1967
2101 Kenskill Ave.	Address 2	-	Time	2:31 PM	Make	Mercedes-Benz
			Invoiced		Model	250 SL
Washington Courthous, OH 4316		1	Advisor	Tyler	Lic.#	
	Hat#		Division	PM	Fleet#	
740.335.0892 x1318	V.I.N.#	113043	PO#		Color	Dark Blue
	Chassis	113.043	Checked By		Miles In	19,271
	Eng#	129.982	Page#	6 of 7	Miles Out	19,271
	2101 Kenskill Ave.	2101 Kenskill Ave. Washington Courthous, OH 4316 740.335.0892 x1318 Address 2 Hat# V.I.N. # Chassis	2101 Kenskill Ave. Address 2 Washington Courthous, OH 4316 Hat# 740.335.0892 x1318 V.I.N. # 113043 Chassis 113.043	2101 Kenskill Ave. Address 2 Washington Courthous, OH 4316 Hat# 740.335.0892 x1318 V.I.N. # 113043 Chassis 113.043 Checked By	2101 Kenskill Ave. Address 2 Washington Courthous, OH 4316 Hat# 740.335.0892 x1318 Address 2 Time Invoiced Advisor Tyler Division PM Y.I.N. # 113043 Chassis 113.043 Checked By	2101 Kenskill Ave. Address 2 Address 2 Time Invoiced Advisor Tyler Lic.# PM Fleet# 740.335.0892 x1318 V.I.N. # 113043 Chassis 113.043 Checked By Address 2 Time Invoiced Advisor Tyler Color Chassis 113.043 Checked By Miles In

		Jo	b Desci	iption			
Secure center cons	ole wood tray.					Line Total	22.50
						Labor	22.50
						Parts	0.00
						Sublets	0.00
The technician noted the locking fuel cap seal to be missing. as					Line Total	22.00	
the seal is no longer available, we robbed a seal from a more				Labor	0.00		
modern cap.						Parts	22.00
						Sublets	0.00
Part Number	Description	QTY	List	Each	Total		
124 470 00 05 *	FUEL CAP LATE STYLE	111	22,00	22.00	22.00		

NOTES:

42 - Parking Brake

The parking brake is inoperative. The cables would need to be replaced at a minimum. We would need to remove the rear pads and rotors to determine the condition, or existence, of shoes and adjusters.

86 - Windshield Washer System

The windshield washer system is inoperative. The arms and blades are missing. We would need to determine if the linkage and wiper transmissions are seized, and whether or not they can be freed up.

01 - Engine Housing

The engine has some oil leaks.

50 - Radiator

There is a slight coolant leak at the radiator drain. We have temporarily repaired this leak with an external sealant. If this leak were to worsen, we would recommend removal of the radiator for repair.

49 - Exhaust System

The exhaust system is an aftermarked straight-pipe set up. We would recommend returning the vehicle to a factory exhaust set up.

88 - Body

The hood fit should be addressed by a body shop. The hinge is damaged and the bolt threads are damaged.

91 - Seats

The driver's seat inner anchor bolt is stripped.


27 - Transmission, shifter

The neutral safety switch and cable are missing. As such, the reverse lights are inoperative.

54 - Electrical

5565 Murray Road | Cincinnati, OH 45227-2707 513.271.5565 | Fax 513.271.8588 | <u>www.precisioncinci.com</u>

Invoice Total				
Labor	\$3,521.00			
Parts	\$1,071.15			
Sublets	\$0.00			
Supplies	\$24.87			
Subtotal	\$4,617.02			
- Tax	- \$297.51			
Total	\$4,914.53			

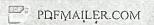

Print and send PDF files as Emails with any application, ad-sponsored and free of charge www.pdfmailer.com

Precision Motorcars

~	ਜ •	ANABE
O PORTICO	Invoice:	16100
DOI VICE	THE A CHEC.	

			~	JOI VICE RILY ORCE. BUILD			
Bateson, Mr. Tim	Company	Sugarcreek Packing	Created	10/06/11	Year	1967	
2101 Kenskill Ave.	Address 2		Time	2:31 PM	Make	Mercedes-Benz	
			Invoiced		Model	250 SL	
Washington Courthous, OH 4316			Advisor	Tyler	Lic.#		
	Hat#		Division	PM	Fleet#		
740.335.0892 x1318	V.I.N.#	113043	PO#		Color	Dark Blue	
	Chassis	113.043	Checked By		Miles In	19,271	
	Eng#	129.982	Page#	7 of 7	Miles Out	19,271	
	Bateson, Mr. Tim 2101 Kenskill Ave. Washington Courthous, OH 4316	Bateson, Mr. Tim 2101 Kenskill Ave. Washington Courthous, OH 4316 740.335.0892 x1318 Company Address 2 Hat# V.I.N. # Chassis	Bateson, Mr. Tim 2101 Kenskill Ave. Washington Courthous, OH 4316 Hat# V.I.N. # Chassis Company Address 2 Sugarcreek Packing Hat# V.I.N. # 113043 Chassis 113.043	Bateson, Mr. Tim Company Address 2 Sugarcreek Packing Created Time Invoiced Advisor Division PO# Chassis 113.043 Checked By	Bateson, Mr. Tim Company Sugarcreek Packing Created 10/06/11 Time 2:31 PM Invoiced Advisor Tyler Division PM Chassis 113.043 Checked By Checke	Bateson, Mr. Tim Company Address 2 Sugarcreek Packing Created 10/06/11 Year Time 2:31 PM Make Invoiced Advisor Tyler Lic.# Color Chassis 113.043 Checked By Miles In Created 10/06/11 Year Time 2:31 PM Make Invoiced Advisor Tyler Lic.# Color Checked By Miles In Color Checked By Miles In Color Checked By Checked By Color Checked By Checked	

Job Description

The horns are inoperative, as they are missing.

54 - Electrical

The radio is inoperative.

72 - Door Operation

The right side door is difficult to open from the outside. This can be resolved with an adjustment to the handle, which requires removal of the interior door panel to gain access.

5565 Murray Road | Cincinnati, OH 45227-2707 513.271.5565 | Fax 513.271.8588 | www.precisioncinci.com

Invoice Total				
Labor	\$3,521.00			
Parts	\$1,071.15			
Sublets	\$0.00			
Supplies	\$24.87			
Subtotal	\$4,617.02			
Tax	\$297.51			
Total	\$4,914.53			