

CUSTOMER #: 7403350892

977180



INVOICE

MIDWESTERN AUTO GROUP

SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME:740-335-0892 CONT:740-606-0348
BUS: 740-335-0892 CELL:740-606-0348

6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

PAGE 6

SERVICE ADVISOR: 5228 ANDREW CLUCK

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE:IN/OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		5000/20024	TG853	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
29OCT98 DL			17:00 30MAR20		0.00	CASH	17APR20
R.O. OPENED	READY	OPTIONS:					
11:32 15OCT19	09:31 17APR20						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
H							
COURTESY MULTI POINT INSPECTION ,TOP OFF ALL FLUIDS , ADJUST TIRE PRESSURES, MAKE SURE TO RESET ALL SERVICE LIGHTS AND INSTALL MAG LIC. PLATE FRAMES UNLESS OTHERWISE INSTRUCTED.							
CAUSE: MULTI POINT INSPECTION ROAD TEST BEFORE AND AFTER SERVICE MPI COURTESY MULTI POINT INSPECTION ,TOP OFF ALL FLUIDS , ADJUST TIRE PRESSURES, MAKE SURE TO RESET ALL SERVICE LIGHTS AND INSTALL MAG LIC. PLATE FRAMES UNLESS OTHERWISE INSTRUCTED.							
				113 CB		0.00	0.00

20024 BENTLEY VEHICLE INSPECTION OPERATIONS. 11/22/19 @ 3:48PM, STARTED VEHICLE INSPECTION OPERATIONS. CHECKING OIL LEAK/BURNING CONCERN BEFORE CONTINUING. 12/11/19 @ 1:57PM, PERFORMED VEHICLE INSPECTION OPERATIONS. PLEASE SEE HAND NOTES FOR VEHICLE DAMAGE AND SPECIFICATIONS. TIME SPENT ON GATHERING ESTIMATE INFORMATION FOR CLIENT. REQUEST THE FOLLOWING OPERATIONS BE PERFORMED: NEW EXHAUST SYSTEM, MAIN VEHICLE AND STARTER BATTERIES, AIRBAG IGNITER REPAIR FOR THE DRIVERS FRONT SEAT BUCKLE, OIL LEAKS FROM THE VALVE COVER/TIMING COVER AREAS, REQUEST DIAGNOSIS FOR THE BATTERY SWITCH OVER SOLENOID, FRONT AND REAR SUSPENSION OVERHAUL OPERATIONS, BLEEDING/FLUID FLUSH OF THE HYDRAULIC SYSTEM, ALIGNMENT OPERATIONS, TIRES DUE TO AGE (FROM 2010-2011), BOOT LID DAMPERS STARTING TO WEAKEN, LOWER OIL SUMP RESEAL, COOLANT FLUSH AND EXCHANGE OPERATIONS. 04/15/2020 @ 11:07AM, NOTED ON FINAL ROAD TEST THAT FAULT P0133 STORED IN THE ENGINE CONTROL MODULE. ESTIMATE PROVIDED FOR A NEW BANK ONE SENSOR ONE O2 SENSOR.

 I QUALITY CONTROL ROAD TEST--MILEAGE IN _____ MILEAGE
 OUT _____ SIGNATURE _____, MAKE SURE TO RESET ALL SERVICE LIGHTS, INSTALL MAG LIC. PLATE FRAMES UNLESS OTHERWISE INSTRUCTED.
 CAUSE: ROAD TEST VEHICLE PRIOR TO AND FOLLOWING SERVICE
 QC QUALITY CONTROL ROAD TEST--MILEAGE IN _____ MILEAGE
 OUT _____ SIGNATURE _____

CUSTOMER COPY

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DISCLAIMER OF WARRANTY	DESCRIPTION	TOTALS
The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assume nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts. *Indicates non genuine factory parts. A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS.	LABOR AMOUNT	
	PARTS AMOUNT	
	GAS, OIL, LUBE	
	SUBLET AMOUNT	
	MISC. CHARGES	
	TOTAL CHARGES	
CUSTOMER SIGNATURE	PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

CUSTOMER #: 7403350892

977180



INVOICE

MIDWESTERN AUTO GROUP

SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME:740-335-0892 CONT:740-606-0348
BUS: 740-335-0892 CELL:740-606-0348

6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

PAGE 7

SERVICE ADVISOR: 5228 ANDREW CLUCK

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE:IN/OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		5000/20024	TG853	
DEL DATE	PROD. DATE	WARR. EXP	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
29OCT98 DD			17:00 30MAR20		0.00	CASH	17APR20
R.O. OPENED	READY	OPTIONS:					
11:32 15OCT19	09:31 17APR20						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
						0.00	0.00

MAKE SURE TO RESET ALL SERVICE LIGHTS,
INSTALL MAG LIC.PLATE FRAMES UNLESS
OTHERWISE INSTRUCTED.

113 CB

20024 04/15/2020 @ 10:50AM, TOTAL OF 21 MILES DRIVEN ON VEHICLE
THIS VISIT. PLEASE NOTE THE VEHICLE ODOMETER RESET ITS TOTAL MILEAGE TO
0 AT SOME POINT FROM OUR REPAIR OPERATIONS PERFORMED IN 2014 THE
VEHICLE HAD 19910 MILES AND THE ODOMETER IS CURRENTLY AT 114. ADDING
THE TWO TOGETHER PUTS THE TOTAL VEHICLE OUT MILEAGE AT 20024.

J CLIENTS EMAIL
EMAIL CLIENTS EMAIL

113 CB

0.00 0.00

K** CLIENT STATES REPLACE MAIN AND STARTER BATTERIES PER INSPECTION.
1450 ELECTRICAL SYSTEM DIAGNOSIS/REPAIR

113 CB

205.95 205.95

2 *MTP-48H6 BATTERY MTP-48/H6 IBS

158.50 158.50 317.00

FAULTY MAIN VEHICLE BATTERY AND STARTER BATTERY. 2.00 03/09/2020 @
2:45PM DURING VEHICLE INSPECTION FOUND THE MAIN VEHICLE BATTERY TESTED
FAULTY WITH THE VAS 6161 TESTER AND THE STARTER BATTERY TESTED WEAK
WITH A PRODUCTION DATE OF 2012. PER CLIENT REQUEST REPLACED BOTH THE
MAIN AND STARTER VEHICLE BATTERIES. I WILL PERFORM POST ROAD TEST
OPERATIONS ONCE OTHER AUTHORIZED VEHICLE REPAIRS ARE PERFORMED.

L** CLIENT STATES REPLACE LOWER SUMP GASKET PER INSPECTION.
1200 ENGINE

113 CB

205.95 205.95

10 5W30ESP MOBIL 1 5W30ESP

9.70 9.70 97.00

LEAKING LOWER ENGINE OIL SUMP GASKET. 1.00 03/12/2020 @ 7:18PM,
DURING INSPECTION NOTED THE LOWER ENGINE OIL SUMP GASKET LEAKING. PER
CLIENT REQUEST DRAINED THE ENGINE OIL AND REMOVED THE LOWER OIL SUMP
PAN. CLEANED SEALING SURFACES AND INSTALLED NEW SEAL WITH MINOR

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DISCLAIMER OF WARRANTY	DESCRIPTION	TOTALS
<p>The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts. *Indicates non genuine factory parts.</p> <p>A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS.</p> <p>CUSTOMER SIGNATURE</p>	LABOR AMOUNT	
	PARTS AMOUNT	
	GAS, OIL, LUBE	
	SUBLET AMOUNT	
	MISC. CHARGES	
	TOTAL CHARGES	
	LESS INSURANCE	
	SALES TAX	
	PLEASE PAY THIS AMOUNT	

CUSTOMER #: 7403350892

977180



INVOICE

MIDWESTERN AUTO GROUP

6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME: 740-335-0892 CONT: 740-606-0348
BUS: 740-335-0892 CELL: 740-606-0348

PAGE 8

SERVICE ADVISOR: 5228 ANDREW CLUCK

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		5000/20024	TG853	
DEL DATE	PROD DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
29OCT98 DD			17:00 30MAR20		0.00	CASH	17APR20
R.O. OPENED	READY	OPTIONS:					
11:32 15OCT19	09:31 17APR20						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
APPLICATION OF SEALANT. TIGHTENED FASTENERS TO SPECIFICATION. I WILL NOW CONTINUE WITH OTHER APPROVED REPAIRS BEFORE FILLING ENGINE OIL AND PERFORMING A ROAD TEST.							

 M** CLIENT STATES PERFORM COOLANT RENEWAL OPERATIONS PER INSPECTION.
 1300 COOLING SYSTEM 617.85 617.85

113 CB
 COOLANT FLUSH, EXCHANGE OPERATIONS. 3.00 03/09/2020 @ 3:15PM,
 STARTED THE COOLANT EXCHANGE OPERATIONS FOR BOTH THE ENGINE AND TURBO
 COOLING CIRCUITS. 03/11/2020 @ 5:41PM, CONTINUED OPERATIONS FOR THE
 COOLANT SYSTEM FLUSHES. THERE IS NOW WATER ONLY IN BOTH THE MAIN AND
 TURBO COOLING CIRCUITS. WILL CONTINUE OPERATIONS IN THE MORNING.
 03/12/20 @ 5:28PM, FINISHED THE REQUIRED COOLING FLUID EXCHANGE
 OPERATIONS. FILLED SYSTEM TO SPECIFICATION WITH THE FACTORY RECOMMENDED
 G48 COOLANT. VERIFIED NO LEAKS POST REPAIRS.

MISC ADD FUEL	CB	25.00	25.00
MISC SHOP SUPPLIES			34.95

CUSTOMER COPY

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DISCLAIMER OF WARRANTY	DESCRIPTION	TOTALS
The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assume nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts. *Indicates non genuine factory parts.	LABOR AMOUNT	4819.96
	PARTS AMOUNT	1139.05
	GAS. OIL, LUBE	0.00
	SUBLET AMOUNT	0.00
	MISC. CHARGES	59.95
	TOTAL CHARGES	6018.96
A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS.	LESS INSURANCE	0.00
CUSTOMER SIGNATURE	SALES TAX	451.42
	PLEASE PAY THIS AMOUNT	6470.38

9/9 Bentley

Silver

997436



CUSTOMER #: 7403350892

INVOICE

SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME: 740-335-0892 CONT: 740-606-0348
BUS: 740-335-0892 CELL: 740-606-0348

MIDWESTERN AUTO GROUP
6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

PAGE 1

SERVICE ADVISOR: 5147 WILLIAM E GREGORY JR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		20029/20029	TB1934	
DEL DATE	PROD. DATE	WARR. EXP	PROMISED	PO. NO.	RATE	PAYMENT	INV. DATE
29OCT98 DE			17:00 30JUN20		0.00	CASH	22JUN20
R.O. OPENED	READY	OPTIONS:					
09:53 29APR20	09:18 22JUN20						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL

A CLIENT STATES CEL IS DISPLAYED. PLEASE CHECK AND ADVISE.
1200 ENGINE
113 CB
1 PB20364PA LAMBDA SENSOR PROBE RR 1132.73 1132.73
BENTLEY VEHICLE INSPECTION OPERATIONS. 05/21/2020 @ 11:00AM,
STARTED VEHICLE DIAGNOSIS FOR THE RETURNED AIRBAG WARNING DISPLAYED ON
THE DRIVERS INSTRUMENT CLUSTER. SCANNED VEHICLE FAULTS WITH THE LEGACY
SCANNER AND WROTE FAULTS DOWN ON THE INSPECTION HAND NOTES FOR RECORDS.
DISCOVERED AIRBAG SYSTEM FAULT 24FA0 "BUCKLE SWITCH DRIVES SIDE
RESISTANCE TOO HIGH- INTERMITTENT" STORED. THERE ARE NO MEASURED VALUES
AVAILABLE TO CHECK ON CURRENT RESISTANCE READINGS. WENT UNDER THE SEAT
AND UNPLUGGED CONNECTOR X1285 FOR THE DRIVERS SEAT BELT BUCKLE SWITCH.
AFTER PERFORMING A FEW KEY CYCLES I FOUND THE INTERMITTENT 24FA0 FAULT
CHANGED TO A 24F20 "BUCKLE SWITCH DRIVER RESISTANCE TOO HIGH" (FAULT
CHANGED TO STATIC INSTEAD OF INTERMITTENT). BELIEVE THERE IS A FAULTY
TERMINAL CONNECTION ON THE X1285 CONNECTOR, TO FURTHER INSURE I SHORTED
BOTH SIGNAL WIRES TOGETHER AT THE X1285 HOUSING. THIS IS SENDING THE
RESULT OF SEAT BELT BUCKLED/UNBUCKLED TO THE AIRBAG CONTROL MODULE AND
NO FURTHER FAULTS ARE PRESENT IN THE SYSTEM. AT THIS TIME I AM GOING TO
ELIMINATE THE X1285 CONNECTOR. PLEASE NOTE I HAVE ALSO LOCATED P.S.I.S.
DOCUMENT 750600B0001 FOR THIS ISSUE. THE BULLETIN OPERATIONS WOULD
REQUIRE 6.0 HOURS LABOR TO PERFORM AN OVERLAY AND ELIMINATE ALL
CONNECTORS IN THE SEAT BELT BUCKLE CIRCUITS. IF THIS AIRBAG WARNING
FAULT RETURNS WE WILL HAVE TO DO THE COMPLETE BULLETIN OPERATIONS. I
WILL NOW BEGIN DIAGNOSIS FOR ENGINE CONCERN. 05/21/2020 @ 12:42PM, AS
MENTIONED ON PREVIOUS REPAIR ORDER THE BANK ONE SENSOR ONE OXYGEN
SENSOR IS FAULTY. PER CLIENT REQUEST PART HAS BEEN ORDERED. THIS VISIT
I HAVE ALSO FOUND THE MAIN VEHICLE BATTERY IS AGAIN LOW ON VOLTAGE. I
WILL BE REQUESTING ADDITIONAL DIAGNOSTIC TIME FOR AN QUIESCENT DRAW
TEST OPERATIONS. 06/19/2020 @ 3:04PM, PERFORMED MULTIPLE QUALITY
CONTROL ROAD TESTS AND A TOTAL OF 35 MILES HAS BEEN DRIVEN ON THE
VEHICLE DURING THIS VISIT. THE VEHICLE STILL HAS SPORADIC WARNINGS
DISPLAYED FOR THE BRAKE LIGHTS, AUTO RIDE CONTROL. ALSO THE BRAKE WEAR
WARNING IS STILL ON. FOUND THE AIR CONDITIONING WAS NOT OPERATING ON

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

DISCLAIMER OF WARRANTY
The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assume nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts. *Indicates non genuine factory parts.

A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS.

CUSTOMER SIGNATURE

CUSTOMER #: 7403350892

997436



SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME: 740-335-0892 CONT: 740-606-0348
BUS: 740-335-0892 CELL: 740-606-0348

INVOICE

MIDWESTERN AUTO GROUP
6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

PAGE 2

SERVICE ADVISOR: 5147 WILLIAM E GREGORY JR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		20029/20029	TB1934	
DEL DATE	PROD DATE	WARR EXP	PROMISED	PO NO	RATE	PAYMENT	INV DATE
29OCT98 DD			17:00 30JUN20		0.00	CASH	22JUN20
R.O. OPENED	READY	OPTIONS:					
09:53 29APR20	09:18 22JUN20						

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

POST ROAD TEST, LATER DISCOVERED THE A/C PRESSURE SWITCH WAS UNPLUGGED. ONCE PLUGGED IN THE SYSTEM OPERATIONS RETURNED TO NORMAL.

B CLIENT STATES SMOKE COMING FROM EXHAUST AND INTAKE TUBES DAMP WITH OIL. PLEASE CHECK AND ADVISE.

1200 ENGINE

113 CB

65 G-052-167-S0 ENGINE OIL 0.00 0.00 0.00

ADDED 05W-40 OIL TO THE ENGINE. NO FURTHER CORRECTIONS, OPERATIONS PERFORMED AT THIS TIME. 0.00 0.54 0.50 32.50

05/21/2020 @ 2:12PM, TIME SPENT GATHERING ESTIMATE INFORMATION.

06/19/2020 @ 2:54PM, UPON UNPACKING DISCOVERED THE ORDERED BREATHER ASSEMBLY IS ACTUALLY ONE OF THE OIL SEPARATOR CYCLONES. WRONG PART ORDERED, RECHECKED CATALOG AND AGAIN CONFIRMED THE BREATHER ASSEMBLY PART NUMBER PB28573PA IS DISCONTINUED. THE VALVE ASSEMBLY CAN NO LONGER BE REPLACED. IN AN ATTEMPT TO HELP THE BANK ONE TURBO CHARGER WE HAVE DECIDED TO PUT A THICKER OIL IN THE ENGINE. THIS MAY HELP THE TURBO IMPELLER SEAL NOT LEAK AS MUCH HOWEVER THIS IS IN NO FORM AN REPAIR FOR THE CONCERN. DRAINED ENGINE OIL AND PUT 05W-40 MOBILE ONE OIL IN THE ENGINE. IF THE ISSUE PERSISTS I WOULD SUGGESTS TRYING 10W-40(50) OR TO PERFORM THE BANK ONE TURBO CHARGER REPLACEMENT OPERATIONS.

C** AIG BAG LAMP ON
1000 SERVICE MENUS
113 CB

CUSTOMER COPY

ELIMINATED CONNECTOR X1285 FROM THE SEATBELT BUCKLE SWITCH CIRCUIT. 0.00 0.00

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DISCLAIMER OF WARRANTY The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assume nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts. *Indicates non genuine factory parts. A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS. CUSTOMER SIGNATURE	DESCRIPTION	TOTALS
	LABOR AMOUNT	
	PARTS AMOUNT	
	GAS, OIL, LUBE	
	SUBLET AMOUNT	
	MISC. CHARGES	
	TOTAL CHARGES	
	LESS INSURANCE	
	SALES TAX	
	PLEASE PAY THIS AMOUNT	

CUSTOMER #: 7403350892

997436



SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME: 740-335-0892 CONT: 740-606-0348
BUS: 740-335-0892 CELL: 740-606-0348

INVOICE

MIDWESTERN AUTO GROUP
6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

PAGE 3

SERVICE ADVISOR: 5147 WILLIAM E GREGORY JR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		20029/20029	TB1934	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
29OCT98 DD			17:00 30JUN20		0.00	CASH	22JUN20
R.O. OPENED	READY	OPTIONS:					
09:53 29APR20	09:18 22JUN20						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
0.00	06/19/2020	@ 3:00PM,	VERIFIED THE AIRBAG WARNING FAULT CAME ON FOR THE DRIVERS FRONT SEAT BELT BUCKLE SWITCH. THE FAULT IS FOR HIGH RESISTANCE ON THE CIRCUIT. VERIFIED THE INTEGRITY OF THE CIRCUIT FROM CONNECTOR X1285 TO THE AIRBAG CONTROL MODULE. BELIEVE THE CONNECTOR TERMINALS ARE CAUSING THE ISSUE. LOCATED P.S.I.S 750600B001 AND CONFIRMED MY DIAGNOSIS. AT THIS TIME ELIMINATED AIRBAG SEAT BELT BUCKLE CONNECTOR X1285 AND SLICED THE WIRES TOGETHER. IF THE WARNING RETURNS IN THE FUTURE I WOULD SUGGEST THE COMPLETE P.S.I.S 750600B001 OPERATIONS BE PERFORMED.				

 D** CLIENT REQUEST CRANK CASE BREATHER REPLACEMENT
 1000 SERVICE MENUS
 113 CB
 PART NOT AVAILABLE, NO OPERATIONS PERFORMED. 0.00 06/18/2020 @ 10:57AM, WE HAD ORDERED PART NUMBER PB26532PA "OIL SEPERATOR BREATHER" PER CLIENT REQUEST. TODAY AFTER OPENING THE PACKAGE I DISCOVERED THAT THE PART NUMBER IS FOR THE BANK ONE OIL CYCLONE. RECHECKED PARTS AND FOUND THE REQUIRED BREATHER ASSEMBLY PART NUMBER PB28573PA "COVER INLET MANIFOLD V8" IS STILL DISCONTINUED. NO FURTHER OPERATIONS TO BE PERFORMED AT THIS TIME. PLEASE SEE LINE B FOR REMAINING INFORMATION PERTAINING TO THE OIL IN INTAKE.

 E** CLIENT REQUEST O2 SENSOR REPLACEMENT
 1000 SERVICE MENUS
 113 CB
 FAULTY BANK ONE SENSOR ONE OXYGEN SENSOR. 0.50 06/19/2020 @ 2:50PM, PREVIOUSLY NOTED O2 SENSOR SLOW RESPONSE CODE STORED. PRE CLIENT REQUEST REPLACED THE BANK ONE SENSOR ONE OXYGEN SENSOR.

 F** CLIENT REQUEST PARISID DRAW TEST
 1000 SERVICE MENUS
 113 CB
 1 999-611-105-01 BATTERY
 AFTERMARKET RADIO CAUSING DRAIN ON THE MAIN VEHICLE BATTERY. 5.00

CUSTOMER COPY

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	1029.75
LESS INSURANCE	
SALES TAX	20.11
PLEASE PAY THIS AMOUNT	13.53
	1029.75
	13.53

DISCLAIMER OF WARRANTY
 The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assume nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts.
 *Indicates non genuine factory parts.
 A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS.

CUSTOMER SIGNATURE

CUSTOMER #: 7403350892

997436



SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME: 740-335-0892 CONT: 740-606-0348
BUS: 740-335-0892 CELL: 740-606-0348

INVOICE

MIDWESTERN AUTO GROUP
6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

PAGE 4

SERVICE ADVISOR: 5147 WILLIAM E GREGORY JR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		20029/20029	TB1934	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
29OCT98 DD			17:00 30JUN20		0.00	CASH	22JUN20
R.O. OPENED	READY	OPTIONS:					
09:53 29APR20	09:18 22JUN20						

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

06/10/2020 @ 4:57PM, NOTED THE NEWLY INSTALLED BATTERY WAS FAULTY WITH 0 VOLTS. PER CLIENT REQUEST BEGAN THE PARASITIC DRAW TEST OPERATIONS AND USED OUR DIGITAL OSCILLOSCOPE TO RECORD THE RESULTS. AFTER 17.5 MINUTES THE VEHICLE SHUT DOWN TO A AMPERAGE READING OF .16 AMPS AND DID NOT REDUCE ANY FURTHER. PLEASE NOTE THE PARASITIC DRAW SPEC IS NO MORE THAN .05 AMPS. BEGAN TO CHECK FUSES AND CIRCUITS TO LOCATE THE CAUSE OF THE DRAW, AT THIS TIME THE CAUSE IS UNKNOWN. WILL RETURN TOMORROW TO CONTINUE DIAGNOSIS. 06/11/2020 @ 11:42AM, CONTINUED OPERATIONS THIS MORNING AND TRACED VOLTAGE DROPS BACK TO THE AFTER MARKET RADIO ASSEMBLY AT ITS FUSE CONNECTIONS UNDER THE FRONT PASSENGERS FLOOR BOARD. REMOVED RADIO FUSES ONE AT A TIME AND FOUND AFTER REMOVING THE 5 AMP FUSE THE AMPERAGE DRAW REDUCED WITHIN SPECIFICATION. REINSTALLED ALL VEHICLE ELECTRICAL COMPONENTS EXCLUDING THE ONE 5 AMP FUSE, FOUND THE VEHICLE PARASITIC DRAW IS NOW WITHIN SPECIFICATION WITH A READING OF .02-.03 AMPS. DISCOVERED NO SOUND FROM THE RADIO DUE TO SPEAKER WIRES UNPLUGGED FROM THE AMPLIFIER. PLUGGED IN AMPLIFIER WIRES AND FOUND RADIO OPERATIONS TO SPECIFICATION.

MISC SHOP SUPPLIES

34.95

CUSTOMER COPY

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DISCLAIMER OF WARRANTY	DESCRIPTION	TOTALS
<p>The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assume nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts. *Indicates non genuine factory parts.</p> <p>A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS.</p> <p>CUSTOMER SIGNATURE</p>	LABOR AMOUNT	2162.48
	PARTS AMOUNT	456.51
	GAS, OIL, LUBE	0.00
	SUBLET AMOUNT	0.00
	MISC. CHARGES	34.95
	TOTAL CHARGES	2653.94
	LESS INSURANCE	0.00
	SALES TAX	199.05
	PLEASE PAY THIS AMOUNT	2852.99

CUSTOMER #: 7403350892

903822

INVOICE

MIDWESTERN AUTO GROUP
6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME: 740-335-0892 CONT: 740-335-0892
BUS: 740-335-0892 CELL: 740-606-0348

PAGE 1

SERVICE ADVISOR: 5228 ANDREW CLUCK

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		79/83	T900	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
29OCT98 DD			17:00 30JAN18		0.00	CASH	03FEB18
R.O. OPENED	READY	OPTIONS:					
14:41 18JAN18	08:05 03FEB18						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CUSTOMER STATES THERE IS AN AIRBAG LIGHT
1100 MAINTENANCE/ DIAGNOSIS/ REPAIR
5136 CB 180.00 180.00
1 PC21081PA ABS SENSOR REAR 247.96 247.96
1.00 TECHNICIAN FOUND DRIVERS SEAT BELT BUCKLE TO HAVE HIGH
RESISTANCE, AND NEEDS REPLACED. BUCKLES HAVE BEEN UPDATED AND MUST BE
DONE AS A SET NOW. CUSTOMER HAS DECLINED.

B ANTI LOCK BRAKE SYSTEM DIAGNOSIS
1000 SERVICE MENUS
5136 CB 1080.00 1080.00

83 6.00 TECHNICIAN FOUND FAULTS FOR RR WHEEL SPEED SENSOR HIGH
RESISTANCES, TECHNICIAN FOUND WIRING HARNESS DAMAGED, TECHNICIAN
OVERLAID WIRING HARNESS TEST DROVE AND FOUND LIGHT TO RETURN UPON
VEHICLE SCAN TECHNICIAN FOUND L/R WHEEL SPEED SENSOR HARNESS IS NOT
PROPERLY ROUTED, RUBBING ON AXLE AND PROTECTIVE HARNESS COVERING IS
BRAKING CAUSING A INTERMITTENT SHORT. TECHNICIAN REPLACED L/R WHEEL
SPEED SENSOR AS WELL.

C CUSTOMER STATES DRIVER SIDE VALVE COVER IS LEAKING OIL
NWP NO WORK PERFORMED AT THIS TIME
5136 CB 0.00 0.00

83 1.00 TECHNICIAN FOUND FRONT COVER AND REAR MAIN SEAL LEAKING OIL
CUSTOMER DECLINED

D PERFORM CAMPAIGN R201
OC CHECK FOR OPEN CAMPAIGNS
5136 WB (N/C)
1 PC60047PA KIT PIPES & RESERVOIR LHD (N/C)
83 2.80 TECHNICIAN COMPLETED R201 INSTALL UPDATED MASTER CYCLE
RESERVOIR.

E QUALITY CONTROL ROAD TEST--MILEAGE IN _____ MILEAGE
OUT _____ SIGNATURE _____, MAKE SURE TO RESET

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DISCLAIMER OF WARRANTY	DESCRIPTION	TOTALS
The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assume nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts. *Indicates non genuine factory parts.	LABOR AMOUNT	
	PARTS AMOUNT	
	GAS, OIL, LUBE	
	SUBLET AMOUNT	
	MISC. CHARGES	
	TOTAL CHARGES	
A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS.	LESS INSURANCE	
CUSTOMER SIGNATURE	SALES TAX	
	PLEASE PAY THIS AMOUNT	

CUSTOMER #: 7403350892

903822



INVOICE

MIDWESTERN AUTO GROUP
6335 Perimeter Loop Rd. DUBLIN, OHIO 43017
(614) 889-2571
www.magcars.com

SUGAR CREEK PACKING
2202 KENSKILL AVE
WASHINGTON COURT HOUSE, OH 43160-914
HOME: 740-335-0892 CONT: 740-335-0892
BUS: 740-335-0892 CELL: 740-606-0348

PAGE 2

SERVICE ADVISOR: 5228 ANDREW CLUCK

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
SILVER	99	BENTLEY ARNAGE	SCBLB51E3XCX01934		79/83	T900	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
29OCT98 DD			17:00 30JAN18		0.00	CASH	03FEB18
R.O. OPENED	READY	OPTIONS:					
14:41 18JAN18	08:05 03FEB18						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

ALL SERVICE LIGHTS, INSTALL MAG LIC.PLATE FRAMES UNLESS OTHERWISE INSTRUCTED.

CAUSE: ROAD TEST VEHICLE PRIOR TO AND FOLLOWING SERVICE
QC QUALITY CONTROL ROAD TEST--MILEAGE IN
MILEAGE

OUT SIGNATURE

MAKE SURE TO RESET ALL SERVICE LIGHTS,
INSTALL MAG LIC.PLATE FRAMES UNLESS
OTHERWISE INSTRUCTED.

5136 CB

0.00 0.00

 
F** CUSTOMER STATES REPAIR THE LEFT REAR WHEEL SPEED SENSOR
1100 MAINTENANCE/ DIAGNOSIS/ REPAIR

5136 CB

0.00 0.00

MISC SHOP SUPPLIES

29.99



CUSTOMER COPY

*Non Genuine Factory Parts

Thank you for bringing your vehicle to
Midwestern Auto Group for service.

DISCLAIMER OF WARRANTY
The seller, Midwestern Auto Group, hereby disclaims all warranties, either expressed or implied including any implied warranty of merchantability or fitness for a particular purpose, and Midwestern Auto Group neither assume nor authorizes any other person to assume for it any liability in connection with the sale of materials and/or parts. *Indicates non genuine factory parts.

A CHARGE FOR HAZARDOUS WASTE MANAGEMENT MAY BE ADDED TO CONFORM WITH CITY, STATE AND FEDERAL REGULATIONS.

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	1260.00
PARTS AMOUNT	247.96
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	29.99
TOTAL CHARGES	1537.95
LESS INSURANCE	0.00
SALES TAX	115.35
PLEASE PAY THIS AMOUNT	1653.30

MIDWESTERN AUTO GROUP
6335 PERIMETER LOOP RD.
DUBLIN, OH 430171116

827

02/06/2018

09:07:06

CREDIT CARD

MC SALE

Card #	XXXXXXXXXXXX9195
Network:	MASTERCARD
SEQ #:	1
Batch #:	1156
INVOICE	1
Approval Code:	090690
Entry Method:	Manual
Mode:	Online
Tax Amount:	\$0.00
Cust Code:	1

SALE AMOUNT

\$1653.30

CUSTOMER COPY