

10/20/25, 11:40 AM

Invoice: Suncoast Porsche Parts & Accessories



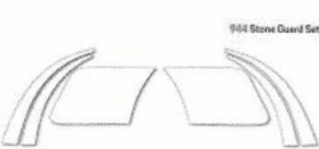
Order Confirmation #1205788

Placed: 10/20/2025 15:41:55 UTC

SHIP TO:

BILL TO:

ORDER SUMMARY

Product	Quantity	Subtotal
 944 Stone Guard Set SUNCOAST STONE GUARD FILM SET (944) ITEM: PK944FILM Status:	1	\$119.95
Subtotal: 1 Item		\$119.95
Shipping: UPS Ground		\$16.27
Sales Tax		\$10.90
Payment: PayPal		(\$147.12)
TOTAL		\$147.12

Flat Edge Autoworks
 3062 Ann Smith Drive, Suite 101
 Bluffton, SC 29910
 (843) 505-7482
 flatedgeautoworks@gmail.com



INVOICE

INVOICE TO

INVOICE NO 3431
INVOICE DATE 08/21/2025

VEHICLE DESCRIPTION	VIN	MILEAGE
1990 944 S2 Cab	WP0CB294XLN481018	71,793

SERVICE DATE	ITEM	DESCRIPTION	QTY/HR	RATE	SUBTOTAL
	Labor	Replaced rear wheel studs with longer studs for spacers. (customer supplied)	3	160.00	480.00
	Labor	HVAC Clip for blend door is broken. causing door to not shut off correctly.	1	160.00	160.00
	Retainer for A/C Evaporator Case	944-572-314-00	1	2.53	2.53T
	Labor	Customer states the central locking button is red all the time. Found fuse F8 to be blown. replaced fuse and locked door with key, fuse blows immediately. Found shorted circuit board on alarm module. Replaced control unit and retested. Operates as normal.	2.50	160.00	400.00
	Labor	Found low temp fan switch to not be operating only high temp. Replaced auxiliary fan switch.	0.50	160.00	80.00

Invoice Number 3431

	Auxiliary Fan Switch - 85 deg. C	951-606-481-00-85	1	51.38	51.38T
	Alarm Control Unit (911,928,944,968)	928-637-104-05	1	213.42	213.42T
	Body Side Moulding, Left	931-559-133-01	1	152.87	152.87T
	Body Side Moulding, Right	931-559-134-01	1	150.87	150.87T
	Body Fender Side Molding S2	944-559-137-00	2	114.14	228.28T
	Quarter Panel Side Moulding Left	931-559-141-00	1	55.43	55.43T
	Quarter Panel Side Moulding Right	931-559-142-00	1	55.43	55.43T
	Adhesive Tape for Door Protection	931-559-165-00	2	31.39	62.78T
	Adhesive Tape Side Guard Wing	944-559-177-00	2	2.53	5.06T
	Adhesive Tape. Body, Frame, Moulding, Trim.	931-559-182-00	2	5.62	11.24T
	Shop Supplies	Oil Disposal, Shop Supplies	1	10.00	10.00

NOTES

SUBTOTAL.....2,119.29

TAX.....59.36

TOTAL.....2,178.65

BALANCE DUE.....\$0.00



3908 Ogeechee Road
Savannah, GA 31405
(912) 417-4353

Invoice

Date	Invoice #
11/27/2024	JF7838

Name / Address

Vehicle Info
1990 944 S2 Cab Silver WP0CB294XLN481018 SILVER Miles

P.O. No.	Tech	Tech 2
	OPEN	

Item	Description	Qty	Rate	Total
Cust Issue	Mileage in 69888 Install New Windshield - Has Trim and Glass ready to go. Done	1	0.00 0.00	0.00 0.00

	Subtotal
	Sales Tax (0.0%)
	Total
	Payments/Credits
	Balance Due



3908 Ogeechee Road
Savannah, GA 31405
(912) 417-4353

Invoice

Date	Invoice #
11/27/2024	JF7838

Name / Address

Vehicle Info
1990 944 S2 Cab Silver WPOCB294XLN481018 SILVER Miles

P.O. No.	Tech	Tech 2
	OPEN	

Item	Description	Qty	Rate	Total
	1. Install windshield. Marvin has trim. Done 2. Passenger seat fore and aft movement malfunction. Repair. Done 3. Remove instrument cluster, replace lighting with LED lights, Repair fuel gauge. It does not read. If you tap it, it responds and then goes back to E. Talk to Marvin about fuel gauge done 4. Oil change with 20w50 Castrol GTX oil. We have filters here. Marvin will decide on viscosity. Done 5. Power steering fluid exchange. It is currently contaminated with brake fluid Done 6. Temperature creeps up. Perform coolant exchange and replace coolant expansion tank. Tank ordered from SSF Done 7. Replace shifter boot provided by Marvin Done 8. Passenger side dash trim. Make sure clock functions. Done 9. One brake light is out, repair. Done PARTS ORDERED FOR CAR			

	Subtotal
	Sales Tax (0.0%)
	Total
	Payments/Credits
	Balance Due



3908 Ogeechee Road
Savannah, GA 31405
(912) 417-4353

Invoice

Date	Invoice #
11/27/2024	JF7838

Name / Address

Vehicle Info
1990 944 S2 Cab Silver WP0CB294XLN481018 SILVER Miles

P.O. No.	Tech	Tech 2
	OPEN	

Item	Description	Qty	Rate	Total
Parts	S2 PHHI Door Lock Switch 951-613-147-00-01C list \$105.30	1	85.55	85.55T
Parts	S2 and racecar SSF Windshield Seal 99354192500 One for racecar and one damaged	2	44.49	88.98T
Sublet	WINDSHIELD REPLACEMENT RR windshield and Trims for 944S2 cab - Installed OEM Glass - Porsche HHI	1	379.00	379.00
Parts	S2 PHHI Windshield 941-541-011-10 list \$1226.58	1	1,018.89	1,018.89T
Parts	PHHI Windshield Seal 99354192500	1	92.20	92.20T
Repair Labor	COOLANT EXPANSION TANK INSTALLATION AND COOLANT EXCHANGE Drained the coolant. Removed and replaced the coolant expansion tank. Refilled with coolant and bled the system. Monitore the temperature for fan operation.	1.5	118.00	177.00
Parts	SSF 94410612506 Coolant Exp tank 944S2 List \$328.53	1	250.90	250.90T
ANTIFREEZE	Green Antifreeze per Gallon	2.2	24.99	54.98T
Repair Labor	POWER STEERING FLUID DECONTAMINATION AND EXCHANGE Evacuated the power steering reservoir. Ran the car to pump out as much fluid as possible. Evacuated reservoir again. Added Dexron III fluid and ran the car.	1.5	118.00	177.00

	Subtotal
	Sales Tax (0.0%)
	Total
	Payments/Credits
	Balance Due



3908 Ogeechee Road
Savannah, GA 31405
(912) 417-4353

Invoice

Date	Invoice #
11/27/2024	JF7838

Name / Address

Vehicle Info
1990 944 S2 Cab Silver WP0CB294XLN481018 SILVER Miles

P.O. No.	Tech	Tech 2
	OPEN	

Item	Description	Qty	Rate	Total
Parts	Dexron Power Steering Fluid qt	2	11.49	22.98T
Repair Labor	DASHBOARD TRIM INSTALLATION			
	Tested the clock. It works as designed. Removed the Air Conditioning control face plate to gain access to the trim piece. Installed the trim piece and reinstalled all removed.	0.5	118.00	59.00
Parts	S2 PPHI Switch plate trim 944-552-436-00-1DB list \$68.33	1	59.76	59.76T
Parts	S2 PPHI Knob Switch for Blower 944-653-207-00-01C list \$47.38	1	43.49	43.49T
Repair Labor	OIL SERVICE			
	Drained the oil and replaced the filter. Refilled with oil. Inspected the car for any other needs that are not on the list. None found at this time. Checked oil level, level is good.	1	118.00	118.00
POR OC142	OC142 or H14W25 PORS 944	1	14.13	14.13T
Castrol GTX 20W...	Castrol GTX 20W50	6.5	9.85	64.03T
Shop Supplies	Shop Supplies	1	35.00	35.00
	PASSENGER SEAT DIAGNOSTIC, SHIFT BOOT INSTALL AND BRAKE LIGHT BULB			

	Subtotal
	Sales Tax (0.0%)
	Total
	Payments/Credits
	Balance Due



3908 Ogeechee Road
Savannah, GA 31405
(912) 417-4353

Invoice

Date	Invoice #
11/27/2024	JF7838

Name / Address

Vehicle Info
1990 944 S2 Cab Silver WP0CB294XLN481018 SILVER Miles

P.O. No.	Tech	Tech 2
	OPEN	

Item	Description	Qty	Rate	Total
Repair Labor	Inspected the passenger seat. Determined it requires a cable. Drivers seat requires the bushing kit. Installed shift boot. Replaced blown brake light.	1	118.00	118.00
Parts	Shift boot supplied by client	1	0.00	0.00T
Parts	Brake light bulb	1	1.99	1.99T
	PASSENGER SEAT REPAIR			
Repair Labor	Removed the passenger seat. Removed and replaced the broken flexible drive shaft for the fore and aft movement motor. Removed the worn bushings and installed new bushings to eliminate the free play movement in the seat mechanism. Reinstalled the seat. Seat functions as designed.	3.5	118.00	413.00
Parts	SSF Seat Flexible Drive Shaft 92852125204 list \$95.46	1	95.46	95.46T
Parts	AONED 12PC Electric Front Seat Bushing Repair Kit for Porsche 964/993 911	1	19.70	19.70T
	DRIVERS SEAT REPAIR			
Repair Labor	Removed the drivers seat. Removed seat rails for rebushing. Removed and replaced the bushings. Reinstalled the rails and reinstalled the seat. Seat slop is taken care of.	3.5	118.00	413.00

	Subtotal
	Sales Tax (0.0%)
	Total
	Payments/Credits
	Balance Due



3908 Ogeechee Road
Savannah, GA 31405
(912) 417-4353

Invoice

Date	Invoice #
11/27/2024	JF7838

Name / Address

Vehicle Info
1990 944 S2 Cab Silver WPOCB294XLN481018 SILVER Miles

P.O. No.	Tech	Tech 2
	OPEN	

Item	Description	Qty	Rate	Total
Parts	AONED 12PC Electric Front Seat Bushing Repair Kit for Porsche 964/993 911	1	19.70	19.70T
Repair Labor	STAINLESS EXHAUST INSTALLATION Removed the existing exhaust. Fitted the stainless steel exhaust and bolted it together. Everything fit properly and no additional parts were needed.	0.8	118.00	94.40
Parts	Exhaust supplied by client	1	0.00	0.00T
Repair Labor	INSTRUMENT CLUSTER REPAIR Removed steering wheel to gain access to instrument cluster. Removed trim and then the cluster to be sent to Nichols. Reinstalled the refurbished instrument cluster. Reinstalled all removed. Scanned for air bag code. Cleared the code. Cleared any other codes. Test drove. Fuel gauge functions properly and Speedometer reads accurately.	2	118.00	236.00
Sublet	NS 944S2 Instrument Cluster repair.	1	370.71	370.71
Shipping	Shipping	1	36.95	36.95
Parts	AZ LED Instrument panel light bulbs ZEVO 2825 list \$40.55	1	22.79	22.79T

Subtotal		\$4,582.59
Sales Tax (0.0%)		\$0.00
Total		\$4,582.59
Payments/Credits		\$0.00
Balance Due		\$4,582.59

Flat Edge Autoworks
 3062 Ann Smith Drive, Suite 101
 Bluffton, SC 29910
 (843) 505-7482
 flatedgeautoworks@gmail.com



INVOICE

INVOICE TO

INVOICE NO 2649
INVOICE DATE 05/28/2024

VEHICLE DESCRIPTION	VIN	MILEAGE
1990 944 S2 Cab	WP0CB294XLN481018	68,518

SERVICE DATE	ITEM	DESCRIPTION	QTY/HRS	RATE	SUBTOTAL
	Labor	Timing belt and chain guide repairment. Replace fault camshaft pickup sensor when valve cover is removed. Replace distributor cap , rotor, spark plugs, ignition wires, engine filter, flush brake fluid	12	125.00	1,500.00T
	Timing Belt Kit (944 S2-968)	TB 152-293 K1	1	600.91	600.91T
	Timing Chain Tensioner Rail (lower)	944-105-949-00	1	146.69	146.69T
	Rubber Grommet for Valve Cover Bolt	928-104-115-02	13	2.89	37.57T
	Valve Cover Gasket (944S2 968)	928-104-447-09	1	30.99	30.99T
	Spark Plug Hole Seal (in Valve Cover)	928-104-443-08	4	3.68	14.72T
	O-Ring for Valve Cover (17 X 2.5 mm)	900-174-056-40	2	1.84	3.68T
	Camshaft Position Sensor (928,944,968)	944-606-170-02	1	245.79	245.79T

	Distributor Cap (944 S2-968)	928-602-211-01	1	160.53	160.53T
	Ignition Rotor (944 S2-968)	944-602-213-01	1	95.08	95.08T
	Spark Plug Wire Set (944 S2)	10 8533 602	1	275.09	275.09T
	Spark Plug - Denso XU22EPR-U (3179)	999-170-129-90	4	10.80	43.20T
	Air Filter (944 S2)	944-110-166-00	1	29.00	29.00T
	Brake Fluid (street cars)	000-043-210-82	1	43.44	43.44T
	Oil Filter 944	944-107-201-09	1	29.87	29.87T
	5W40-LM MOLYGEN	LM 20232	7	13.75	96.25T
	Aluminum Washer (22 X 27 X 1.5 mm)	900-123-118-30	1	1.13	1.13T
	Labor	Replace leaking power steering fluid tank	1	125.00	125.00T
	Reservoir with Cap - Power Steering Fluid	928-347-015-05	1	45.35	45.35T
	R134a refrigerant	R134a	1.5001234	40.53	60.80T
	Labor	Replaced front shock absorbers. (Customer supplied parts) Replaced rear shocks.	3.50	125.00	437.50T
	Concave Spring Seat Washer (944)	133-412-341	2	94.54	189.08T
	Shock Absorber Rear (944 M474) Koni	951-333-032-01	2	282.36	564.72T
	Labor	Perform chassis alignment.	3	125.00	375.00T
	Shop Supplies	Oil Disposal, Shop Supplies	2	10.00	20.00T

NOTES

SUBTOTAL.....5,171.39
TAX.....189.97
TOTAL.....5,361.36

BALANCE DUE.....\$0.00



Pelican Parts
 1600 240th Street
 Harbor City, CA 90710
 310-626-8765
 www.pelicanparts.com

Bill of Sale

Date: 11/16/23
 Invoice No: 1700145364-156



Phone #	Payment	Sales Rep	Shipping Methods	Car Type
910-420-1011	PayPal	OL	FEDEX_GROUND	

QTY	Status	Part Number	Description	Unit Price	Amount
2	Packed & Shipped	40718A-M14	Wiper Blade - 18" - Bosch "MICRO EDGE" (Front Left or Right)	8.39	16.78
2	Packed & Shipped	944-107-201-09-OEM	Oil Filter	20.85	41.70
1	Packed & Shipped	944-110-166-00-OEM	Air Filter	27.15	27.15
1	Packed & Shipped	944-538-041-01-M100	Kit E-538-041-99N: Key Head (with Light), Brand: Genuine Porsche Brand: Genuine Porsche	41.25	41.25
1	Packed & Shipped	944-538-331-00-M100	Kit E-538-041-99N: Key Blank for Lighted Key Head Brand: Genuine Porsche	10.75	10.75

Shipping & Handling 0.00
 Sales Tax Rate: 7% 9.63

Thank you for your support!

Total: 147.26

Any problems or questions about this order?
 Just give us a call toll-free at: 1-888-280-7799

Paid via PayPal \$147.26

Date	Invoice	Mileage	Service
01/11/18	23353	66616	OIL SERVICE CHECK ODOMETER - R & R AND REPL GEAR CHECK W.W. SQUIRTERS - FOUND BATTERY PINCHING HOSE - REPOSITIONED BATTERY ODOMER GEAR 220X22 94410720108 OIL FILTER 5W40 SYNTHETIC OIL AL WASHER
03/23/15	22153	63995	OIL SERVICE 5W40 SYNTHETIC OIL AL WASHER SOLVENT 94410720190 OIL FILTER WASHER PUMP GROMMET 92862817201 WASHER PUMP replace washer pump repair pass seat motor front to back oil leak was drain plug
02/01/13	21142	63995	REPL CRANKSHAFT POSITION SENSOR REFERENCE SENSOR
12/28/12	21087	63995	99361522700 FUEL PUMP RELAY diagnose & replace fuel pump relay
01/27/09	16535	64580	replace timing belts 94410532302 CAMSHAFT BELT 94410221904 BAL SHAFT BELT BELT 6PK1000 BELT
11/17/08	16432	63995	R & R ODOMETER FOR REPAIR OIL SERVICE REPL HOOD STRUTS REPAIR C-CLIP FOR THE BATTERY GROUND WIRE BRAKE FLUID 12 OZ. 40719 WIPER BLADE AIR FILTER 94410720108 OIL FILTER 94451135101 HOOD STRUT Sublet: odo repair brake fluid flush repl air filter last t belt replacement?
12/15/06	11824	63995	CRANKSHAFT SEAL WARRANTEE PARTS CHARGE ADJUSTMENT
12/15/06	11795	63995	CK OIL LEAK / REPLACE REAR MAIN SEAL, CLUTCH & STA RTER 99911342641 CRANKSHAFT SEAL 93110211100 PILOT BEARING KF78201 CLUTCH KIT SR39X STARTER
10/20/05	11049	63995	477955481 WASHER CHECK VALVE 91462843300 WASHER CHECK VALVE 92862817201 WASHER PUMP REPL WASHER PUMP AND CHECK VALVES REPAIR SEAT
01/03/05	10538	63542	OIL SERVICE AL WASHER MOBIL ONE 15W50 OIL 94410720108 OIL FILTER