

ALL CARS AUTO CARE  
115 W CENTRAL AVE  
EDGEWATER, MD 21037  
410/956-7688

05/05/2025 16:10

Sale

Trans Number: 5  
Batch #: 125001

VISA Manual  
\*\*\*\*\*7015 \*\*/\*\*

AMOUNT: \$1439.50

Resp: APPROVED

Code: 017710

Ref #: 31710652

CVV Rsp: M-Match

AVS Rsp: Y-Addr&Zip Match

Thank You!

CUSTOMER COPY

VIN:  
Vehicle: 1934 Dodge  
Deluxe 0L,  
USA/Canada

License: 201447  
Fleet No.: 3754018

Odometer:  
Customer ALL TIRE

Notes: PREASSURES  
CHECKED/DOWN  
TO 20PSI/FILLED  
TO 30PSI LET SIT  
OVERNIGHT TO  
CHECK FOR  
SLOW LEAK/ SO  
FAR ALL  
PREASSURES  
HOLDING AND  
VALVE  
CORE/STEMS  
NOT LEAKING

Invoice: 002638  
Created: 05/05/2025 4:11 PM  
Printed: 05/05/2025 4:11 PM  
Technician(s): BERT  
Written by: CARA  
Payment(s): Visa \$1439.5

DIAGNOSE REPAIR FUEL GAUGE ON DASH NOT REGISTERING LEVEL

Number	Type	Part#/Op Code	Description	Quantity	Unit Price	Total Cost
1	Labor		DIAGNOSE FUEL LEVEL READING NOT WORKING AT ALL			\$ 154.95
2	Labor		PULL TANK AND INSTALL SENDING UNIT SUPPLIED BY CUSTOMER. FIRST ONE WAS FAULTY/DAMAGED IN TRANSPORT.			\$ 464.85
3	Fee			1.00	\$ 20.00	\$ 20.00

Note: NO GROUND WIRE WAS INSTALLED WHEN FUEL TANK PREVIOUSLY REPLACED. CORK FLOAT LEVEL ALSO WAS NO GOOD. UPPER SHIELD NEEDED A RELIEF CUT/SPACE AVAILABLE FOR SENDER NOT TO CONTACT UPPER SHIELD

Job Total: \$ 639.80

Signature:

*Paid By Phone* (Signature)

Date: 5.5.25

**INSTALL NEW FUEL PUMP ASSEMBLY FURNISHED BY CUSTOMER**

Number	Type	Part#/Op Code	Description	Quantity	Unit Price	Total Cost
1	Labor		INSTALL NEW FUEL PUMP ASSEMBLY/PREVIOUS PUMP LEAKING OUT OF WEEP HOLE			\$ 154.95

**Job Total: \$ 154.95****CHECK OUT BRAKES/LOW PEDAL AND NO STOPPING POWER**

Number	Type	Part#/Op Code	Description	Quantity	Unit Price	Total Cost
1	Part		BRAKE FLUID/ MASTER CYLINDER SUPPLIED BY CUSTOMER	1.00	\$ 25.00	\$ 25.00
2	Labor		INSTALL MASTER CYLINDER AND ADJUST ALL FOUR WHEEL BRAKE ADJUSTMENT/BLEED ENTIRE SYSTEM			\$ 387.38

**Job Total: \$ 412.38****FIGURE OUT FRONT HEADLIGHT ISSUES WITHG RIGHT HEADLAMP/LEFTR SIDE HAD A BAD BULB. BOTH LAMPS NEEDED SOME WIRING DONE**

Number	Type	Part#/Op Code	Description	Quantity	Unit Price	Total Cost
1	Part		FRONT BULBS SUPPLIED BY CUSTOMER	0.00	\$ 0.00	\$ 0.00
2	Labor		REPLACE/REPAIR FRONT HEADLAMPS TO OPERATE PROPERLY			\$ 154.95

**Job Total: \$ 154.95****ADJUST PASSENGER DOOR GAP**

Number	Type	Part#/Op Code	Description	Quantity	Unit Price	Total Cost
1	Labor		ADJUST PASSENGER DOOR GAP FORWARD DOOR TO A PILLAR GAP			\$ 46.49

**Job Total: \$ 46.48**

Signature: \_\_\_\_\_

Date: \_\_\_\_\_

Total Jobs Cost: \$ 1,408.56

Parts	\$ 25.00
Labor	\$ 1,363.56
Tax	\$ 3.17
Shop Supplies & Hazardous Materials	\$ 27.77
Fees	\$ 20.00
<b>Grand Total</b>	<b>\$ 1,439.50</b>
Balance Due	\$ 0.00

I have received the above goods and/or services. If this is a credit card purchase, I agree to pay and comply with my cardholder agreement with the issuer.

*A finance charge of 1.5%/mo (18% annual rate) will be charged on all past due accounts. All parts are new unless otherwise specified. Re-check torque after the first 50 to 100 miles of service.*

Signature: \_\_\_\_\_

Date: \_\_\_\_\_