



3908 Ogeechee Road  
 Savannah, GA 31405  
 (912) 417-4353

# Invoice

Date	Invoice #
1/25/2023	JF5860

Name / Address
HAGERTY Attn: Accounts Payable PO BOX 87 Traverse City, MI 49685

Vehicle Info
2010 Dodge Viper 1B3AZ6EZ6AV100159 Metallic orange

P.O. No.	Tech	Tech 2
	David	

Item	Description	Qty	Rate	Total
Cust Issue	Mileage in 7669 1. Lift inspection 2. Service all fluids 3. Tire estimate 4. Trunk lock repair/replacment 5. Steering column clamshell	1	0.00	0.00
Repair Labor	INITIAL INSPECTION AND WASH Test drive and under car inspection. The differential is making some noise. Step one would be a fluid service. Transmission fluid looks great. Oil needs to be changed and battery requires replacement. There is damage to the passenger side exhaust exit in the rocker panel. Superficial and only cosmetic. Trunk lock cylinder requires replacement. Ignition lock is malfunctioning. It sometimes does not turn the car off. Ignition lock suggested. The car needs tires.	1	105.00	105.00
Sublet	PREWASH VIPER Car came in very dirty. Washed car and cleaned engine bay. Vehicle will need a detail prior to sale. TRUNK ACCESS	1	45.00	45.00

	<b>Subtotal</b>
	<b>Sales Tax (7.0%)</b>
	<b>Total</b>
	<b>Payments/Credits</b>
	<b>Balance Due</b>



3908 Ogeechee Road  
 Savannah, GA 31405  
 (912) 417-4353

# Invoice

Date	Invoice #
1/25/2023	JF5860

Name / Address
HAGERTY Attn: Accounts Payable PO BOX 87 Traverse City, MI 49685

Vehicle Info
2010 Dodge Viper 1B3AZ6EZ6AV100159 Metallic orange

P.O. No.	Tech	Tech 2
	David	

Item	Description	Qty	Rate	Total
Repair Labor	SEE BELOW WITH REPAIR BATTERY INSTALLATION	0	105.00	0.00
Repair Labor	Installed new battery once trunk was accessible. Removed panel in trunk to gain access to battery. Replaced battery and reinstalled panel. Car Starts as designed.	0.5	105.00	52.50
Parts	TPH ACDelco BAttery GR34S list \$146.67	1	140.99	140.99T
Repair Labor	OIL SERVICE Oil service. Drained oil and replaced oil filter. Filled with 5w40 oil and adjusted other fluids as needed. Ran engine and then checked oil level. Vehicle is ready to be driven.	1	105.00	105.00
Parts	AZ Mobil One Oil Filter m1-210 lit \$26.43	1	19.59	19.59T
5W40	Total 5w40 Euro 9000 Synth Engine Oil	11	11.85	130.35T
Shop Supplies	Shop Supplies	1	35.00	35.00
Parts	TPH Air Filter AF3961 list \$41.99	1	33.99	33.99T
	DIFFERENTIAL SERVICE			

	<b>Subtotal</b>
	<b>Sales Tax (7.0%)</b>
	<b>Total</b>
	<b>Payments/Credits</b>
	<b>Balance Due</b>



**3908 Ogeechee Road  
Savannah, GA 31405  
(912) 417-4353**

# Invoice

Date	Invoice #
1/25/2023	JF5860

Name / Address
HAGERTY Attn: Accounts Payable PO BOX 87 Traverse City, MI 49685

Vehicle Info
2010 Dodge Viper 1B3AZ6EZ6AV100159 Metallic orange

P.O. No.	Tech	Tech 2
	David	

Item	Description	Qty	Rate	Total
Repair Labor	Removed under car splash shield for differential. This gave us access to the differential to perform the service. Drained fluid out of differential. Refilled with 75w140 GL5 with LSD additive. Reinstalled splash shield and test drove. Much better a second service needs to be performed. Performed second service and test drove and added fuel. Differential is fine.	2.4	105.00	252.00
Parts	AZ Valvoline SynPower 75w140 synthetic gear oil	4	23.99	95.96T
Parts	AZ K&W Limited Slip Additive 2508 list \$27.16	2	24.99	49.98T
Fuel Charges	Fuel Charges	1	30.02	30.02
Repair Labor	IGNITION LOCK AND STEERING COLUMN CLAMSHELL REPAIR Removed broken pieces of steering column clamshell. Inspected ignition lock. lubricated lock. Ignition lock functions as designed. Installed new steering column clamshell Upper and Lower - Please note Ignition lock sometimes will stick on key removal and not fully shut car down	1.2	105.00	126.00
Parts	SOC Steering cloumn shroud UC77DX9AA list \$22.00	1	20.60	20.60T
Parts	SOC Steering Column Shroud UC78DX9AA list \$22.00	1	20.60	20.60T

	<b>Subtotal</b>
	<b>Sales Tax (7.0%)</b>
	<b>Total</b>
	<b>Payments/Credits</b>
	<b>Balance Due</b>



3908 Ogeechee Road  
 Savannah, GA 31405  
 (912) 417-4353

# Invoice

Date	Invoice #
1/25/2023	JF5860

Name / Address
HAGERTY Attn: Accounts Payable PO BOX 87 Traverse City, MI 49685

Vehicle Info
2010 Dodge Viper 1B3AZ6EZ6AV100159 Metallic orange

P.O. No.	Tech	Tech 2
	David	

Item	Description	Qty	Rate	Total
Repair Labor	DECK LID LATCH ADJUSTMENT AND DECK LID LOCK CYLINDER REPLACEMNT REAR TRUNK STUCK SHUT - key lock had something jammed in and damaged lock cylinder and clearly damaged latch mech - Managed to get trunk lid open - Inspected deck lid latch. Made adjustments to latch and found the cable that goes to the lock cylinder to be out of position. Disconnected the cable and now the latch functions as designed. Trunk can be accessed with the vehicle remote. Removed deck lid lock cylinder. Cut apart to get lock cylinder and wafers out of the damaged part. Keyed new lock cylinder with wafers removed from old lock cylinder. Lubricated and built deck lick lock assembly. Installed in deck lid lock cylinder and adjusted. Decklid opens and closes as designed.	4	105.00	420.00
Parts	SOC Deck Lid Lock Cylinder 4778147 list \$59.20 CHECK ENGINE LIGHT DIAGNOSTIC AND REPAIR	1	55.10	55.10T

	<b>Subtotal</b>
	<b>Sales Tax (7.0%)</b>
	<b>Total</b>
	<b>Payments/Credits</b>
	<b>Balance Due</b>



3908 Ogeechee Road  
 Savannah, GA 31405  
 (912) 417-4353

# Invoice

Date	Invoice #
1/25/2023	JF5860

Name / Address
HAGERTY Attn: Accounts Payable PO BOX 87 Traverse City, MI 49685

Vehicle Info
2010 Dodge Viper 1B3AZ6EZ6AV100159 Metallic orange

P.O. No.	Tech	Tech 2
	David	

Item	Description	Qty	Rate	Total
Repair Labor	Test drove car and check engine light came on. Differential sounds better but the car needs to be driven more. Scanned car for codes and found two. Performed diagnostics on reverse lock out code. Checked fuses and wiring to solenoid. The wiring to the solenoid rubbed against transmission and frayed apart. Repaired and lenthened wiring harness. Cleared codes and test drove. Reverse lock out code did not return.	2.5	105.00	262.50
Shop Supplies	Shop Supplies wiring pieces FINAL TEST DRIVE and Delivery to Warehouse	1	10.00	10.00
Repair Labor	Test drove car. It drove well and did not recode. Dropped car at Warehouse for Final detail FINAL DETAIL	0.5	105.00	52.50

	<b>Subtotal</b>	\$2,062.68
	<b>Sales Tax (7.0%)</b>	\$39.70
	<b>Total</b>	\$2,102.38
	<b>Payments/Credits</b>	\$0.00
	<b>Balance Due</b>	\$2,102.38