

PALMA AUTO REPAIR LLC
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
PHONE (856) 547-6522 FAX (856) 546-6137

Repair Order # **0026272**

Date: 4/2/2025 Page 1 of 3

Orig Est #: 0003463 Center :

Customer's	Vehicle : 1982 ROLL Silver spur	Key# :
Address :	License :	
City :	VIN : SCAZS42A3CCX04038	
Phone 1 :	Fleet #:	Trans : THM400 - 3
Phone 2 :	Engine : V8-6750CC 6.8L OHV	CODE :
	Mileage :	

Tech	Job Description	Qty	Part Number	Part Description	Reason for Replacement	Labor	Parts Price	Subtotal
TSB	INSULATE EGR HEAT SHIELD, BURNING A HOLE IN THE HOOD INSULATION PAD, CAN CAUSE A FIRE IF THERE WERE INSULATION PAD UNDER HOOD, ALL THREE ARE MISSION ON THE UNDERSIDE OF HOOD. INSTALLED FIBERGLASS PAD UNDER MEDAL HEAT SHIELD.					157.50		157.50
MSK	EMISSION AIR PUMP ONE WAY CHECK VALVES NEED RENEWING, OVER 30.000 MILE SERVICE FOR REPLACEMENT, CAN CAUSE A FIRE UNDER HOOD IF NOT REPLACED.					112.50	296.56	409.06
	2.00	UE 43666		CHECK VALVE, EMISSION A			188.26	
		Location:		TFC 4				
	1.00	UE 43505		HOSE, AIR PUMP/VALVE			108.30	
MSK	RENEWED DRIVER'S SIDE VIEW MIRROR GLASS ASSEMBLY.					112.50	100.00	212.50
	1.00	CD 6395 USED		GLASS, LEFT SIDE VIEW			100.00	
MSK	DRIVER'S FRONT WINDOW IS NOT OPERATING PROPERLY, MOVING VERY SLOWLY, NECESSARY TO HELP PULL THE WINDOW GLASS UP. REMOVED DOOR PANEL TO INSPECT. FOUND A SPUN LOWER CHAIN SPROCKET. NECESSARY TO REMOVE THE WINDOW LIFT MOTOR GEAR BOX ASSEMBLY TO REMOVE THE SPUN CHAIN SPROCKET SILENT BLOCK BONDED BUSHING SLEEVE FROM THE MAIN LOWER DRIVE IN GEAR BOX TO REPLACE LOWER CHAIN SPROCKET. NEED TO REMOVE GEAR BOX TO PRESS OF OLD SPROCKET AND PRESS ON NEW SPROCKET. RENEW OLD GREASE AND REPLACE IT WITH NEW MOLLY TYPE GREASE. LUBRICATE MOTOR DRIVE GEAR CHAIN AND CHANNEL GUIDES.					450.00	488.57	938.57
	1.00	UD 71409 ELEC MOTOR		RUBBER COUPLER			21.60	
		Location:		CA603				
	1.00	UD 72131		SPROCKET & BUSH ASSEMBLY			466.97	
		Location:		CA603				
MSK	COWL VENT FILTER REPLACEMENT, NECESSARY TO CLEAN OUT DRAINS. RENEWED WITH UPDATED METAL MESH SCREEN, WHICH REPLACE THE OLD FOAM TYPE. ALSO REPLACED WASHER JET AND WIPER ARM BUMP STOP.					270.00	364.55	634.55
	1.00	UB 71168 EXT BODY		MEDAL,COWLFILTER RH			152.30	
		Location:		BFC-3				
	1.00	UB 71169 EXT BODY		MEDAL,COWL FILTER LH			152.30	
		Location:		BCF-3				
	1.00	UD 23155		STOP WIPER ARM			25.25	
		Location:		GFC-5				
	1.00	UD 23128 EXT BODY		JETWASHER,WINDSHIELD			34.70	
		Location:		GFC-7				
MSK	TEST HYDRAULIC ACCUMULATOR PRESSURES 850PSI ON BOTH, BUILD UP TO 2400PSI & CONTROLLING.					157.50	35.49	192.99
	1.00	UT 13741PAR		MINERAL FLUID			35.49	
TSB	EVACUATE AND RECHARGE A/C SYSTEM WITH DYE TO CHECK FOR LEAKS. FOUND PROBLEM WITH STRIPPED SHADER VALVE ON TOP OF VIR ASSEMBLY. CAN'T BE FIXED. REPLACE ADAPTER WITH A NEW TYPE ON TOP OF VIR AND LEFT THE 134 FITTING. EVACUATE AND RECHARGE A/C SYSTEM AGAIN, FOUND TWO LEAKS IN AC COMPRESSOR					450.00	60.15	510.15
	1.00	209578		A/C VALVE CORE			2.15	
	2.00	RED R/12		RETROFIT R/12 CAN			50.00	
	1.00	OIL CHARGE		OIL AND DYE			8.00	
TSB	CHECK A/C & HEATING SYSTEM, NECESSARY TO REMOVE CARPET SURROUND COVERING A/C SERVO ON TOP OF TRANSMISSION TUNNEL TO INSPECT FLAP ACTUATORS. FOUND SYSTEM IS CONTROLLING CORRECTLY, ALL FLAPS ARE MOVING CORRECTLY. FOUND PROBLEM WITH HEATER CONTROL VALVE. LEAKING INTERNALLY, CAUSING UNCONTROLLED HOT AIR TO COME OUT OF VENTS. REPLACED WITH A MANUAL SHUT OFF LEVER VALVE AND REPLACED ANTIFREEZE.					832.50	73.39	905.89
	1.00	HEATER CONTROL		MANUEL SHUT OFF			22.99	
	8.00	ANTIFREEZE EXT. LIFE		50/50 MIX. ANTI. QT.			50.40	
MSK	RE FASTEN BOTH LOWER SILL MOLDING. INSTALLED MALE & FEMALE CLIPS.					225.00	8.02	233.02

PALMA AUTO REPAIR LLC
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
PHONE (856) 547-6522 FAX (856) 546-6137

Repair Order # 0026272

Date: 4/2/2025 Page 2 of 3

Orig Est #: 0003463 Center :

Customer's	Vehicle : 1982 ROLL Silver spur	Key# :
Address :	License :	
City :	VIN : SCAZS42A3CCX04038	
Phone 1 :	Fleet #:	Trans : THM400 - 3
Phone 2 :	Engine : V8-6750CC 6.8L OHV	CODE :
	Mileage :	

Tech	Job Description	Qty	Part Number	Part Description	Reason for Replacement	Labor	Parts Price	Subtotal
		2.00	UB 12419	INSERT FEMALE, MOLDING C			2.84	
	Location:			BIN12				
		2.00	UB 12418	DRIVE FASTENER			5.18	
	Location:			BIN12				
MSK	PASSENGER'S REAR DOOR, WONT STAY CLOSE. WILL BE NECESSARY TO REMOVE DOOR PANEL TO INSPECT FOR LINKAGE OR BAD LATCH. REMOVED ALL LINKAGE TO LATCH AND STILL HAVE THE SAME PROBLEM. NEED TO REPLACE THE DOOR LATCH ASSEMBLY.					450.00	350.00	800.00
		1.00	UB 38968 USED	ASSY LOCK DOOR			350.00	
TSB	COOLING SYSTEM, INSTALLED LATE STYLE UPDATED ENGINE COOLING FAN BLADE.					122.50	550.00	672.50
		1.00	3Z0198250	ENGINE FAN BLADE			550.00	
	Location:			SH 15				
MSK	MINERAL OIL LEAKING ON TOP OF DRIVER'S SIDE EXHAUST MUFFLER AND BURNING OFF TOP OF MUFFLER. REMOVE HEAT SHIELD ABOVE THE MUFFLER TO INSPECT. FOUND A LOOSE HYDRAULIC MEDAL LINE AT JUNCTION BLOCK, TIGHT MEDAL LINE GOING INTO JUNCTION BLOCK.					337.50		337.50
MSK	CHECK GEAR SHIFT SELECTOR INDICATOR LIGHT LED BULB. NECESSARY TO REMOVE STEERING COLUMN TOP COWLING AND INDICATOR PLATE TO TIGHTEN SCREW BASE BULB. REPLACED SELECTOR INDICATOR PLATE.					112.50	10.02	122.52
		1.00	UD15848	LED BULB DASH BOARD & GE.			10.02	
MSK	THIRD BRAKE LIGHT, REMOVE REAR ASSEMBLY FROM REAR PARCEL SHELF AND REPLACE PLASTIC BULB SOCKET WITH A NEW UPDATED MEDAL SOCKET.					12.25	23.04	35.29
		1.00	1156	BULB			3.00	
		1.00	SOCKET	SINGLE ELEMENT SOCKE			20.04	
MSK	CHECKED REVERSE LIGHT BULBS & SOCKETS, FOUND NO PROBLEM IN CONNECTION ON BULB SOCKET OR BULBS. NO POWER TO REVERSE LIGHT SOCKETS WHEN SELECTED.					52.50		52.50
JDP	RESEAL REAR WINDOW SURROUND SEAL.					0.00		
MSK	TIRES ARE THE CORRECT SIZE, 235/70/15, BUT ARE OLD, AND DRY ROTTED, CRACKED ALL OVER. NEEDS TO BE REPLACED. REPLACED CUSTOMER'S FOUR BLACK WALL TIRE AND VALVE STEMS, ALSO INSPECT SPARE. TIRE IS OLD BUT IS LIKE NEW AND THE CORRECT SIZE.					450.00	22.50	472.50
		3.00	2080-8	VALVE STEM			22.50	
MSK	SPEEDOMETER REPAIR, REMOVE TO HAVE FOR REPAIRED & REINSTALL					275.00		275.00
JDP	SPEEDOMETER SHOP.					700.00		700.00
JDP	UPS FREIGHT, SPEEDOMETER TO CALIFORNIA DELIVERY.					86.00		86.00
MSK	REMOVE OLD HOOD INSULATION FROM ONE OF OUR PARTS CAR AND INSTALLED TO UNDER SIDE OF HOOD THAT ARE MISSING.					225.00	200.00	425.00
		1.00	USED	HOOD INSULATION			200.00	
JDP	COMPLETE INTERIOR AND EXTERIOR DETAILING.					225.00		225.00
JDP	UPS FREIGHT, DELIVERY.					75.00		75.00

PALMA AUTO REPAIR LLC
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
PHONE (856) 547-6522 FAX (856) 546-6137

Repair Order # **0026272**
 Date: 4/2/2025 Page 3 of 3
 Orig Est #: 0003463 Center :

Customers:	Vehicle : 1982 ROLL Silver spur	Key# :
Address	License :	
City	VIN : SCAZS42A3CCX04038	
Phone 1	Fleet #:	
Phone 2	Engine : V8-6750CC 6.8L OHV	Trans : THM400 - 3
	Mileage :	CODE :

Tech	Job Description	Labor	Parts	Subtotal
Qty	Part Number	Part Description	Reason for Replacement	Price

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 90 DAYS OR 4000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X _____

Labor :	\$5,030
Parts :	\$2,582
Sublet :	\$861
Other Fees :	\$0
SUPPLY CHARG	\$10
Subtotal :	\$8,483
Sales Tax :	\$550
Total :	\$9,033
Paid :	\$6,768
Due :	\$2,265

Signature X _____