

AUTO MASTERS INC.
P.O. Box 444
Ellensburg, WA 98926
Phone: 509-925-7998 Fax: 509-925-1218

INVOICE
72675
Orig. Est. # 072723

INVOICE

Reprint

Printed Date: 03/26/2026

Work Completed: 03/26/2026

1974 Chevrolet - Pickup K10 - 5.7L V8 (350CI) VIN(V)
Lic # : 0507P Odometer In : 64289

VIN # : CCY244Z158512

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Brake Fluid 18789	1.00	8.75	8.75	**CHECK BRAKE PULL Found right rear brake drum was wet. Wheel cylinders were leaking.	434.00
Gasoline 5555	1.00	23.00	23.00	Replaced rear wheel cylinders and brake shoes. Flushed brake system. Was not getting any fluid from left front. Found brake hose was plugged. Replaced left front brake hose.	
Fuel Line Hose H-177	8.00	3.32	26.56	**HOOK UP FUEL LINES Drained fuel from tanks. Had about 1 gallon in right hand tank. Left hand tank was empty. Rubber fuel lines to tank from selector valve were hard and brittle. Replaced rubber hoses to tank from selector valve. Replaced rubber hose from valve to hard line on frame. Fuel right hand tank. Left hand tank has locking cap. Engine runs--volume of fuel from pump to carburetor appears low.	560.00
Battery Cable GT272B	1.00	61.85	61.85	Replaced fuel pump and filter. Fuel tank selector valve is operating correctly. Test drove vehicle.	
Battery Cable GT238B	1.00	44.28	44.28	**CORRECT BATTERY CABLE CONNECTIONS. Replaced battery cables. The battery that is in the vehicle is the incorrect group size. If battery is replaced, it should be a group size 24. Replaced battery.	140.00
Brake Hose BH86550	1.00	38.25	38.25		
Fuel Filter 33032	1.00	12.34	12.34		
Brake Shoes 473	1.00	52.41	52.41		
Seat 2081	2.00	12.51	25.02	Red brake light is on. Right rear brake drum is wet. Suspect cylinders are leaking.	
Wheel Cylinder WC79767	2.00	21.43	42.86		
Fuel Pump MT6011	1.00	32.05	32.05		
Hose Clamp 118789	7.00	1.75	12.25		
Battery 24GHR	1.00	172.84	172.84		
Shop Supplies			25.00		

AUTO MASTERS INC
208 N KITTITAS ST
ELLENSBURG, WA 98926-30
509-925-7998

DEBIT SALE

REF# 00000001
ZACH B 485 RPN 40755725
BALANCE 085735
APPR CODE 408759
TAX 1
COST 9644
AMOUNT \$1,858.65

APPROVED

US DEBIT
AD: A000000000000000
TVR: 80 80 04 90 00
TS: 98 00

THANK YOU
CUSTOMER COPY

Email Address:

AUTO MASTERS INC.
P.O. Box 444
Ellensburg, WA 98926
Phone: 509-925-7998 Fax: 509-925-1218

INVOICE
73529
Orig. Est. # 073583

Printed Date: 09/01/2026 Work Completed: 09/01/2026

INVOICE

Bennett, Jess
9291 Wilson Creek Rd
Ellensburg, WA 98926
Cell: 509-899-2127

1974 Chevrolet - Pickup K10 - 5.7L, V8 (350CI) VIN(V)
Lic #: 0507P Odometer In: 64306
VIN #: CCY244Z158512

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Gasoline	1.00	35.00	35.00	**CHECK FUEL GAUGE AND FUEL TANK SELECTOR	870.00
5555				Removed selector switch-power goes to selector valve. Fuel gauge	
Bulb	3.00	1.68	5.04	has power to selector switch. Right hand tank reads open	
168				resistance. Resistance changes when wiggling wire. Blue wire to	
Fuel Sending Unit	1.00	109.22	109.22	driver side tank reads around 100 ohms (indicating full). 0 ohms is	
692-073				empty. When moving wires around, the resistance would also	
Fuel Sending Unit	1.00	127.39	127.39	change. Fuel gauge did not change if open or grounded. Has	
692-043				problem with gauge or printed circuit board. Had poor wire	
Instrument Cluster (Used)	1.00	315.03	315.03	connections to senders. Removed fuel tanks and replaced sending	
18316				units. Replaced fuel gauge and cluster. Left hand tank was empty.	
Shop Supplies			21.75	Right hand tank was almost full. After replacing fuel gauge, right	
				hand shows full and left hand shows empty. Added fuel to left tank.	
				Gauge reads about 1/4 full.	

AUTO MASTERS INC
208 N KITTITAS ST
ELLENSBURG, WA 98926-30
509-925-7998

DEBIT SALE

Batch #: 577 REF#: 00000003
09/02/26 RR#: 90221049
APPR CODE: 564498 142048

Trace: 3
DEBIT Chip
*****0644
AMOUNT \$1,611.00

APPROVED

US DEBIT
AD: A0000000980840
TVR: 80 80 04 80 00
TSR: 68 00

THANK YOU
CUSTOMER COPY

Labor: 870.00
Parts: 613.43
SubTotal: 1,483.43
Tax: 127.57
Total: 1,611.00
Bal Due: \$1,611.00

Customer Number: 7837

Vehicle Received: 7/7/2026

I hereby authorize the above repair work to be done as
described on street, highways or elsewhere for the full
amount of repairs thereon. Warranty on parts and lab
cost of repair.

A finance charge of 1.5 percent per month (18.00 per

Signature _____

at due (0.50 minimum)

Date _____

Email Address: automastersinc@elltel.net

Service Advisor: Borger, Chet, Tech.

Page 1 of 1

Copyright (c) 2026 Mitchell Repair Information Company, LLC. Invert 5.122 by



1206 S Canyon Road
Ellensburg, WA 98926
509-260-4331

Store: 339
Invoice: 33901223580
Salesperson: Amanda B

Customer Information

Customer ID: A03478044
Name: JESS A BENNETT
Address: 629 E WILSON
City, State, Zip: ELLensburg, WA 98926
Phone: (509) 899-2127

Vehicle Information

Vehicle: 1975 CHEVROLET K10
Color:
Mileage: 64,290
License: B20182H

Comments: CWD 509-899-3013

Les Schwab Invoice

Qty	Product Code	Product Description	Price/ea	FET	Amount
4	788704	16X6 8-6.5 XHD MOD TRAILER WHEEL	\$99.99	\$0.00	\$399.96
4	984850	LT245/75R16/10 CONFIDENCE LTS	\$173.99	\$0.00	\$695.96
4	13731	WHEEL SPIN BALANCE	\$19.99	\$0.00	\$79.96
4	648662	TUBELESS VALVE STEM - PASS	\$8.99	\$0.00	\$35.96
4	1260064	AMERICAS BEST TIRE WARRANTY	\$0.00	\$0.00	\$0.00

Parts Subtotal: \$1,131.88
Labor Subtotal: \$79.96
Sales Tax: \$104.22
Tire Fee: \$20.00

Invoice Total: \$1,336.06

Payment Method:

DEBITCRD Approval# 032174 Card# XXXXXXXXXXXX0644

\$1,336.06

DOT: Tire(s) has been electronically registered.

Wheel Position: LF, RF, LR, RR, JORDAN/PAUL

Remember to rotate your tires every 5,000 miles for maximum mileage - and it's free!

Free air checks for the life of the tires.

Les Schwab electronically registers your tire purchase with the tire manufacturer at no charge to you, in accordance with NHTSA's tire registration requirements.

SAE J2492 WARNING: THE FOLLOWING APPLIES TO VEHICLES WITH MODIFIED SUSPENSION/RIDE HEIGHT. The suspension/ride height of this vehicle has been modified. As a result, this vehicle may handle differently than that of factory equipped vehicles. As with any vehicle, extreme care must be used to prevent loss of control or roll-over during sharp turns or abrupt maneuvers. Always wear seat belts and drive safely, recognizing that reduced speeds and specialized driving techniques may be required. Failure to drive this vehicle safely may result in serious injury or death. Do not drive this vehicle unless you are familiar with its unique handling characteristics and are confident of your ability to maintain control under all driving conditions. Some modifications (and combinations of modifications) are not recommended and may not be permitted in your state. Consult your owner's manual, the instructions accompanying this product and state laws before undertaking these modifications. You are responsible for the legality and safety of the vehicle you modify using these components.

Your car may have a tire pressure monitoring system that uses a warning light to alert the driver of low tire pressure or system failure. Pursuant to NHTSA, Les Schwab must install all tire and wheel combinations with functioning TPMS sensors, including tires and custom

Invoice Date/Time: 04-28-2026 09:37 AM

Page 1 of 2