72745

INVOICE

PAGE 1

JIM Ellis Expect the best Est. 1971 Automotive Group
Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 39654 Tony Betancourt

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		104860/104884	T4746

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DI			17:00 08FEB19			CASH	08FEB19

R.O. OPENED	READY	OPTIONS: DLR:0832 ENG:3600CC
13:34 18JAN19	09:55 08FEB19	

LINE OPCODE TECH TYPE HOURS	LIST	NET	TOTAL
A MULTI POINT INSPECTION			
MPI MULTI POINT INSPECTION			
38279 C		0.00	0.00
RF COMPLIANCE FEE		2.95	2.95
PARTS: 0.00 LABOR: 0.00 OTHER: 2.95 TOTAL LINE A:			2.95
104860 COMPLETED INSPECTION.			
**********			
B PORSCHE SHUTTLE SERVICE			
PSS PORSCHE SHUTTLE SERVICE			
38279 C		0.00	0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B:			0.00
**********			
C CUST STATES SPEEDO AND ODO INP			
VINSP-4 INSPECT TRIM			
38279 C		163.10	163.10
MISC SPEEDO REPAIR			
C		325.00	325.00
PARTS: 0.00 LABOR: 163.10 OTHER: 325.00 TOTAL LINE C:			488.10
104860 RECOMMEND SENDING SPEEDOMETER ASSEMBLY OUT FOR REPAIRS.			
SPEEDO REPAIRED PER SUBLET			
**********			
D CUST STATES SPOILER WILL PUT SPOILER UP MANUALLY WITH AND THEN WILL NOT GO DOWN AUTOMATICALLY. STATES WILL GO UP AT 50MPH BUT WILL NOT COME DOWN AUTOMATICALLY----CHECK OPERATION OF SPOILER AT SPEEDS			
VINSP-22 INSPECT ELECTRICAL SYSTEM			
38279 C		0.00	0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE D:			0.00
104860 TEST DROVE THE VEHICLE AND THE SPOILER NEVER OPERATED AUTOMATICALLY. THE SPOILER WARNING LIGHT ALWAYS STAYS ON. NO FAULTS IN THE SYSTEM. SENT OUT THE SPEEDOMETER FOR REPAIR AND RECHECKED. ONCE INSTALLED THE SPOILER STILL DID NOT OPERATE. INSPECTED WIRING DIAGRAMS AND DETERMINED THE CRUISE CONTROL ALSO USES THE SAME SPEED SIGNAL AS THE SPOILER. TESTED CRUISE CONTROL AND IT IS NOT WORKING. REMOVED			

PAID FEB 08 2019 BY:

Please read carefully the statement below, and sign. 72 hours after completion of work on the vehicle, I will incur a storage fee of $10.00 a day, I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X
CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SI2C - IMAGING

CUSTOMER COPY

[redacted]

72745

INVOICE

PAGE 2

JIM Ellis
Expect the best
Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 39654 Tony Betancourt

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		104860/104884	T4746

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DD			17:00 08FEB19			CASH	08FEB19

R.O. OPENED	READY	OPTIONS: DLR:0832 ENG:3600CC
13:34 18JAN19	09:55 08FEB19	

LINE OPCODE TECH TYPE HOURS			LIST	NET	TOTAL
SPOILER CONTROL UNIT AND CHECKED ALL PINS. PERFORMED WIRING HARNESS CHECKS BETWEEN THE SPOILER CONTROL UNIT AND SPEEDOMETER SIGNAL, PASSED. SWAPPED SPEEDOMETER OUT OF A KNOWN GOOD CAR AND THE SPOILER WORKED CORRECTLY. FOUND THAT THE SPEED OUT SIGNAL FROM THE SPEEDOMETER WAS NOT A STRONG ENOUGH SIGNAL. SENT SPEEDOMETER OUT FOR A SECOND REPAIR WITH THE KNOWN GOOD UNIT AS A COMPARISON TOOL. ONCE REPAIRED THE SPEEDOMETER WAS INSTALLED. THE SPOILER WARNING GOES OFF AT 7MPH AND THE SPOILER OPERATES AS DESIGNED.					
**********					
E PASSENGER REAR SEAT BELT WILL LATCH, BUT HOUSING FALLS OFF					
SRS01 AIR BAG/SEAT BELT LIGHT ON					
38279	C			0.00	0.00
ASR TECHNICIAN HAS ADDITIONAL REPAIR OR MAINTENANCE REQUESTS					
38279	C			81.10	81.10
2 477-857-739-B-70B SEAT BELT RECEPTOR			230.42	230.42	460.84
PARTS: 460.84 LABOR: 81.10 OTHER: 0.00				TOTAL LINE E:	541.94
104860 REPLACED BOTH REAR SEAT BELT BUCKLES.					
**********					
F CUST STATES ONE OF MUFFLERS BYPASSED, WOULD LIKE FOR IT TO BE CONNECTED AGAIN					
VINSP-26 INSPECT EXHAUST SYSTEM AND CHECK FOR LEAKAGE					
38279	C			0.00	0.00
ASR TECHNICIAN HAS ADDITIONAL REPAIR OR MAINTENANCE REQUESTS					
38279	C			330.10	330.10
1 964-111-046-05 MUFFLER			1808.84	1808.84	1808.84
4 999-025-125-01 WASHER			7.93	7.93	31.72
2 900-910-003-01 HEXAGON NUT			3.64	3.64	7.28
2 999-084-052-02 LOCKING NUT 8M			15.76	15.76	31.52
2 900-074-339-02 HXHD BOLT 8X70			11.10	11.10	22.20
PARTS: 1901.56 LABOR: 330.10 OTHER: 0.00				TOTAL LINE F:	2231.66
104860 REMOVED MUFFLER BYPASS. LOOSENED REAR MUFFLER AND PROPERLY					

Please read carefully the statement below, and sign, 72 hours after completion of work on the vehicle, I will incur a storage fee of $10.00 a day, I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SI2C - IMAGING

CUSTOMER COPY

72745

INVOICE

PAGE 3

JIM Ellis Expect the best
Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 39654 Tony Betancourt

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		104860/104884	T4746

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DD			17:00 08FEB19			CASH	08FEB19

R.O. OPENED	READY	OPTIONS: DLR:0832 ENG:3600CC
13:34 18JAN19	09:55 08FEB19	

LINE OPCODE TECH TYPE HOURS	LIST	NET	TOTAL

INSTALLED IT. INSTALLED THE SIDE MUFFLER WITH NEW HARDWARE. ADJUSTED EXHAUST TIP.

****

G** RECOMMEND SENDING THE SPEEDOMETER OUT FOR REPAIRS. THE SPOILER DRIVE CONTROL UNIT GET IT'S SPEED SIGNAL FROM THE SPEEDOMETER. RECOMMEND TESTING THE AUTOMATIC SPOILER OPERATION AFTER SPEEDOMETER REPAIR IS PERFORMED.
ASR TECHNICIAN HAS ADDITIONAL REPAIR OR MAINTENANCE REQUESTS

38279 C 0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE G: 0.00

104860 REMOVED SPEEDOMETER AND SENT IT OUT FOR REPAIRS. ODOMETER AND SPEEDOMETER NOW OPERATE.

****

EST: 3,914.91 21JAN19 16:31 SA: 39654

CUSTOMER PAY SUPPLY FEE FOR REPAIR ORDER 39.95

JIM Ellis Expect the best Automotive Group

Please read carefully the statement below, and sign. 72 hours after completion of work on the vehicle, I will incur a storage fee of $10.00 a day. I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	574.30
PARTS AMOUNT	2362.40
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	367.90
TOTAL CHARGES	3304.60
LESS INSURANCE	0.00
SALES TAX	192.19
PLEASE PAY THIS AMOUNT	3496.79

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - S12C - IMAGING

CUSTOMER COPY

The Porsche Multi-Point Inspection Report

PORSCHE

The Porsche Multi-Point Inspection Report is a series of thorough vehicle "health checks" performed by factory-trained Porsche technicians. It is designed to keep your Porsche operating in top condition and to minimize your chances of being inconvenienced on the road. If additional service is recommended on any listed item, your Porsche Service Advisor will be happy to speak with you about your options.

1991		
Year/Model	Engine Size	
104860	WP0AB2961MS410270	02/08/2019
Mileage	VIN	Date

Checked and Okay at this Time | May Require Future Attention* | Requires Immediate Attention

Check Fluid Levels and Fill

OK	FILL		OK	FILL	
✔		Engine Oil	✔		Brake Reservoir
		Windshield Washer			Headlamp Washer
		Power Steering	✔		Coolant Recovery Reservoir
		Transmission (if equipped w/ dipstick)			

Check Following Systems / Components

✔		Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps
✔		Visually inspect headlamp alignment
✔		Windshield washer spray, wiper operation and wiper blades
✔		Windshield cracks and/or chips
✔		Heating, ventilation and air conditioning check
		Engine air cleaner filter
	✔	Oil and/or fluid leaks
✔		Constant velocity (CV) drive axle boots (if equipped)
✔		Exhaust system (leaks, damage, loose parts)
✔		Steering and steering linkages
✔		Shocks/struts, air suspension and other suspension components for leaks and/or damage
✔		Brake system (including lines, hoses and parking brake)
		Engine cooling system, hoses and clamps
		Radiator, heater and air conditioning hoses for leaks / damage
✔		Accessory drive belt(s)
✔		Clutch operation (if equipped)
		State inspection due (if applicable) ___/___/___ (Month / Day / Year)
		Your last completed maintenance _____ ; ___/___ (Mileage ; Month / Year)
		Your next factory scheduled maintenance is due at _____ ; ___/___ (Mileage ; Month / Year)

Check Battery

✔ Good | Recharge | Bad

Check Brakes
Measure Front / Rear Brake Linings

RF ✔ RR ✔

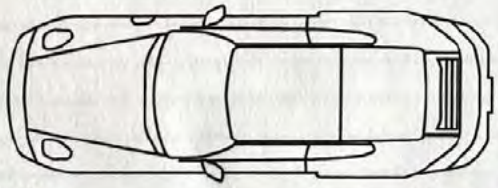

LF ✔ LR ✔

Over 5mm or 7/32"

3 to 5mm or 4/32" to 7/32"

Less than 2mm or 3/32"

Brake Measurements Not Taken This Service Visit ☐

Check Tires

TREAD DEPTH

LF	RF
✔ 7/32" or Greater	7/32" or Greater ✔
4/32" to 6/32"	4/32" to 6/32"
3/32" or Less	3/32" or Less
LR	**RR**
✔ 7/32" or Greater	7/32" or Greater ✔
4/32" to 6/32"	4/32" to 6/32"
3/32" or Less	3/32" or Less

Wear Pattern / Damage: ✔ LF ✔ LR ✔ RF ✔ RR

Tire Wear Indicates

☐ Alignment Check Needed ☐ Wheel Balance Needed

Tire Pressure Set to Factory Recommendations PSI ____ Front ____ Rear

*Brake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance service.

This Courtesy Inspection Completed By Your Porsche Service Team

Service Advisor: Tony Betancourt

Technician: Craig Mangold Buffington

Customer Signature: _____

Comments:

Coolant Recovery Reservoir: N/A

Oil and/or fluid leaks: MINOR ENGINE OIL LEAKS

8534 12/09

PORSCHE

Comments:
Left Front Brake Linings: 7.0MM
Right Front Brake Linings: 7.0MM
Left Rear Brake Linings: 7.5MM
Right Rear Brake Linings: 7.5MM
Left Front Tread Depth: 6.97MM
Right Front Tread Depth: 6.82MM
Left Rear Tread Depth: 6.85MM
Right Rear Tread Depth: 6.74MM

© 2015 CDK Global, LLC / CDK Global is a trademark of CDK Global, LLC

CDK Global

Buckhead Auto Sport
4975 Roswell Rd
Atlanta, GA. 30342
Phone: 404-252-5493
"Taking care of Buckhead the way it should be done"

INVOICE
7619
Org. Est. # 009166

INVOICE

Date: 01/20/2020

1991 Porsche - 911 Carrera 2 - 3.6L, H6 (220CI) VIN(B)
Lic # :
Odometer In : 0

VIN # :

Part Description / Number	Qty	Sale	Ext
Oil Filter Spin-On *930 107 764 03*	1.00	18.76	18.76
PORSCHE OIL *15W-40*	12.00	9.00	108.00
Shop Supplies			12.68

Labor Description	Ext
OIL CHANGE	
ENGINE OIL FILTER - Remove & Replace - One	42.00
Hazardous Materials	4.20

Org. Estimate 196.45 Revisions 0.00 Current Estimate 196.45

Labor:	42.00
Parts:	139.44
HazMat:	4.20
SubTotal:	185.64
Tax:	10.81
Total:	196.45
Bal Due:	$196.45

[Payments -]
Vehicle Received:

Customer Number : 2364

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____

Visit us on the web : www.Buckheadautosport.com

Our Email Address: *infobuckheadautosport@gmail.com*

Service Advisor : ADAMS, STEPHEN, Tech : ADAMS, STEPHEN

Copyright (c) 2020 Mitchell Repair Information Company, LLC invhrs 9.15.17d

DieHard Gold Battery, Group Size H6, 730 CCA Part No. 48H6 Warranty: 3 YR FREE REPLACEMENT	1	$169.99	$169.99	Advance Auto Parts - Store 6870 5475 PEACHTREE INDUSTRIAL BL CHAMBLEE, GA 30341 770-457-9100

For Questions:

See our Return Policy or contact Customer Service.

Confirm your order status here.

Product Subtotal:	$169.99
Discounts:	$0.00
Shipping Charges:	$0.00
Shipping Discount:	$0.00
Core Charges:	$22.00
Tax:	$15.36
Order Total:	$207.35

Enjoy the new Speed Perks program today!
Members get points on every purchase, easy to redeem rewards and more. Learn more

THINK AHEAD. THINK ADVANCE.

Contact | 877-238-2623 | Privacy Policy | Terms & Conditions

© 2021 Advance Auto Parts

This email was sent by: **Advance Auto Parts**
5008 Airport Road Roanoke, VA, 24012,

124919P

INVOICE

PAGE 1

JIM Ellis Expect the best
Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 662 SCOTT ALAN FEINGLASS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		106409/106421	T4531

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DD			16:36 21JUN23			CASH	21JUN23

R.O. OPENED	READY	OPTIONS:
07:47 22MAY23	13:02 21JUN23	DLR:0832 ENG:3600CC

PAID
JUN 21 2023

LINE OPCODE TECH TYPE HOURS		LIST	NET	TOTAL
A SAFETY INSPECTION ($110 VALUE)				
MPSI SAFETY INSPECTION ($110 VALUE)				
788 C			0.00	0.00
RF COMPLIANCE FEE			3.95	3.95
PARTS: 0.00 LABOR: 0.00 OTHER: 3.95			TOTAL LINE A:	3.95
**********				
B GENERAL COMPLAINTCustomer states the key will no longer lock the doors from the outside. Please check and advise.				
BI001 PERFORM DIAGNOSIS				
788 ISP				(N/C)
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00			TOTAL LINE B:	0.00
106409 TECH FOUND DRIVER DOO LOCK CYLINDER FAULTY. PROVIDE CLIENT WITH A QUOTE FOR REPLACEMENT LOCK CYLINDER. CLIENT UNABLE TO PRODUCE KEY NUMBER AND UNSPECIFICIED KEY WOULD BE USED				
**********				
C Oil and Filter - Replace				
MA10 Oil and Filter - Replace				
788 COIL			239.00	239.00
PARTS: 0.00 LABOR: 239.00 OTHER: 0.00			TOTAL LINE C:	239.00
106421 CLIENTY REQUESTS OIL AND FILTER CHANGE- DRAINED BOTH OIL PLUGS AND CLEANED. REINSTALLED WITH NEW SEAL WASHERS. REPLACED ENGINE OIL FILTER. FILLED IN ENGINE OIL TANK AND RUN ENGINE. SET OIL LEVEL AND TEST DRIVE.				
**********				
D** DRIVER DOOR HANDLE/ LOCK CYLINDER- REPLACE- TECH FOUND DRIVER DOOR LOCK CYLINDER WORN OUT AND SPINNING FREELY. RECOMMEND REPLACING LOCK CYLINDER. LOCK CYLINDER REPLACEABLE WITH MATCHING KEY IF KEY/ LOCK NUMBER IS PROVIDED. OTHERWISE A NEW LOCK AND KEY FOR ONLY DRIVER DOOR WILL BE PROVIDED.				
BY39 DRIVER DOOR HANDLE/ LOCK CYLINDER- REPLACE				
788 C			934.39	934.39
1 911-538-941-07 DOOR HANDLE, EXTERIOR		550.90	550.90	550.90
PARTS: 550.90 LABOR: 934.39 OTHER: 0.00			TOTAL LINE D:	1485.29
**********				

Please read carefully the statement below, and sign, 72 hours after completion of work on the vehicle, I will incur a storage fee of $10.00 a day, I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SI2C - IMAGING

CUSTOMER COPY

124919P

INVOICE

PAGE 2

Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 662 SCOTT ALAN FEINGLASS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		106409/106421	T4531

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DD			16:36 21JUN23			CASH	21JUN23

R.O. OPENED	READY	OPTIONS: DLR:0832 ENG:3600CC
07:47 22MAY23	13:02 21JUN23	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
CUSTOMER PAY SUPPLY FEE FOR REPAIR ORDER							99.99

SHOP FEES ON THIS INVOICE COVER SUPPLIES & EQUIPMENT / MATERIALS USED IN QUANTITIES IMPRACTICLE TO MEASURE.THESE ITEMS INCLUDE BUT ARE NOT LIMITED TO EQUIPMENT WEAR, LUBRICANTS, SOLVENTS, & MISCELLANEOUS HARDWARE. ALSO HEALTH AND SAFETY REQUIREMENTS BY STATE AND LOCAL LABOR LAWS. IE; PPE

Please read carefully the statement below, and sign, 72 hours after completion of work on the vehicle, I will incur a storage fee of $10.00 a day. I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	1173.39
PARTS AMOUNT	550.90
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	103.94
TOTAL CHARGES	1828.23
LESS INSURANCE	0.00
SALES TAX	52.07
PLEASE PAY THIS AMOUNT	1880.30

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SI2C - IMAGING

CUSTOMER COPY

127189P

INVOICE

PAGE 1

Jim Ellis Expect the best
Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 662 SCOTT ALAN FEINGLASS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		106478/106478	T4708

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DD			15:00 06SEP23			CASH	11SEP23

R.O. OPENED	READY	OPTIONS: DLR:0832 ENG:3600CC
16:37 31JUL23	15:12 11SEP23	

LINE OPCODE TECH TYPE HOURS	LIST	NET	TOTAL
A SAFETY INSPECTION ($110 VALUE)			
MPSI SAFETY INSPECTION ($110 VALUE)			
788 C		0.00	0.00
RF COMPLIANCE FEE		3.95	3.95
PARTS: 0.00 LABOR: 0.00 OTHER: 3.95 TOTAL LINE A:			3.95
106478 PERFORMED VEHICLE INSPECTION.			
**********			
B CLIENT STATES THAT DOOR LOCK NEEDS TO BE RE ADDRESSED-SOP-			
BY001 repair central locking			
788 C		0.00	0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B:			0.00
106478 CLIENT REQUESTS CENTRAL LOCKING MICROSWITCH FOR DRIVER DOOR LOCK TO BE INSTALLED- QUOTE PROVIDED.			
**********			
C CLIENT STATES THAT DRIVERS/passenger SEATS DOES NOT MOVE FOR/AFT			
IN001 diagnose issue			
788 C		0.00	0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C:			0.00
106478 DIAGNOSED AND CONFIRMED SEAT SWITCH IS WORN/ DIRTY WITH ONLY ONE DIRECTION OF SWITCH NOT OPERATIONAL INTERMITTENTLY. RECOMMEND REPLACING SEAT SWITCHES WITH FRESH NEW UPDATED SWITCH UNITS.			
**********			
D KEEP DOWNSTAIRS INSIDE PLEASE			
0 GENERAL COMPLAINT			
788 C		0.00	0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE D:			0.00
**********			
E CLIENT STATES THAT PASSENGER WINDOW DOES NOT GO UP			
ELI diagnose			
788 C		0.00	0.00
1 964-613-134-00 MICROSWITCH	161.08	161.08	161.08
PARTS: 161.08 LABOR: 0.00 OTHER: 0.00 TOTAL LINE E:			161.08
106478 CONFIRMED CONCERN AND FOUND A CORRODED PIN FOR DRIVER DOOR PASSENGER SWITCH, CAUSING FAULTY OPERATIONS IN WINDOWS CIRCUIT. REMOVED			

PAID SEP 15 '23 By

Please read carefully the statement below, and sign, 72 hours after completion of work on the vehicle. I will incur a storage fee of $10.00 a day. I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SI2C - IMAGING

CUSTOMER COPY

127189P

INVOICE

Jim Ellis Expect the best
Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 662 SCOTT ALAN FEINGLASS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		106478/106478	T4708

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DD			15:00 06SEP23			CASH	11SEP23

R.O. OPENED	READY	OPTIONS: DLR:0832 ENG:3600CC
16:37 31JUL23	15:12 11SEP23	

LINE OPCODE TECH TYPE HOURS	LIST	NET	TOTAL

SWITCH AND OPENED CONNECTOR. CLEANED AND TIGHTENED PIN IN QUESTION AND CLEANED PIN ON SWITCH. REMOVED AND INSPECTED REMAINING SWITCHES AND CONFIRMED CONTINUITY OF LINES. CONFIRMED APPROPRIATE POWER TO CIRCUIT WITH SOUND FUSE. RECOMMEND REPLACING WINDOW SWITCHES WITH FRESH NEW UPDATED UNITS TO RESTORE CIRCUIT RELIABILITY.

****

F CLIENT STATES THAT BATTERY WILL GO DEAD AFTER 3 DAYS 2 HRS DIAGNOSIS TO START
ELI INSPECT ELECTRICAL SYSTEM.
788 C 511.46 511.46

PARTS: 0.00 LABOR: 511.46 OTHER: 0.00 TOTAL LINE F: 511.46

106478 MICROSWITCH DRAW- CHECKED BATTERY STATIC VOLTAGE. PARKED VEHICLE AND PERFORMED DRAW TESTING. TECH FOUND A DRAW FOR ~.27A AND FOUND DRAW O DROP TO ~.024A WITH WINDOW CIRCUIT BROKEN. PERFORMED WINDOW SWITCH DIAGNOSIS AND FOUND DRAW TO CONSISTENTLY STAY LOW IN THE ~.023A RANGE. ALLOWED DRAW TEST TO PLAY OUT FOR A FEW DAYS AND FOUND BATTERY VOLTAGE TO DROP .1V OVER A FEW DAYS. PARKED VEHICLE. DOWNSTAIRS FOR AN ADDITIONAL FEW DAYS TO ALLOW PARTS ORDERS TO COME IN. RETRIEVED VEHICLE AND FOUND BATTERY VOLTAGE REMAINS ABOVE 12.5V AND ENGINE STARTS OK. TECH BELIEVES THAT DRAW HAS BEEN RECTIFIED WITH THE REPLACEMENT OF FAULTY MICROSWITCH FOR DRIVER DOOR IN ADDITION TO CORRODED WINDOW SWITCHES. CONFIRMED BATTERY VOLTAGE OK. CONFIRMED NO DRAW PRESENT AT THIS TIME.

****

G** CENTRAL LOCKING MICROSWITCH INSTALL- CLIENT REQUESTS MICROSWITCH INSTALL FOR DRIVER DOOR HANDLE TO RESTORE CENTRAL LOCKING FUNCTIONALITY.
ASR CENTRAL LOCKING MICROSWITCH INSTALL-
788 C 363.52 363.52

PARTS: 0.00 LABOR: 363.52 OTHER: 0.00 TOTAL LINE G: 363.52

106478 CLIENT REQUESTS NEW CENTRAL LOCKING MICROSWITCH FOR DRIVER LOCK. REMOVED DOOR PANEL AND VAPOR BARRIER. DISCONNECTED HARNESS' AND COVERS. REMOVED DRIVER DOOR HANDLE AND INSTALLED NEW MICROSWITCH UNIT. ROUTED HARNESS PIGTAIL AND CONNECTED INTO SYSTEM. REINSTALLED DOOR

Please read carefully the statement below, and sign, 72 hours after completion of work on the vehicle, I will incur a storage fee of $10.00 a day, I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SIZC - IMAGING

CUSTOMER COPY

127189P

INVOICE

PAGE 3

JIM Ellis Expect the best
Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 662 SCOTT ALAN FEINGLASS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		106478/106478	T4708

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DD			15:00 06SEP23			CASH	11SEP23

R.O. OPENED	READY	OPTIONS: DLR:0832 ENG:3500CC
16:37 31JUL23	15:12 11SEP23	

LINE OPCODE TECH TYPE HOURS	LIST	NET	TOTAL
PANELLING AND VAPOR BARRIER AND CONFIRMED OPERATION OF CENTRAL LOCKING. TECH FOUND DOOR LOCKING AND CENTRAL LOCKING SYSTEM PERFORMING AS DESIGNED AT THIS TIME.			
**********			
H** Window SwitchES (3) - Replace-CHECKED OPERATION OF SYSTEM, PULLED OUT SWITCHES AND INSPECTED. TECH FOUND PASSENGER SWITCH ON DRIVER DOOR CORRODED WITH CONNECTOR DAMAGE. DISASSEMBLED CONNECTOR, ADJUSTED AND CLEANED. CLEANED SWITCH. CONFIRMED OPERATION OF ALL WINDOWS. RECOMMEND INSTALLING NEW SWITCHES TO REFRESH ALL WINDOW SWITCHES IN VEHICLE AS THEY WEAR OVER TIME DUE TO ELECTRICAL ARCING. SEE CLIENT VIDEO. INCLUDES DIAG AND ADJUSTMENT TIME.			
EL82 Window Switch - Replace			
788 C		511.46	511.46
3 964-613-621-02-01C SWITCH FOR ELECTRIC WINDOW REGULATOR BLA	112.14	112.14	336.42
2 928-613-181-01 SWITCH FOR SEAT HEIGHT ADJUSTMENT	192.05	192.05	384.10
PARTS: 720.52 LABOR: 511.46 OTHER: 0.00		TOTAL LINE H:	1231.98
106478 CLIENT REQUESTS THREE NEW WINDOW SWITCH UNITS. REMOVED WINDOW SWITCHES AND CONFIRMED CONNECTORS OK. INSTALLED NEW WINDOW SWITCHES AND CONFIRMED OPERATION IS CONSISTENT.			
**********			
I** Seat Switch (DRIVER) - Replace-CONFIRMED CONCERN AND FOUND INTERMITTENT OPERATION OF FRONT SEAT SWITCH FOR FORWEARD AND BACKWARD MOVEMENT. RECOMMEND REPLACING SEAT SWITCH DUE TO ELECTRICAL WEAR AND UNRELIABILITY. SEAT TO BE REMOVED. INCLUDES DIAG AND RESEARCH TIME.			
ET66 Seat Switch (DRIVER) - Replace			
788 C		511.46	511.46
PARTS: 0.00 LABOR: 511.46 OTHER: 0.00		TOTAL LINE I:	511.46
106478 CLIENT REQUESTS NEW DRIVER 4 WAY SEAT SWITCH FOR HORIZONTAL MOVEMENT. LIFTED SEAT FULLY AND REMOVED MOUNTING BOLTS. REMOVED SEAT. REMOVED SWITCH SURROUNDS AND PULLED FRONT SWITCH HARNESS FROM MOTORS			

Please read carefully the statement below, and sign, 72 hours after completion of work on the vehicle, I will incur a storage fee of $10.00 a day, I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SI2C - IMAGING

CUSTOMER COPY

127189P

INVOICE

PAGE 4

Porsche Atlanta Perimeter
4006 Carver Drive · Atlanta, GA 30360
Main: (770) 234-2100 · Direct: (770) 216-7555
www.jimellis.com
A Jim Ellis Automotive Dealership

SERVICE ADVISOR: 662 SCOTT ALAN FEINGLASS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
	91	PORSCHE TARGA	WP0AB2961MS410270		106478/106478	T4708

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN91 IS 01JAN91 DD			15:00 06SEP23			CASH	11SEP23

R.O. OPENED	READY	OPTIONS: DLR:0832 ENG:3600CC
16:37 31JUL23	15:12 11SEP23	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL

AND CONNECTOR. INSTALLED NEW SWITCH AND RE-PINNED TO CONNECTOR AND WIRED TO MOTORS. CONFIRMED OPERATION AND INSTALLED SWITCHES TO SEAT. REINSTALLED SEAL AND CONFIRMED OPERATION.

****

J** Seat Switch (PASSENGER) - Replace-CONFIRMED CONCERN AND FOUND INTERMITTENT OPERATION OF FRONT SEAT SWITCH FOR FORWARD AND BACKWARD MOVEMENT. RECOMMEND REPLACING SEAT SWITCH DUE TO ELECTRICAL WEAR AND UNRELIABILITY. SEAT TO BE REMOVED. INCLUDES DIAG AND RESEARCH TIME.

ET66 Seat Switch (PASSENGER) - Replace

788	C			388.14	388.14
1 928-613-182-01	SWITCH		286.03	286.03	286.03

PARTS: 286.03 LABOR: 388.14 OTHER: 0.00 TOTAL LINE J: 674.17

106478 CLIENT REQUESTS NEW PASSENGER SEAT SWITCHES- CONFIRMED MOTORS OPERATIONAL. REMOVED PASSENGER SEAT AND DISCONNECTED HARNESS'. REMOVED SWITCHES WITH TRIM AND HARNESS'. INSTALLED NEW PASSENGER SEAT SWITCHES, ROUTED AND MOUNTED HARNESS' AND INSTALLED TO CONNECTORS. CONFIRMED OPERATION. REINSTALLED SEAT AND TRIMS. CONFIRME3D OPERATION.

****

CUSTOMER PAY SUPPLY FEE FOR REPAIR ORDER 99.99

SHOP FEES ON THIS INVOICE COVER SUPPLIES & EQUIPMENT / MATERIALS USED IN QUANTITIES IMPRACTICLE TO MEASURE.THESE ITEMS INCLUDE BUT ARE NOT LIMITED TO EQUIPMENT WEAR, LUBRICANTS, SOLVENTS, & MISCELLANEOUS HARDWARE. ALSO HEALTH AND SAFETY REQUIREMENTS BY STATE AND LOCAL LABOR LAWS. IE; PPE

Please read carefully the statement below, and sign, 72 hours after completion of work on the vehicle, I will incur a storage fee of $10.00 a day, I, the undersigned, agree to pay all court costs and a reasonable attorney's fee and, or collection agency fee.

TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE
ALL PARTS REMOVED WILL BE DISCARDED UNLESS SPECIFIED OTHERWISE.

"The Factory Warranty constitutes all of the warranties with respect to the seller of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose and the seller neither assumes nor authorizes an other person to assume for it any liability in connection with the sale of this item/items."

AUTHORIZATION FOR REPAIR AND DISCLAIMER FOR DELAY, LOSS OR DAMAGE

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	2286.04
PARTS AMOUNT	1167.63
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	103.94
TOTAL CHARGES	3557.61
LESS INSURANCE	0.00
SALES TAX	101.41
PLEASE PAY THIS AMOUNT	3659.02

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SI2C - IMAGING

CUSTOMER COPY