



Garment Quality Control Checklist

19 Mar 2026 / Jonathan Tarlengco

Complete

Score	18 / 20 (90%)	Flagged items	2	Actions	1
Conducted on	19.03.2026 08:00 PST				
Inspector's Name	Jonathan Tarlengco				
Location	1059 San Rafael St, Mandaluyong City, 1550 Metro Manila, Philippines (14.577478, 121.041059)				
Report Number	2023-0086				
Client	Linery International				
Supplier	Garmends Asia Pacific				

Flagged items & Actions

2 flagged, 1 action

Flagged items

2 flagged, 1 action

Defects / Table / Row 1

Severity levels

Critical

Signatures

Overall Inspection Conclusion

Fail



Photo 4

To do | Assignee: SafetyCulture Staff | Priority: Medium | Due: 16.03.2026 10:00 PST | Created by: SafetyCulture Staff

Contact supplier

Contact the supplier for an explanation.

Other actions

0 actions

Batch Sample Information

You may attach image of product design here.

Product Description

Women's Blazer; made of terylene fiber, with two side pockets; available from size 12-16; grey 002, designed in California; to be made in the Philippines

Client

Linery International

Supplier

Garmends Asia Pacific

Manufacturer

Harper Textiles

PO Number

00058769034

Item No.

2003944

Order Quantity

100

Inspection Type

Pre-production inspection

Sampling standard

ANSI/ASQ Z1.4 - 2008/ MIL-STD - 105E Normal Sampling

Style/Color Conformity

Attach image of client's product design specification sheet and compare sampled batch to the design. Attach images for proof of conformity/non-conformity.



Photo 1

Defects

1 flagged, 5 / 6 (83.33%)

	Defects	Severity levels	Recommendation
1	Broken, cracked, missing, or wrong color accessory	Critical	Contact supplier
2	Substituted accessory style, size, or positio	N/A	N/A
3	Distorted, pleated, twisted, broken or rusted button/stud	N/A	N/A
4	Incorrectly placed buttons, beads or sequins	Minor	N/A
5	Wrong thread color does used with button, bead or sequin	N/A	N/A
6	Substituted buttons, studs or beads	N/A	N/A

Measurement Point

	Measurement Point description	Tolerance	Size 12	Size 14	Size 16	Size 18
1	Neck width from edge to edge (shoulder forward 1/2")	1/4"	10"	10 1/4"	10 1/2"	10 3/4"
2	Front neck drop from high point shoulder	1/4"	4 3/8"	4 1/2"	4 5/8"	4 3/4"
3	Back neck drop from high point shoulder	1/4"	4 1/8"	4 1/4"	4 3/8"	4 1/2"
4	Shoulder width from edge to edge each side	1/8"	1 3/4"	1 3/4"	1 3/4"	1 3/4"
5	Across from 5" from high point shoulder	1/4"	12"	12 3/8"	12 3/4"	13 1/8"
6	Front yoke width along seam	1/4"	13 1/8"	13 1/2"	13 7/8"	14 1/4"
7	Chest 1" below arm extend	1/4"	20 1/4"	21"	21 3/4"	22 1/2"

Quantity Conformity

Product Reference Number	2003944
Purchase Order Number	00058769034
Order Quantity	1000
Available Quantity [Pieces Packed]	500
Available Quantity [Packed CTN]	110
Available Quantity [Pieces Unpacked]	390
Not Finished Quantity	0
Sample Size [Packed Lot]	30
Sample Size [Unpacked Lot]	70

Attach summary of client's specifications on marking/label/packaging here.

Unit/Packaging/Artwork

Pass



Photo 2

Polybag Printing/Label

N/A

Inner Packing

N/A

Outer Packing

N/A

On-site Tests	9 / 9 (100%)
----------------------	--------------

Pull Test for Accessories	1 / 1 (100%)
---------------------------	--------------

Apply a force of 6 ± 0.2 kg for 10 seconds on all accessories by means of a pull gauge. Accessories must remain securely in place. If there is no pull gauge available, evaluate by hand pull and include a note in the report.

Sample size	2 pcs
--------------------	-------

Did the item pass/fail the test?	Pass
---	------

Fatigue Test for Accessories	1 / 1 (100%)
------------------------------	--------------

Check the fasteners (buttons, snaps, zippers, etc.) as intended for 50 cycles. Accessories must be undamaged without any loss of function following the test .

Sample Size	2 pcs
--------------------	-------

Did the item pass/fail the test?	Pass
---	------

Stretch Test for Elastic Fabric and Straps	1 / 1 (100%)
--	--------------

Stretch elastic fabrics and straps to check the elasticity. They must have proper elasticity without elastic fibers or stitches breaking.

Sample Size	2 pcs
--------------------	-------

Did the item pass/fail the test?	Pass
---	------

Buttonholes Test	6 / 6 (100%)
------------------	--------------

Button not sewn securely	N/A
---------------------------------	-----



Photo 3

Incomplete stitching or uncut buttonhole	Minor
---	-------

One or more skipped stitches at buttonhole	N/A
---	-----

Buttonhole incorrect size for buttons	Minor
--	-------

Wrong direction of buttonhole	N/A
--------------------------------------	-----

Buttonhole fraying around edges causing button to catch on threads need trimming

N/A

Signatures

1 flagged, 1 action, 0 / 1 (0%)

Final Comments/Observations

The sampled batch received a total quality grade of 94% as majority of the sampled batch met the product specifications. However, there were pieces that were found to have defects, particularly in style and colour conformity. These findings have to be corrected, thus another sample batch is requested for testing. The next testing will be 5 days from now.

Overall Inspection Conclusion

Fail



Photo 4

To do | Assignee: SafetyCulture Staff | Priority: Medium | Due: 16.03.2026 10:00 PST | Created by: SafetyCulture Staff

Contact supplier

Contact the supplier for an explanation.

Supplier's Representative: Name and Signature

Adam Coles
16.03.2026 08:44 PST

Manufacturer's Representative: Name and Signature

Jonathan Tarlengco
16.03.2026 08:44 PST

Buyer's Representative: Name and Signature

Jenny Chung
16.03.2026 08:45 PST

Media summary



Photo 1



Photo 2



Photo 3

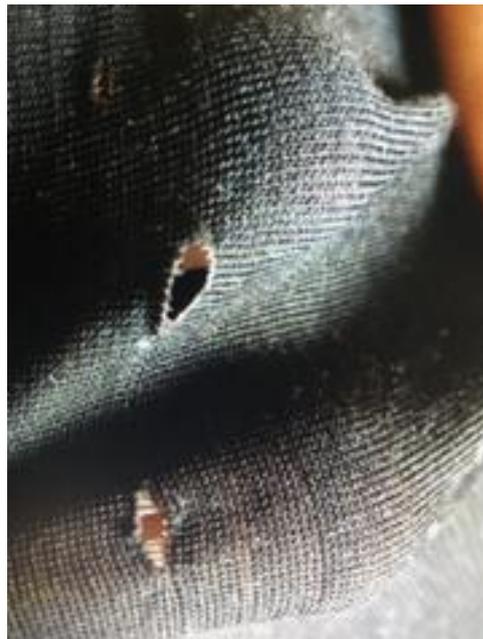


Photo 4