



Ian Smoak, Manager


Exceptional British Sports Car Service, Restoration, & Parts

www.sportscarcraftsmen.com

5635 Kendall Ct
Arvada, CO 80002
M-F 8 - 5:30 Sat 9 - 12

303-422-9272

mowogman@comcast.net

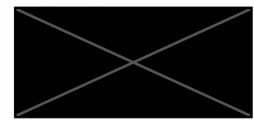

Invoice # 14663

1953 MG TD

VIN: 24566/1916
Engine: L4 1.3L, 76cid, Gas, Carb
Trans:

Odom: 0
Color: Red
Mfg. Date:

Inv Date: 8/23/2024
Service Writer: Ian Smoak
Status: Posted

Unit #

PO #
Key Tag / Hat #

Vehicle Problems	Requests for Service	Services Performed	Hrs	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-----	-------	-----

Notes: Revival - Sitting 20ish years

6,477.54

Labor Service - Revival from 20yrs. Remove fuel tank and inspect - awful. Pressure washed to get a better view, and the bottom is perforated from rust. Rust, scale and debris indicate need for replacement. 8.00 148.00 1,184.00

See below for more information about individual systems. After firing engine, noted no oil pressure. Test with a secondary gauge and it registered 40lbs at idle, cold. Instrument needs to be replaced, although they are currently unavailable. I have placed one on order, and can call when it arrives. The two other options are to install a later-style safety gauge, which would simply not have a matching face; or to leave the original in, inoperative, until a new one arrives. Oil pressure pipe had to be replaced with a good used part.

Ran engine to temp and took for a short test-drive. Brakes need complete service, and the tires need to be replaced. Charging is intermittent - remove and bench-test generator, which works fine. Investigated control box, found defective and replaced.

Short test-drive indicated need for complete brake system work, and new tires. Customer was consulted and gave approval to move ahead. SCOTT

Sublet GENERATOR	Outside labor to rebuild generators/alternators/starters	1.00	150.00	150.00
New 142-000	RB106 REGULATOR - W/ SCREW TERM *Non Adjusted*	1.00	79.99	79.99
New 435-548U	Pipe, Oil Pressure Fitting to Gauge - MGT-srs	1.00	25.00	25.00
New 361-761	DUAL GAUGE - OIL/WATER AH/MG/TR	1.00	289.99	289.99

Labor Service - Remove old fuel tank to clean and evaluate. Leaking from pinholes in bottom. Ordered replacement tank and sent out to have painted to match car. Install new tank with original end caps and filler. 13.50 148.00 1,998.00

Cleaned and repaired fuel warning lamp sending unit, install. Add 4 gal of fresh, non-ethanol fuel. *Later topped tank on test-drive

Remove fuel pump, disassemble, clean and inspect. Reinstall, flush fuel line. Replace fuel filter and old, hard fuel hose.

Remove, clean and inspect carbs. Replace jets, jet seals and float needles. Set all for basic starting and fire engine. Run to temp, set mixture, idle and choke. SCOTT

Sublet PAINT	Gas Tank Painting	1.00	775.00	775.00
New 370-760	JET - .090 H-type AH/MG	2.00	18.99	37.98
New 295-200	SEAL - JET TUBE CORK H-type	4.00	1.29	5.16
New 371-055	FLOAT NEEDLE - VITON TIP	2.00	49.99	99.98
New 377-300	FUEL FILTER - PLASTIC 1/4in	1.00	4.99	4.99
New 1/4" FUEL HOSE	1/4" Fuel Hose, Bulk (per foot)	2.00	3.49	6.98
New 293-600	MGT GASKET GAS CAP	1.00	4.29	4.29
New FUEL, NON-ETHANOL	Gasoline, Non-Ethanol	10.00	8.50	85.00

Labor Service - Replace all brake hydraulics, flush and bleed system. SCOTT 6.00 148.00 888.00

New 180-075	WHEEL CYL - AFTMKT REAR MGA/MGT/TR2 -3	2.00	17.99	35.98
New 180-620	WHEEL CYLINDER - AFTMKT FRONT	4.00	27.99	111.96

Invoice # 14663

1953 MG TD

Inv Date: 8/23/2024

New	180-841	MGTD/TF BRAKE HOSE - MGTD-TF	3.00	21.89	65.67
New	181-195TRW	BRAKE MASTER CYL - MGTD/TF	1.00	164.99	164.99
New	VAL608334	Valvoline VPS DOT4, Dry Brake Fluid	1.00	29.95	29.95
Labor Service - As part of tuning, refresh ignition system with new ignition cap, rotor, wires and spark plugs. Set ignition timing, test-drive. SCOTT			2.00	148.00	296.00
New	153-000	DISTR CAP - AFTMKT MGT DDB111X	1.00	44.99	44.99
New	151-805	25D HEAVY DUTY ROTOR - RED	1.00	16.49	16.49
New	171-618X	Plug wire set MGT repro	1.00	59.99	59.99
New	152-110	SPARK PLUG - MGT/JAG L86YC	4.00	4.29	17.16

Customer requests that: All the tires on the vehicle need replacement. **1,132.36**

Labor Service - Mount and Balance four tires. Includes removing and replacing tires from wheels, mount on vehicle, electronically balance wheels and tires and inspect/replace valve stems/tubes. SCOTT			1.00	260.00	260.00
New	TIRESTOCK	Balance Weights and Valve Stems (if app)	4.00	2.00	8.00
New	VRE165X15	165HR15 VREDESTEIN SPRINT CLASSIC	4.00	165.95	663.80
New	MICHTUBE15E	Michelin 15 inch inner tube 145/185	4.00	50.14	200.56

Add On Charges Breakdown		
Special Handlin		20.00
Tire Disposal		20.00

Warranty All repair work is warranted for 30 days.	Posted 1/17/25 2:54PM	8,158.04	Invoice Summary	
			Parts	2,028.95
			Labor	4,626.00
			Sublet	925.00
			Fluids	29.95
			Supply Charge	98.78
			Add On Charges	40.00
			Sub Total	7,748.68
			Sales Tax (DEF)	171.75

X
Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's