

1620 EL CAMINO AVE  
SACRAMENTO, CA 95815

# BUGFORMANCE

*Air Cooled Specialist*  
Since 1978


P. (888) 929-1949  
INFO@BUGFORMANCE.COM

BAR-AJ119887  
EPA-00178865

WWW.BUGFORMANCE.COM

FOLLOW US:  

Invoice # 29758

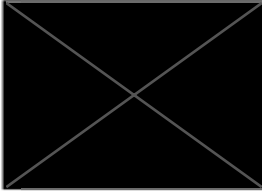

1968 Volkswagen Beetle Base

License # D195K1

Inv Date: 5/06/2024

VIN:

Odom: 84090

Service Writer: Will Service

Engine: H4 1.5L, 92cid, GAS, CARB

Color: SILVER

Status: Posted

Trans: MANUAL

Mfg. Date:

Unit #

PO #

Key Tag / Hat #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Notes: TUNE UP

Labor Service - COMPLETE TUNE-UP (TYPE 1)					484.25
Labor Service - (T1,2,3,) RETORQUE LOWER HEAD STUDS AND ADJUST VALVES, CLEAN VALVE COVERS AND REINSTALL WITH NEW GASKETS.					0.00
New 113-101-481FEL	GASKET, VALVE COVER 1200-1600CC	2.00	2.50		5.00
Labor Service - REMOVE SPARK PLUGS AND CHECK COMPRESSION: CYL. #1 _120_ CYL. #2 _130_ CYL. #3 _120_ CYL. #4 _125_					0.00
Labor Service - (T1,2/71,3) DRAIN OIL. CLEAN SUMP SCREEN AND PLATE. REINSTALL BOTH W/NEW GASKETS. ADD NEW OIL.					0.00
New 113-198-031	GASKET, OIL STRAINER KIT-ALL 1200-1600C	1.00	3.50		3.50
New 06143	OIL, 40W CASTROL (PLASTIC QUART)	3.00	14.51		43.53
Labor Service - REMOVE DISTRIBUTOR AND REPLACE POINTS, ROTOR, DIST. CAP, AND CONDENSER.					0.00
New 111-905-207C	CAP, DISTRIBUTOR 027	1.00	75.25		75.25
New 02069	CONDENSER, 245	1.00	16.33		16.33
New 111-905-225F	ROTOR, 082	1.00	25.50		25.50
New 111998063	POINTS, 057 - 01013	1.00	23.22		23.22
Labor Service - REPLACE FUEL FILTER W/NEW ONE. (TDI DIESEL)					0.00
New 131-261-275A	FILTER, FUEL UNIVERSAL	1.00	2.50		2.50
Labor Service - REMOVE OLD SPARK PLUGS AND INSTALL NEW ONES.					0.00
New BR5HS	SPARK PLUG, NGK 14MM SAME AS 7902/W8AC 14MM 1/2 REACH	4.00	5.00		20.00
Labor Service - SET DWELL AND TIMING. DWELL _46 DEGREES_ TIMING _30 DEGREES TOTAL_					0.00
Labor Service - ADJUST STOCK SINGLE CARBURETOR.					0.00
WE TRIED TO ADJUST THE ORIGINAL CARBURETOR ON THE ENGINE BUT THE ACCELERATOR PUMP WAS NOT SQUIRTING. THE ACCELERATOR PUMP IS LEAKING.					
WE SPOKE TO THE CUSTOMER AND HE GAVE US APPROVAL TO REPLACE THE CARBURETOR WITH A NEW UNIT.					
Labor Service - SERVICE AIR CLEANER.					0.00
Labor Service - FEE FOR WASTE DISPOSAL FOR HIGH PRESSURE WASH TANK -HOT TANK-SOLEVENT TANK AND BRAKE CLEANER TANK.					14.90
Labor Service - REMOVE HEAD LAMP ASSEMBLY AND INSTALL NEW ASSEMBLY TRANSFER BULB IF GOOD.					223.50
THE CUSTOMER INSTALLED ONE BUT NEEDS INSTALLED CORRECTLY. THE OTHER ONE IS INSIDE THE VEHICLE AND NEEDS INSTALLED.					
New N139612	SCREW, HEADLIGHT BUCKET TO FENDER PACK OF 6 1967-1979	1.00	2.82		2.82
New N171211	FUSE, 8 AMP (WHITE)	1.00	0.25		0.25
Labor Service - REMOVE OLD CARBURETOR INSTALL NEW CARBURETOR WITH NEW BASE GASKET AND FUEL FILTER. ADJUST CARBURETOR.					223.50

1620 EL CAMINO AVE  
SACRAMENTO, CA 95815



P. (888) 929-1949  
INFO@BUGFORMANCE.COM

BAR-AJ119887  
EPA-00178865

WWW.BUGFORMANCE.COM

FOLLOW US:

Invoice # 29758

1968 Volkswagen Beetle Base License # D195K1 Inv Date: 5/06/2024

New	113-129-029A	CARB,30/31 FITS S.P. with dual port adapter	1.00	193.04	193.04
New	47388	REDLINE WEBER PLUG, VACUUM - MISC SIZES EACH.	1.00	1.00	1.00

Revisions of Original Estimate - Original Estimate of Services and Parts \$1,017.00

Rev#	Date and Time	Who Contacted	Method	Contact #	Cont. By	Revise By	Total
1	5/06/2024 3:22PM	VIGIL, JOSHUA	By Phone	(916) 296-4382	WILL	377.13	1,394.13
CARBURETOR REPLACEMENT							

X \_\_\_\_\_  
Customer accepts revision to the invoice and agrees to pay revised amount.

Recommended Repairs and Services:

- 1. CHECK CLUTCH - HAS EXCESSIVE FREEPLAY.
- 2. CHECK FRONT END - HAS EXCESSIVE PLAY IN THE STEERING.
- 3. AXLE BOOTS LEAKED WHILE ON THE LIFT.

<p>I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.</p> <p>X _____ Vehicles left 3 days after repair may be subject to storage fees.</p> <p>X _____ Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's agreement with the issuer.</p>	<p>Posted 5/07/24 4:44PM CREDIT CARD-ALL 1,394.13</p>	<p>Invoice Summary</p> <table border="1"> <tr> <td>Parts</td> <td>411.94</td> </tr> <tr> <td>Labor</td> <td>946.15</td> </tr> <tr> <td><b>Sub Total</b></td> <td><b>1,358.09</b></td> </tr> <tr> <td>Sales Tax (2019)</td> <td>36.04</td> </tr> <tr> <td><b>Total</b></td> <td><b>1,394.13</b></td> </tr> </table>	Parts	411.94	Labor	946.15	<b>Sub Total</b>	<b>1,358.09</b>	Sales Tax (2019)	36.04	<b>Total</b>	<b>1,394.13</b>
	Parts	411.94										
Labor	946.15											
<b>Sub Total</b>	<b>1,358.09</b>											
Sales Tax (2019)	36.04											
<b>Total</b>	<b>1,394.13</b>											
<p>Discard old parts</p>	<p>Original Estimate: 1,017.00</p>	<p><b>Total 1,394.13</b></p>										