

Black Wolf Automotive Specialties

1320 Profit Court
Woodbridge, VA. 22191
Phone: 703-490-4000 Fax: 703-910-7740

We Take Care of Your Car As If It Were Our Own

Work Completed Date : 03/27/2017

Vehicle Received: 03/22/2017


INVOICE

5198

ASE Master Certified
ASE Advanced Level

INVOICE

Invoice Date: 03/27/2017

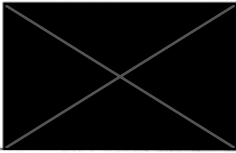

1969 Chevrolet - Chevelle -

Lic # : - VA

Odometer In : 0

VIN # :

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
PerTronix Flame-Thrower HEI Distributors PNX-D1070	1.00	384.00	384.00	Tow	187.50
Dynamat 5 19.7 sqft sheets 1	1.00	179.98	179.98	notes from drop off-carpet and dynamat seat belts- figure out or maybe upgrade. window and weatherstrip alignment	
carpet floor 50-286393-1	1.00	202.78	202.78	brake performance since upgrade outlet balls frozen/ glued in dash evaluate windshield	
Chevelle Tachometer With Gauge Cluster, 5500 Redline, 1969 50-251577-1	1.00	430.81	430.81	verify lock and latch performance repair all valve stems seat upgrade	
Chevelle Seat Belt & Shoulder Harness Kit, Front, 3-Point Retractable, Blue, 1966-1972 50-208154-1	1.00	291.59	291.59	2- Diagnose crank no start condition	125.00
Valve stems 1	4.00	3.00	12.00	- No spark, needs new distributor or new cap, rotor, coil and module.	
Pvc hose 1	1.00	15.00	15.00	3- Evaluate vehicle and recommend upgrades. Like A/C, Windows and dash Upgrade ideas- Change to 350 badges, ss gauge with tach. Vintage air with with serpentine drive kit.	125.00
Battery 8424	1.00	118.27	118.27	Replace pvc hose (swollen, vacuum leak). Replace battery date code 7/12.	
Tail light socket Is6447	1.00	17.18	17.18	-Front sway bar bushings are worn.Transmission pan is seeping. Power steering pump needs to be cleaned up and monitored for leaks. Valve cover gaskets are seeping. Both kick panels could be repainted. Sun visors need reupholstry. Needs new R/R tail light socket.	
Sway bar bushing Check bar before ordering 2651927	1.00	0.00	0.00	- Rear shocks look ok. Customer advised	
Transmission pan gasket 14417	1.00	14.40	14.40	4-Install distributor	187.50
Valve cover gasket Vs12869	1.00	29.70	29.70	5-Align windows and window trim- estimated	1000.00
Chevelle Air Conditioning Unit, Complete, Sure Fit, Gen IV.For Cars Without Factory Air Conditioning, Vintage Air, 1968-1969 50-211872-1	1.00	1863.99	1863.99	6-Verify door lock operation	125.00
Chevelle Serpentine Pulley Kit, Small Block, With Polished Wide Brackets & Short Water Pump, For Cars With Air Conditioning & Power Steering, 1964-1972 50-208155-1	1.00	1762.50	1762.50	7-Lay dynamat- estimated	1500.00
DEH-X8700BH Pioneer Radio DEH-X8700BH	1.00	180.00	180.00	8-Install carpet	n/c
Front speakers -5.5"- Pioneer 1	1.00	69.99	69.99	9-Replace tachometer with in cluster tachometer	250.00
Rear 6"x9" speakers- Pioneer 1	1.00	79.99	79.99	10-Reupholster sun visors	200.00
				11-Repaint kick panels	100.00
				12-Install shoulder belts	500.00
				13-Replace valve stems	100.00
				14-Replace pvc hose	12.50
				15-Replace battery	37.50
				16-Diagnose and repair tail lights, turn signals and tag lights	125.00
				17-R&R Sway bar links	25.00
				18-R&R transmission pan gasket	125.00
				19-R&R valve cover gaskets	250.00
				20-Alignment	250.00

Black Wolf Automotive Specialties

1320 Profit Court
 Woodbridge, VA. 22191
 Phone: 703-490-4000 Fax: 703-910-7740

We Take Care of Your Car As if It Were Our Own

Work Completed Date : 03/27/2017

Vehicle Received: 03/22/2017


INVOICE

5198

ASE Master Certified
 ASE Advanced Level

INVOICE

Invoice Date: 03/27/2017

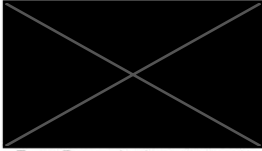

1969 Chevrolet - Chevelle -

Lic # : - VA

Odometer In : 0

VIN # :

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
350 fender emblem	1.00	116.98	116.98	21-Install Vintage air system- Estimated	1750.00
50-204528-1				22-Install Pulley and bracket kit- estimated	1000.00
Shop Supplies			39.42	25-Install windshield- estimated	650.00
				23- Remove rear glass and reseal- estimated. Glass could crack during operation. Customer advised.	1000.00
				24- Install complete stereo system. Includes head unit, front speakers, rear speakers and new speaker wires	500.00
				26-Install fender emblems	200.00

Org. Estimate 460.69 Revisions 17,030.95 Current Estimate 17,491.64

Revision # 1. Previous Estimate Amount: 460.69 Additional Cost: 10353.29 Revised Estimate: 10813.98 Parts: \$3458.21 Labor: \$5787.50 Sublet: \$650.00 Taxes & Fees: \$457.5800 Authorized by - Fallon, Jm. Date - 3/22/2017, Time - 3:33 PM. Initiated By - Shop. Phone Number - Cellular: 703-944-6497

Revision # 2. Previous Estimate Amount: 10813.98 Additional Cost: 6677.66 Revised Estimate: 17491.64 Parts: \$3626.49 Labor: \$2750.00 Sublet: \$0.00 Taxes & Fees: \$301.1700 Authorized by - Fallon, Jm. Date - 3/24/2017, Time - 1:37 PM. Initiated By - Shop. Phone Number - Cellular: 703-944-6497

Labor:	9,675.00
Parts:	5,808.58
Sublet:	650.00
SubTotal:	16,133.58
Tax:	348.51
Total:	16,482.09
Bal Due:	\$16,482.09

[Payments -]

An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs and storage. All Attorney and legal fees necessary to secure Black Wolf Automotive Specialties pecuniary interests will be the responsibility of the opposing party. Warranty on parts and labor is two years or 24,000 miles, whichever occurs first, unless otherwise noted. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Storage of \$50.00 a day will be charged if not picked up within 48 hours of completion.

Signature _____ Date _____ Time _____



Circle Auto Repair
 3171 Spring St.
 Fairfax, VA 22031
 Phone: 703-591-8112 Fax: 703-591-4322

8/27/2021 10:07:00AM


Invoice #
24669

Estimate #: 46004

1969 Chevrolet Chevelle SS Red

Odometer In: 67952
 License: AQ 909 - VA VIN: 136379B370460

Inspection: 09/16/2020 Manufactured 09/16/2020

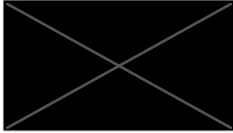

Description Of Services

Continued From Previous Page

Recommendations

- 06/09/2021 Your vehicle's transmission fluid is due for service soon based on vehicle's mileage. Transmission fluid should be serviced every 30,000 miles or every 2 years. Check with the customer on history of transmission fluid.
- 06/09/2021 Power steering fluid is ok at this time. It is due to be Exchanged soon based on vehicle's mileage.

Service Advisor: Foley, Jeff
 Technician(s): Frisby, David

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 36 MONTHS/ UNLIMITED MILE whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. For NATIONWIDE WARRANTY INFORMATION - CALL 1-866-588-0728 (Technet)



Labor Total:	\$3,598.89
Parts Total:	\$9,933.65
Job Supplies:	\$144.38
Hazmat Disposal:	\$3.73

Sub Total:	\$13,680.65
Tax Total:	\$604.68
Grand Total:	\$14,285.33
Balance Due:	\$10,785.33



SIGNATURE.....Date.....

Payment(s)
 7/15/2021 9:54:38AM \$3,500.00 Visa

Circle Auto Repair
Google Review Please

Circle Auto Repair
Thank you!
 For supporting our small
 business

Circle Auto Repair
3 Yr/Unlimited





Circle Auto Repair

3171 Spring St.
Fairfax, VA 22031
Phone: 703-591-8112 Fax: 703-591-4322

8/27/2021 10:07:00AM


Invoice #
24669

Estimate #: 46004

1969 Chevrolet Chevelle SS Red

Odometer In: 67952
License: AQ 909 - VA VIN: 136379B370460

Inspection: 09/16/2020 Manufactured: 09/16/2020

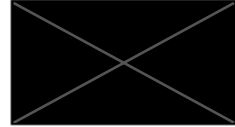

Vehicle Time In: 8/27/2021 10:06:21AM

Description Of Services

Install fuel injection kit and program

Install complete EFI system and stand alone computer. Install new ignition distributor , fuel tank and run all new wiring and fuel lines.

Description	Quantity
Antifreeze -Universal Extended Life	2.00
Fuel Pump Block-Off Plate	1.00
Fuel injection kit	1.00
Manifold Gasket Set - Intake	1.00
Thermostat- Safe-T-Stat - Alternate Temp	1.00
Ignition update set including 565200 distributor, 556153 coil, 556151	1.00
Ignition box, 8213 bracket	
Throttle linkage bracket	1.00
Steel braided fuel line kit	1.00
Fuel line fitting kit	1.00
Fuel tank kit with pump and sender	1.00
Barbed fuel line connectors	2.00
Connector 3/8 kit	1.00
Air Cleaner	1.00

Job Total: \$13,532.54






Circle Auto Repair

3171 Spring St.
Fairfax, VA 22031
Phone: 703-591-8112 Fax: 703-591-4322

7/13/2021 11:37:00AM

Invoice #
24630

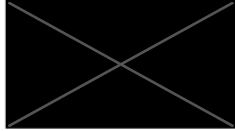

Estimate #: 45960

1969 Chevrolet Chevelle SS Red

Odometer In: 67912

License: AQ 909 - VA VIN: 136379B370460

Inspection: 09/16/2020 Manufactured 09/16/2020

Description Of Services

Continued From Previous Page

Recommendations

- 06/09/2021 Your vehicle is due for an Oil Change by date
- 06/09/2021 Your vehicle's transmission fluid is due for service soon based on vehicle's mileage. Transmission fluid should be serviced every 30,000 miles or every 2 years. Check with the customer on history of transmission fluid.
- 06/09/2021 Power steering fluid is ok at this time. It is due to be Exchanged soon based on vehicle's mileage.
- 06/09/2021 Minor amount of power steering fluid is seeping out of the power steering gear.

Service Advisor: Foley, Jeff
Technician(s): Frisby, David; SELECT, PLEASE

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 36 MONTHS/ UNLIMITED MILE whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. For NATIONWIDE WARRANTY INFORMATION - CALL 1-866-588-0728 (Technet)



Labor Total:	\$468.96
Parts Total:	\$120.92
Job Supplies:	\$47.19
Hazmat Disposal:	\$3.73

Sub Total:	\$640.80
Tax Total:	\$10.09
Grand Total:	\$650.89
Balance Due:	\$650.89



SIGNATURE.....Date.....

Circle Auto Repair
Google Review Please

Circle Auto Repair
Thank you!
For supporting our small
business

Circle Auto Repair
3 Yr/Unlimited





Circle Auto Repair

3171 Spring St.
Fairfax, VA 22031
Phone: 703-591-8112 Fax: 703-591-4322

7/13/2021 11:37:00AM

Invoice #
24630


Estimate #: 45960

1969 Chevrolet Chevelle SS Red

Odometer In: 67912

License: AQ 909 - VA VIN: 136379B370460

Inspection: 09/16/2020 Manufactured 09/16/2020

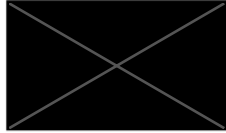

Vehicle Time In: 7/13/2021 11:37:01AM

Description Of Services

[Confirmed] drop off fuel leak

drop off fuel leak

Repair fuel leak at carburetor

Remove Carburetor, Repair leak at accelerator pump. Re install and adjust as necessary

Description	Quantity
Carburetor Gasket set	1.00

Carb # 80457-2

Job Total: \$589.88





Circle Auto Repair
 3171 Spring St.
 Fairfax, VA 22031
 Phone: 703-591-8112 Fax: 703-591-4322

6/10/2021 7:53:00AM

Invoice #
24458

Estimate #: 45781


1969 Chevrolet Chevelle SS Red

Odometer In: 67855

License: AQ 909 - VA

VIN: 136379B370460

Inspection: 09/16/2020 Manufactured 09/16/2020

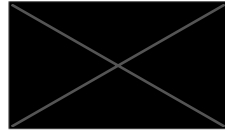

Description Of Services

Continued From Previous Page

Recommendations

- 06/09/2021 Your vehicle is due for an Oil Change by date
- 06/09/2021 Your vehicle's transmission fluid is due for service soon based on vehicle's mileage. Transmission fluid should be serviced every 30,000 miles or every 2 years. Check with the customer on history of transmission fluid.
- 06/09/2021 Power steering fluid is ok at this time. It is due to be Exchanged soon based on vehicle's mileage.
- 06/09/2021 Minor amount of power steering fluid is seeping out of the power steering gear.

Service Advisor: Hamideh, Lena
 Technician(s): Frisby, David

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 36 MONTHS/ UNLIMITED MILE whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. For NATIONWIDE WARRANTY INFORMATION - CALL 1-866-588-0728 (Technet)



Labor Total:	\$199.90
Parts Total:	\$230.76
Job Supplies:	\$34.45
Hazmat Disposal:	\$3.73

Sub Total:	\$468.84
Tax Total:	\$15.91
Grand Total:	\$484.75
Balance Due:	\$484.75



SIGNATURE.....Date.....

Circle Auto Repair
Google Review Please

Circle Auto Repair
Thank you!
 For supporting our small
 business

Circle Auto Repair
3 Yr/Unlimited





Circle Auto Repair

3171 Spring St.
Fairfax, VA 22031
Phone: 703-591-8112 Fax: 703-591-4322

6/10/2021 7:53:00AM


Invoice #
24458

Estimate #: 45781

1969 Chevrolet Chevelle SS Red

Odometer In: 67855
License: AQ 909 - VA VIN: 136379B370460

Inspection: 09/16/2020 Manufactured 09/16/2020

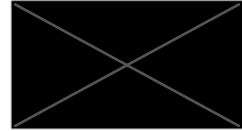

Vehicle Time In: 6/9/2021 4:54:13PM

Description Of Services

24 Point Quick Inspection: <https://2un.me/4atj8j3j>

24 Point Quick Inspection: <https://2un.me/q62j8j6e>

- 15W-40 Engine Oil Qt	5.00
Oil Filter	1.00

Job Total: \$44.51

Performed Lube Oil and Filter change, Lubricated chassis and performed health check

Job Total: \$28.56

Perform Service on Automatic Transmission: Pressurize All Fluid and Replace All Fluid - Perform Cleaning of Torque Converter and All Components Using BG ATF Cleaner

Remove transmission cooler line fittings to access flushing ports on transmission. Setup and configure machine to allow two way pressurized transfer of transmission fluid to and front transmission and torque converter. Perform clean of transmission passages, valve body, and torque converter using pump and cleaner. Replenish transmission with proper amount of fluid. Reconnect transmission fittings and verify proper operation.

Description	Quantity
Automatic Transmission Fluid	16.00
BG Complete Transmission Service Kit	1.00

Job Total: \$357.59





w Tinting

ille Rd
20110

Sales Receipt

DATE	SALE NO.
6/10/2017	22894

MODEL	WARRANTY #	SALESMEN	INSTALLE...	PAYMENT/ PO#
		Amy	Bee/Travis	Visa
DESCRIPTION	SHADING	QTY	AMOUNT	
	35 D486841	1	669.00T	
	15 D486842	1	109.00T	
			46.68	
			Total	\$824.68

Phone #	Fax #	E-mail	Web Site

Streets & Sons Tire and Auto Repair

9600-4 Ploof Rd. SE
 Leland, NC. 28451
 Phone: (910)-399-3557
 www.streetsandsonstireandauto.com | streetsandsonsautonc@gmail.com

Invoice # 005293
 Original Est # 5948

Invoice

Balance Due: \$1,211.61



1969 Chevy - Chevelle SS
 396
 VIN: 000013637 9B370460
 Odometer: In 68,202

License Plate: 83268 NC
 Color:

Work Complete: 04/10/2025
 Service Advisor: Erin Aldridge
 Customer ID: 2527

Hat: 444

Type	Description	Part #	Qty	Sale/Rate	Total
Full Vehicle Checkover					\$170.27
Labor	Full Vehicle Checkover Perform multipoint inspection on vehicle battery, brake system, tires, belt(s), hoses, lights, fluids, and check the manufacturer maintenance schedule for recommended maintenance items.				\$75.00
	Findings: DEAD BATTERY POWER STEERING PUMP IS LEAKING REAR MAIN SEAL STARTING TO LEAK TRANSMISSION FRONT PUMP SEAL LEAKING POSSIBLE OIL PAN GASKET LEAK - UNSURE IF IT IS SPLASHING BACK FROM OTHER LEAKS IN FRONT OF IT REAR PINION SEAL IS LEAKING REAR DIFF MOUNTS BLOWN OUT RF SWAY BAR LINK BUSHINGS FALLING APART				
Labor	Alignment Check CHECKED ALIGNMENT- RECOMMEND FRONT END ALIGNMENT. RF TOE AND LF CAMBER NEED ADJUSTING.				\$25.00
Labor	Replace/fix glovebox lock REMOVED LOCK BARREL AND REMOVED LATCH HOUSING FOR GLOVEBOX, INSTALLED NEW HOUSING, INSTALLED NEW LOCK BARREL INTO HOUSING AND VERIFIED LATCH OPERATION-LOCK LATCH OPERATING AS DESIGNED WHEN OPEN. HAD TROUBLE CLOSING LATCH ASSEMBLY- SEEMS LIKE STRIKER FOR GLOVEBOX IS NOT ALIGNED PROPERLY CAUSING GLOVEBOX LID TO BE VERY HARD TO LATCH AND UNLATCH. NEW LOCK ASSEMBLY WORKS PROPERLY- ALIGNMENT ISSUE WITH LID STRIKER.			\$119.00	\$59.50
Parts: \$0.00 Labor: \$159.50 Tax: \$10.77 Total: \$170.27					
Remove & Replace Vehicle Battery					\$230.63
Labor	Remove & Replace Vehicle Battery REPLACED BATTERY AND VERIFIED GENERATOR IS CHARGING AT 14V			\$119.00	\$35.71
Part	ProPower Plus Battery 600 CCA RC110	24-DL	1.00	\$180.35	\$180.3
Parts: \$180.35 Labor: \$35.70 Tax: \$14.58 Total: \$230.63					
Diagnostics					\$127.00
Labor	Customer requests: check timing SET UP TIMING LIGHT AND IDLED VEHICLE WHILE MONITORING CRANK PULLEY- ACCORDING TO TIMING LIGHT- LOOKS LIKE ENGINE IS RUNNING ADVANCED ABOUT 40 DEGREES				\$59.5

Type	Description	Part #	Qty	Sale/Rate	Total
Diagnostics [Continued]					\$127.03
Labor	Check tachometer wiring. Customer states it has erratic function. INSPECTED TACH WIRING IN ENGINE BAY- NO ISSUES WITH WIRING FOUND AT THIS TIME. POSSIBLE ISSUE WITH HOLLEY SOFTWARE? RECOMMEND TAKING TO HOLLEY EFI SPECIALIST FOR FURTHER DIAG				\$59.50
Parts:	\$0.00	Labor:	\$119.00	Tax:	\$8.03
				Total:	\$127.03
Power steering pump					\$407.11
Labor	Remove & replace power steering pump REMOVED POWER STEERING PUMP FROM VEHICLE, PRESSED OFF RESERVOIR AND PRESSED ONTO NEW PUMP WITH NEW O RINGS, RE-INSTALLED, ADDED AND BLED P/S SYSTEM, BLED COOLING SYSTEM.				\$178.50
Part	LARES POWER STEERING PUMP Without Reservoir	12009	1.00	\$187.37	\$187.37
Part	POWER STEERING FLUID	SPPSF12	2.00	\$7.75	\$15.50
Labor	Remove and replace right front sway bar link bushings REMOVED AND INSTALLED NEW BUSHINGS ON RF SWAY BAR LINK				\$59.50
Part	MOOG SWAY BAR LINK	K8266	1.00	\$8.58	\$8.58
Labor	Front End Alignment with Shims Road test vehicle. Check all suspension and steering parts for wear. Check tire pressure and condition. Check alignment specs. Adjust caster, camber, and toe as needed on front two wheels.				\$150.00
Parts:	\$0.00	Labor:	\$150.00	Tax:	\$10.13
				Total:	\$160.13
Order					\$43.76
Misc	Shop Supplies				\$43.76
Total:	\$43.76	Tax:	\$0.00		

Thank you for your business.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Labor	\$702.20
Parts	\$391.80
Supplies	\$43.76
Subtotal	\$1,137.76
Labor Tax	\$47.40
Parts Tax	\$26.45
Order Total:	\$1,211.61

Signature _____

Date _____

Time _____

"TRI-FIVE RESTO RODS"

703 376 1234

STERLING/LEESBURG Virginia

DATE: July 05, 2013

TO:



FROM: Rick Sears (Shop Rate = \$55.00hr)

REFERENCE: 1969 Chevelle 2dr Sport Coupe (SS396 Badging)

Factory Specifications:

1969 Chevrolet "Chevelle" 2dr Sport Coupe / VIN = 136379B3-----
350 CU/4barrel
Turbo 350 Transmission
GM 10 Bolt Rear

TRIM TAB DATA:

"ST69 13637BAL234007"
53/53 = Glacier Blue (Exterior)
762 = Dark Blue/Bench Seat (Interior)
Built 4th week April/1969
Factory Tire Size = 215-70-14 (26.0" Tire)

Owner Complaint:

Car has vibration at mid speed/check front end for wear
Drivers Window does not work properly
Gas Gauge is not functioning

Upon inspection and road test, the vehicle did have a vibration starting at 45mph and continuing to roughly 60mph which at that speed the vibration decreased to almost none. The gas gauge, after a continuity test the sending unit was found to be not functioning. Found tires underinflated, Rear Air Shocks had no air and the air lines were obstructed, front wheel bearings not sufficiently greased.

Repairs:

Front End; was thoroughly checked for wear, none was found, the front wheel bearings were repacked, front shocks replaced Air Shock lines repaired. All the tires were "Road Forced" balanced, it was determined the wheels and tires are no good.
Labor hours..... 4 hours
Gas Gauge; gas tank was removed, new sending unit installed
Labor hours.....3 hours

Drivers Door; R&R Door Panel / Re-Align Door Glass	
Labor hours.....	4 hours
Mount/Balance New Tires / Install	
Labor hours.....	N/C

Parts procured:

Front Shocks / pair.....	\$ 95.90
GM Sending Unit.....	\$ 86.95
Chevelle Window Door Hardware Kit	\$ 121.00
Gas / 5 gal.....	\$ 19.90
Wheels, SS39615X7-4.75 (2ea).....	\$ 280.00
Wheels, SS39615X8-4.75 (2ea).....	\$ 288.00
Caps, SS396 (4ea).....	\$ 160.00
Rings, 15X7 GM "Re Productions"	\$ 160.00
Valve Stem Kit.....	\$ 12.00
Tires, BF Goodrich 225-70R 15 RWL T/A Radial (2ea) (9X27.4dia)...	\$ 256.00
Tires, BF Goodrich 255-70R 15 RWL T/A Radial (2ea) (10X29.1dia)..	\$ 250.00

Sublet Labor" (Mr. Tire)

Road Force Balance.....	..\$ 125.73
Mount /Balance 4ea.....	..\$ 135.55
Shipping/Taxes Tire/Parts...	\$ 52.00

Total Parts.....	\$ 1,729.75
Total Sub Let Labor/Shipping.....	\$ 313.38
Total Shop Supplies.....	\$ 25.00
Total Labor.....	\$ 605.00

Deposit.....	\$ 2,600.00
--------------	-------------

Balance Due.....	\$ 73.13
-------------------------	-----------------

Rick Sears "Tri Five Resto Rods"
128 Evergreen St.
Sterling VA. 20164
703 376 1234

1969

From 1969 on, the SS was no longer a separate model. Instead, it was now an "SS" option package added to a 300 Deluxe model, Malibu model, or El Camino Custom model. 1969 was the only model year that the SS package could be ordered on the base model Chevelle 300 Deluxe (as a 2-door coupe or a 2-door post sedan). The only SS option in '69 was the "Z25" SS-396 package. The '69 and up cars are harder to authenticate because the VIN can not be used to confirm if the car is an SS.

There were two colors that were exclusive to the '69 SS. "Monaco Orange" (code 72) and "Daytona Yellow" (code 76). If either of these paint codes appear on the cowl tag (and the cowl tag is genuine) then that would prove the car to be a genuine SS.

If someone had a nice '69 Malibu, and a rusted out '69 SS, it would be easy for them to simply move the SS equipment over to the Malibu. As long as they did not alter or move the VIN plates or cowl tags, this would be perfectly legal, and since the VIN tag doesn't tell you much, there would be almost no way for you to know.

From '69 on, single-piston disk brakes were STANDARD equipment with the SS package. These brakes are easier to find parts for than the earlier four-piston disk brakes.

Chevrolet literature indicates that the only way to get a 396 was with the SS package. However, there appears to be at least one late-production Chevelle that was built with a 396 and all the required SS equipment, but the "Z25" SS-396 option was not listed on the car's build sheet. It is believed that this car came from the factory with "SS" emblems, but that is not 100% certain.

Again in 1969, the only available SS engine was the 396 (in the same flavors as in 1968). In 1969, however, it was possible (if you knew who to talk to) to order something called a COPO 427 Chevelle. COPO stands for "Central Office Production Order". The COPO program allowed dealers to order equipment that was not usually available (such as special paint, special engines, etc.) Unlike the '68s, the '69 Chevells had their 427 engines installed at the FACTORY, not the dealership. This makes the '69 427s more legitimate in the eyes of collectors today. You didn't necessarily have to go to Yenko or some other special dealer in '69 to get a 427 Chevelle. Your local dealer could usually get you one if you filled out the right paperwork. While the '69 COPO 427s had basically the same equipment as the SS-396s, they were not generally considered SSs because they did not have any external "SS" or "427" identification. They were the ultimate sleepers. Any genuine '69 COPO 427 Chevelle is quite valuable today. There are also unconfirmed reports of a '69 COPO 427 El Camino.

In addition, there was an "L89" aluminum head option available for the '69 375 HP 396. Few were ordered.

1969 SSs had "SS/396" emblems on the front, back, fenders, door panels, on the dash above the glove box, and on the standard SS steering wheel. The '69 SS also had the twin-bulge hood like the '68s, but the bolt holes where the hood hinges attached were slightly different. The '69 SS came with 14" SS wheels with "SS" center caps. The '69 SS stripe option consisted of a black, white, or red stripe which ran along the upper body sides. There are also reports of a few '69 SSs with dealer-painted hood stripes, similar to the stripes used on many '70-'72 SSs.

Another rare car, produced only in '69, was an SS Chevelle built on the 2-door post sedan, the "Chevelle 300". This was the only year that a 2-door post sedan SS was produced. Most of the '69 SSs, and all the '70-'72 SSs, were built upon the 2-door Malibu pillarless coupe.

23551 Pebble Run Pl #150
Sterling, VA 20166
info@xtremeautodetails.com
XtremeAutoDetails.com
(1) 250-7005



Invoice: 15247
Date: 06/18/2021

Customer:



Year: 1969 Mileage: 678807
Make: Chevrolet License: AQ909
Model: Chevelle Super Sport VIN: 136379B370460

Description	Quantity	Rate	Amount
PAINT CORRECTION SOLUTIONS - SINGLE-STAGE PAINT CORRECTION + Paint defect removal up to 80% + Hand wash (non-marring technique) + Chemical process to remove embedded contaminants in the paint + Single-stage DA paint correction + Opti-Seal (Other options available for an additional cost) + Door and trunk jambs cleaned + Full wheel detail Interior vacuum and wipe-down	1	\$795.00	\$795.00*
PAINT PROTECTION SOLUTIONS - IGL Coatings KENZO + 10H 2 Layer Coating Graphene Infused + 5 Years IGL Coatings Warranty + Complimentary Inspection Hand Wash (15 days after application)	1	\$1,400.00	\$1,400.00

*Indicates non-taxable item

Subtotal \$2,195.00
Discount \$219.50
TAX 6% \$75.60
Total \$2,051.10
PAID \$0.00

Balance Due \$2,051.10