

280Z Picked up 11/29/23

Rays Auto Repair

1200 Central Ave.
Napa, CA 94558
707-253-7102

ARD: 262284 EPA: CAL000355566 NAPA Auto Care Center

Customer Copy

Invoice #1062398

Estimated Time Due

Wednesday, November 29, 2023
4:09:18 PM

Ordered on
Tuesday, November 28, 2023

Workorder # 1067380

MAKE & MODEL	FLEET NO.	PHONE	REP	CSH	PO #	TERMS	
1978 DAIMATSUN 280Z		7	Steve Price-	SMP		Cash	
LICENSE NO.	MILES IN/OUT	VIN	TORQUE	ENGINE SIZE	TRANSMISSION	COLOR	PRD DATE
	2361	HL530456548			4SPEED	RED	04/78
CATALOG	DESCRIPTION	QTY	PARTS	LABOR	DISC	TOTAL	Code

	Exhaust Leak at Manifold, Oil Leak at Engine Oil Pan, Front Brake Calipers are Seized, Rear Wheel Cylinders are Leaking and Brake Hoses are Cracked. Brake Master Cylinder is Leaking and Damaged Brake Booster						
SL	Replace Exhaust Manifold Gasket and Heli Coil Broken Bolt	5.2		180.00		\$936.00	SMP
SL	Replace Engine Oil Pan Gasket, Oil Filter and Oil	2.6		180.00		\$468.00	SMP
SL	Replace Front Brake Rotors, Pads, Calipers, Brake Hoses, Pack Wheel Bearings and Bleed System	2		180.00		\$360.00	SMP
SL	Replace Rear Brake Wheel Cylinders, Hoses and Bleed System	1.5		180.00		\$270.00	SMP
SL	Replace Brake Booster and Brake Master Cylinder, Bleed System	1.5		180.00		\$270.00	SMP
OP	N-MS91034 Exhaust Manifold Gasket Set	1	25.96			\$25.96	
OP	N-OS20076 Oil Pan Gasket Set	1	18.34			\$18.34	
OP	N-PF794M Front Brake Pad Set	1	45.02			\$45.02	
OP	N-9234RGS Front Brake Rotor	2	105.07			\$210.14	
OP	R-1039XA Brake Caliper	1	83.76			\$83.76	
OP	R-1039XB Brake Caliper	1	83.76			\$83.76	
OP	N-18864 Wheel Seals	2	12.03			\$24.06	
OP	N-37405 Rear Brake Wheel Cylinders	2	47.88			\$95.76	
OP	N-36940 Front Brake Hoses	2	39.59			\$79.18	
OP	N-36892 Rear Brake Hoses	2	32.99			\$65.98	
OP	N-NMC21947 Brake Master Cylinder	1	108.56			\$108.56	
OP	N-535104 Brake Booster	1	194.90			\$194.90	
OP	N-42136 Air Filter	1	23.71			\$23.71	
OP	N-1515 Oil Filter	1	11.87			\$11.87	
OP	N-7041910 Oil Drain Plug	1	6.20			\$6.20	
OP	N-5W30 Motor Oil	5	7.50			\$37.50	

Welcome, We appreciate your business.

PAID BY
VISA-M/C \$3,611.27

TIRES FILLED TO:



Parts	\$1,208.60	Taxable	\$1,208.60
Labor	\$2,304.00	Non-Taxable	\$2,309.00
Freight	\$0.00	Local Tax (Set in Sa)	\$93.67
Other	\$5.00		
Supplies	\$0.00		
TOTAL		\$3,611.27	

Parts and Labor warranties 24 month or 24,000miles, whichever comes first. This warranty limited to the work on this form only. Vehicle must be returned to our shop at customer's expense, to honor warranty. I hereby authorize the repair work to be done along with the necessary materials. You and your employees may operate vehicle for purposes of testing, inspection or delivery at my risk. An express Mechanic's lien is acknowledged on vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Because of the extent of the teardown and inspection, the vehicle may not perform as well as before. No refunds on Special Orders or discontinued items. All returns are subject to 15% handling charge. Any deposits are subject to forfeit if cancelled.

Print Name _____

Signature _____

Date _____

Rays Auto Repair

1200 Central Ave.
Napa, CA 94558
707-253-7102

ARD: 262284 EPA: CAL000355566 NAPA Auto Care Center

Customer Copy

Invoice #1058715

Estimated
Time Due

Monday, October 12, 2020
4:18:40 PM

Ordered on
Monday, October 05, 2020

Workorder # 1062572


MAKE & MODEL	FLEET NO.	PHONE	REP	CSH	PO #	TERMS	
1978 DAUTSUN 280Z			Teresa Price	TJP		Cash	
LICENSE NO.	MILES IN/OUT	VIN	TORQUE	ENGINE SIZE	TRANSMISSION	COLOR	PRD DATE
	2,082	HL530456548					
CATALOG	DESCRIPTION	QTY	PARTS	LABOR	DISC	TOTAL	Code

SL	Drivers door will lock but will not unlock-Removed drivers door panel for inspection - arm on back of lock cylinder worn out - not moving far enough to unlock - Recommend replacing both door lock cylinders with arms Lock Cylinder set with keys \$100.18 X 2 = \$200.36 Labor \$300.00 Total \$500.36 Plus Tax	1		.00		\$0.00	KDP
SL	Reverse lights do not work - Back Up Light switch broken	0.5		150.00		\$75.00	KDP
OP	N-18-2000 BackUp Light Switch	1	33.88			\$33.88	
OP	N-77-78 Door Lock Cylinder With Keys	1	100.18			\$100.18	
SL	Install New Door Lock Cylinders	1.6		150.00		\$240.00	KDP
FRE	Freight on Special Order Parts	1	8.93			\$8.93	

Welcome, We appreciate your business.

PAID BY
VISA-M/C \$468.38

TIRES
FILLED
TO:

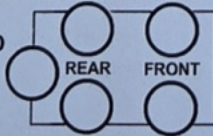

Parts	\$134.06	Taxable	\$134.06
Labor	\$315.00	Non-Taxable	\$323.93
Freight	\$8.93	Local Tax (Set in Sa	\$10.39
Other	\$0.00		
Supplies	\$0.00		
TOTAL			\$468.38

Parts and Labor warranties 12 month or 12,000miles, whichever comes first. This warranty limited to the work on this form only. Vehicle must be returned to our shop at customer's expense, to honor warranty. I hereby authorize the repair work to be done along with the necessary materials. You and your employees may operate vehicle for purposes of testing, inspection or delivery at my risk. An express Mechanic's lien is acknowledged on vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Because of the extent of the teardown and inspection, the vehicle may not perform as well as before. No refunds on Special Orders or discontinued items. All returns are subject to 15% handling charge. Any deposits are subject to forfeit if cancelled.

Thank you!

Print Name _____ Signature _____ Date _____

Invoice #1062398
Order # 1062398
Monday, November 28, 2023

ITEM	QTY	UNIT PRICE	AMOUNT	PRO DATE
TRANSMISSION	1	190.00	190.00	11/18
LABOR	1	190.00	190.00	
TOTAL			380.00	

- \$380.00 SMP
- \$68.00 SMP
- \$360.00 SMP
- \$270.00 SMP
- \$270.00 SMP
- \$25.96
- \$18.34
- \$45.02
- \$210.14
- \$83.76
- \$83.76
- \$24.06
- \$95.76
- \$79.18
- \$65.98
- \$108.56
- \$194.90
- \$23.71
- \$11.87
- \$6.20
- \$37.50

\$1,208.60
\$2,309.00
\$93.67

11.27

NORTH COAST BUSINESS FORMS 255-3700

8807 (DAYSUN)

2807 - SMOG