

Invoice 1178

CUSTOMER ORDER NO.	DATE	PAGE
Keith Zimmer	9/19/2014	1

PO NO.	
SALESPERSON	
TERMS	Upon Receipt

SOLD TO:

DESCRIPTION	QUANTITY	UNIT PRICE	DISCOUNT	AMOUNT
Check front suspension, Front shock is broken at lower mounting point.			\$0.00	
Replace both front shocks with new updated Koni coil over shock.			\$0.00	
Adjust coil for correct ride height.	2.00	\$115.00	\$0.00	\$230.00
PARTS LIST			\$0.00	
Koni coil over shock	1.00	\$699.00	\$0.00	\$699.00
Shipping	1.00	\$22.50	\$0.00	\$22.50
			WI Sales Tax	\$48.53


COMMENTS


Shelby Cobra

SUBTOTAL	\$951.50
TAX	\$48.53
TOTAL AMOUNT	\$1,000.03
AMOUNT RECEIVED	\$0.00
BALANCE DUE	\$1,000.03

LATE MODEL THROTTLE, LLC

CFI SAE Smoothing: 5

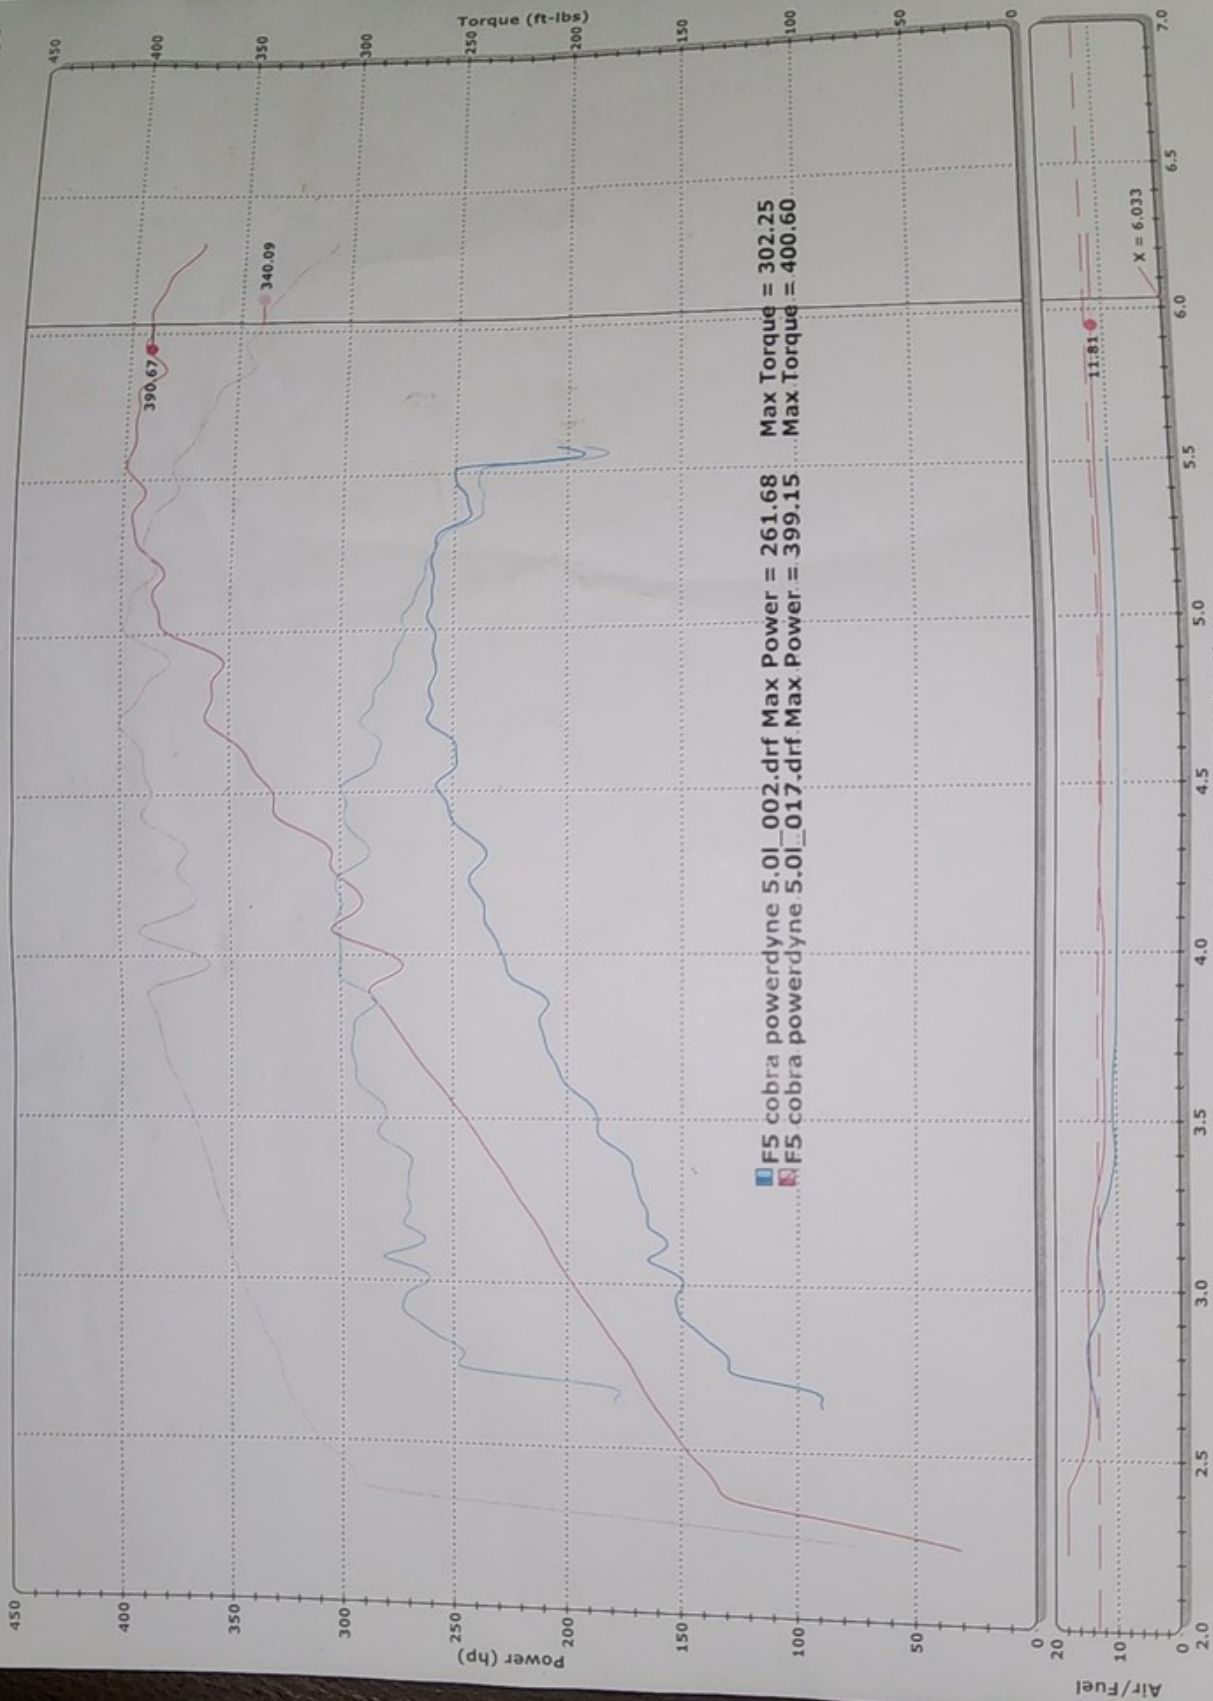



525 Progress Ave, Ste B
Waukesha, WI 53186
www.latemodelthrottle.com
262-510-7582

Bill To

PAID
06/29/2015

REPAIR ORDER/INVOICE

Date	Invoice #
6/30/2015	4374

Engine Size	Mileage	Plate
5.7L	15,612	16574
VIN	Model Year	
MA31975	2003	

Stock #	Terms	Due Date	Vehicle Make	Vehicle Model
	Due On Delivery	6/30/2015	Factory Five	MK II

Description	part number	Qty	Rate	Amount
Hardware &/or software needed to gain access to vehicle's ECU to modify the appropriate parameters. (This is a one time fee.) Diablosport CMR chip		1	140.00	140.00T
Dyno Tune, 2WD Supercharged stroker dyno tune		1	475.00	475.00T
Mr. Gasket Overflow Tank, 34 Ounces, 3 in. Diameter, 10 in. Height, Stainless Steel, Polished, Universal, Each		1	57.99	57.99T
Remove And Install new coolant overflow tank, moving fill cap to highest location, bleeding cooling system		2.5	94.98	237.45T
Remove FMU from vehicle not needed will adjust tune accordingly after removal, fuel leak was from quick disconnect seperating, reseated quick disconnect, will check for additional leaks once racked and in the air.		1.5	94.98	142.47T
Fix customer starter bolt, that is tighten incorrectly at an angle		0.3	94.98	28.49T

1. Old parts removed from cars will be discarded unless otherwise instructed in writing.
2. All parts are sold without any warranty stated/implied except from the manufacturer due to the unusual stress placed on performance parts/vehicles.
3. Products not purchased through Late Model Throttle are the sole responsibility of the buyer and there is no warranty on the part or labor of installation due to defect or otherwise.
4. Returns will only be accepted for unused parts in brand new condition for store credit only. Special order items cannot be returned. NO EXCEPTIONS.
5. A 25% restocking fee may apply to any items returned.
6. Prices reflect a discounted cash price. A 3% charge will be applied to any invoice paid with a credit card.
7. Late Model Throttle is not responsible for any parts left behind after vehicle is picked up.
8. Storage fees of \$25/day will be assessed if vehicle is not picked up promptly.
9. LMT is not responsible for sensors that are unable to be re-used.

"Motor vehicle repair practices are regulated by chapter ATCP 132, Wis. Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911."

Total

Payments/Credits

Balance Due

*Thank you for your
business!*

All over due invoices will incur a fee of 10% of balance due, per week of non payment. Customer is responsible for any administrative, legal and filing fees associated with collection.

LMT
 12345 Ave, Ste B
 Waukesha, WI 53186
 latemodelthrottle.com
 262-510-7582

Bill To

PAID
 06/29/2015

REPAIR ORDER/INVOICE

Date	Invoice #
6/30/2015	4374

Engine Size	Mileage	Plate
5.7L	15,612	16574
VIN	Model Year	
MA31975	2003	

Stock #	Terms	Due Date	Vehicle Make	Vehicle Model
	Due On Delivery	6/30/2015	Factory Five	MK II

Description	part number	Qty	Rate	Amount
Set TPS and timing, gap plugs Gen. Shop fee, Misc supplies, environmental, disposal Sales Tax		1	94.98	94.98T
		1	25.00	25.00T
			5.10%	61.27

1. Old parts removed from cars will be discarded unless otherwise instructed in writing.
2. All parts are sold without any warranty stated/implied except from the manufacturer due to the unusual stress placed on performance parts/vehicles.
3. Products not purchased through Late Model Throttle are the sole responsibility of the buyer and there is no warranty on the part or labor of installation due to defect or otherwise.
4. Returns will only be accepted for unused parts in brand new condition for store credit only. Special order items cannot be returned. NO EXCEPTIONS.
5. A 25% restocking fee may apply to any items returned.
6. Prices reflect a discounted cash price. A 3% charge will be applied to any invoice paid with a credit card.
7. Late Model Throttle is not responsible for any parts left behind after vehicle is picked up.
8. Storage fees of \$25/day will be assessed if vehicle is not picked up promptly.
9. LMT is not responsible for sensors that are unable to be re-used.

"Motor vehicle repair practices are regulated by chapter ATCP 132, Wis. Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911."

Total	\$1,262.65
Payments/Credits	-\$1,262.65
Balance Due	\$0.00

*Thank you for your
business!*

All over due invoices will incur a fee of 10% of balance due, per week of non payment.
Customer is responsible for any administrative, legal and filing fees associated with collection.

LATE MODEL THROTTLE
525 PROGRESS AVE
HAUKESHA WI 53186
262-510-7582

Merchant ID: 192200673
Term ID: 1414

Sale

VISA

XXXXXXXXXXXX8017

Entry Method: Swiped

Apprvd: Online Batch#: 000009

08/26/15 15:25:42

Inv#: 00000002 Appr Code: 010760

Total: \$ 725.76

Customer Copy

THANK YOU

PAID
08/28/2015

REPAIR ORDER/INVOICE

Date	Invoice #
8/26/2015	4607

Engine Size	Mileage	Plate
5.7L	15,612	16574
VIN	Model Year	
MA31975	2003	

Terms	Due Date	Vehicle Make	Vehicle Model	
Due On Delivery	8/26/2015	Factory Five	MK II	
	part number	Qty	Rate	Amount
Intake manifold		0.5	94.98	47.49T
		1	22.73	22.73T
Intake Manifold		3.6	94.98	341.93T
Ignition- Rewired		1	94.98	94.98T
Test Wires		1	94.98	94.98T
		1	33.91	33.91T
Environmental,		1	33.42	33.42T
with cash		1	21.10	21.10T
			5.10%	35.22

1. Old parts removed from cars will be discarded unless otherwise instructed in writing.
2. All parts are sold without any warranty stated/implied except from the manufacturer due to the unusual stress placed on performance parts/vehicles.
3. Products not purchased through Late Model Throttle are the sole responsibility of the buyer and there is no warranty on the part or labor of installation due to defect or otherwise.
4. Returns will only be accepted for unused parts in brand new condition for store credit only. Special order items cannot be returned. NO EXCEPTIONS.
5. A 25% restocking fee may apply to any items returned.
6. Prices reflect a discounted cash price. A 3% charge will be applied to any invoice paid with a credit card.
7. Late Model Throttle is not responsible for any parts left behind after vehicle is picked up.
8. Storage fees of \$25/day will be assessed if vehicle is not picked up promptly.
9. LMT is not responsible for sensors that are unable to be re-used.

"Motor vehicle repair practices are regulated by chapter ATCP 132, Wis. Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911."

Total	\$725.76
Payments/Credits	-\$725.76
Balance Due	\$0.00

Thank you for your business!

All over due invoices will incur a fee of 10% of balance due, per week of non payment. Customer is responsible for any administrative, legal and filing fees associated with collection.



Valenti Classics, Inc
9848 S. 57th Street
Franklin, WI 53132
(414)421-6300
www.valenticlassics.com

Invoice

Date	Invoice #
12/01/2016	3809
Terms	Due Date
Due on receipt	12/31/2016

Bill To

PAID

Yr, Make, Model

1965 Cobra

Service	Activity	Quantity	Rate	Amount
Labor	• Complete Rewire of Car & Install New Harness, Tune Baseline & Setup(110 hours)	0	9,350.00	0.00T
HOL550-606N	• HP ECU & Harness, Ford MpFI, NTK	1	2,300.00	2,300.00T
HOL558-305	• Ford TFI Ign Harness	1	91.00	91.00T
HOL554-107	• 3 Bar Map	1	116.00	116.00T
Shipping	• Shipping	1	25.00	25.00T
14SG	• 14 Circuit Wiring Harness	1	300.00	300.00T
Shipping	• Shipping(Estimate)	1	35.00	35.00T
01501	• Self Canceling Turn Signal	1	98.00	98.00T
Shipping	• Shipping(Estimate)	1	15.00	15.00T
B0178IA6P0	• On/Off Toggle Switch	5	7.76	38.80T
B0050J1QYA	• Push Button Memory Switch	2	12.95	25.90T
Misc. Hardware	• Miscellaneous Hardware: Nuts, Bolts, Electrical Connectors	3	18.00	54.00T
Labor	• Employee Labor 11/10/16	1.75	85.00	148.75T
B00MAG6RM	• LED Bulb	1	17.00	17.00T
M				
EAR320006ER	• -6 Auto Flex Hose	1	151.79	151.79T
L				
EARAT230206	• Screen Fuel Filter	1	37.00	37.00T
ERLP				
RUS640870	• -6 Ford Fitting	2	12.75	25.50T
Shipping	• Shipping	1	16.50	16.50T
FRA-484106-B	• AN To Hose Barb Fitting	2	8.00	16.00T
L				
Shipping	• Shipping	1	9.00	9.00T

Continue to the next page

Service	Activity	Quantity	Rate	Amount
2Go-BTN-25-W	• Billet Button	1	31.20	31.20T
Shipping	• Shipping	1	13.00	13.00T
B01BLVS3BE	• Change Order 1-Kicker 4X6 Speakers	1	57.00	57.00T
B00MQ9ZDV4	• Change Order 1-3-Way Component Speakers	1	172.00	172.00T
Misc. Hardware	• Change Order 1-Miscellaneous Hardware: Nuts, Bolts, Electrical Connectors	1	18.00	18.00T
Labor	• Change Order 1-Labor To Install New Speakers(3 hours)	0	255.00	0.00T
Labor	• Employee Labor 10/28/16-11/17/16	27.19	85.00	2,311.15T
B007VR5YHO	• Brass Hose Barb Adapter	1	11.75	11.75T
Shipping	• Shipping	1	8.00	8.00T
FRA-491987	• Fuel Rail Fittings	1	22.10	22.10T
SUM-220122	• Reducers	1	13.00	13.00T
Shipping	• Shipping	1	13.00	13.00T
Labor	• Labor 11/8/16-11/28/16	26.97	85.00	2,292.45T
AT800106ERLP	• Hose Ends	6	11.15	66.90T
Shipping	• Shipping	1	20.00	20.00T
311591894422	• Cobra Idle Adapter Kit	1	260.00	260.00T
Labor	• Labor 11/29/16-12/05/16	27.2	85.00	2,312.00T
10622	• Red Tail Light	2	33.80	67.60T
Shipping	• Shipping	2	16.00	32.00T
Part	• PT753-Pigtail Socket	1	15.93	15.93T
Part	• 104LLBP2-Mini Bulb	2	6.03	12.06T
FEL1487	• Exhaust Header & Manifold Gaskets	1	27.97	27.97T
Shipping	• Shipping	1	10.00	10.00T
Labor	• Labor 12/06/16-05/23/17	36.16	85.00	3,073.60T
Part	• 5224-Spark Plugs	8	2.99	23.92T
Part	• 26286-Coil	1	40.76	40.76T
Part	• CBE32-Module	1	130.93	130.93T
Labor	• Labor 05/24/17-6/1/2017	9.27	85.00	787.95T
Labor	• Labor 6/02/17	2.43	85.00	206.55T
Other Fee		1	49.26	49.26
	• *** Final design & Selection To Be Made By Customer Any Changes Causing Additional Modifying Will Result In A Price Change & Change Order			
Hidden Damage Disclosure	• ***No Budget For Hidden Damage, Unknown Issues, TBD Items, Change Orders May Apply	1	0.00	0.00T
	• ***We will start in December, if we finish during winter/snow we will drop of the car enclosed.			

YOUR COMPLETE COLLECTOR CAR CENTER

SubTotal	\$15,620.32
Tax (5.6%)	\$871.98
Total	\$16,492.30
Payment	\$16,492.30
Balance Due	\$0.00

MATERIAL: ALL PARTS NEW UNLESS SPECIFIED: U-USED R-REBUILT

QTY	PART NO. OR DESCRIPTION	WARRANTY IF CHECKED	SALE
	IDEAL VALVE	96	08
	UPPER INTAKE GASKET	15	37
	THROTTLE BODY SET	17	45
	8 SPARK PLUGS	30	64

VALENTI CLASSICS, INC.

DEALER NAME: 6648 S. 67TH STREET
 ADDRESS: FRANKLIN, WI 53132
 CITY, ST, ZIP: (202) 835-2070 • FAX (414) 421-8313

PHONE: _____
 NAME: _____
 ADD: _____
 CITY: _____
 YEAR & MAKE: 1965 CORVETTE
 SERIAL NO.: _____
 LICENSE NO.: _____ ODOMETER: _____ MODEL: _____ COLOR: ORANGE
 ADDITIONAL WORK AUTHORIZED BY: _____
 NAME: _____
 DATE: _____ TIME: _____ AM PM NO. CALLED: _____ NEW ESTIMATE: _____

NO. 762070

DATE OF ORDER	DELIVERY DATE
8/11/14	8/14/14
TIME PROMISED	PHONE NO.
	262.391.674
ESTIMATED PRICE	LABOR CHARGE
1029.60	
LUBRICATE	☐
CHANGE OIL	☐
CHANGE OIL FILTER	☐
REPACK WHEEL BEARINGS	☐
SERVICE AIR CLEANER	☐
ROTATE TIRES	☐
CHANGE TRANS FLUID	☐
ALIGN FRONT END	☐
EMISSION CONTROL SERVICE	☐

TOTAL PARTS 159 30

SUBLET REPAIRS-TOWING

TOTAL SUBLET REPAIRS

GALS. GAS @

QTS. OIL @

LBS. GREASE @

TOTAL GAS, OIL & GREASE

OPER. NO.

LABOR INSTRUCTIONS

6 Hrs. RUN 3000 RPM IGNITION SYSTEM & INSPECT
UNITS, CLEAN AIR INTAKE, & MAINTAIN TIGHT
GAP2-THM INSPECT ELECTRICAL SYSTEM PER ALLIANCE
CABLE AND 7/28/14

3-4 INSPECT POWER STEERING OIL & 12.55 hrs

CHECK # 1446
PAID IN FULL

8/20/14

SEE REVERSE SIDE BEFORE SIGNING.

I HEREBY AUTHORIZE the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for the purpose of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I understand that all charges are due upon delivery of the vehicle. I acknowledge receipt of a copy of this agreement.

1. I request an estimate in writing before you begin repairs.

2. Please proceed with repairs, but call me before continuing if the price will exceed \$ _____

3. I do not want an estimate.

Do you want the replaced parts you are entitled to? ☐ Yes ☐ NoPayment will be made by: ☐ Cash ☐ Credit Card ☐ OtherCall when vehicle is ready? ☐ Yes ☐ No

☐ THIS VEHICLE WAS RECEIVED WITHOUT FACE TO FACE CUSTOMER CONTACT

Motor vehicle repair practices are regulated by Chapter AT CP 132, Wis. Admin. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911.

SHOP REPRESENTATIVE SIGNATURE

ESTIMATE CHARGE

INTERNAL SUMMARY

ACCT. CHARGE

FACTORY CLAIMS

CHARGE

DESCRIPTION

AMOUNT

TOTAL LABOR

TOTAL PARTS

GAS, OIL & GREASE

PAINT & BODY MATERIALS

SUBLET REPAIRS

SHOP SUPPLIES

SUB TOTAL

SALESTAX

TOTAL

1059.05

159.30

1258.95

69.34

1328.29

BIG BEAR TIRE COMPANY

W39834 Highway 16
Oconomowoc, WI 53066
(262) 567-4449

Sales Receipt

Date	Sale No.
8/4/2017	88302

Sold To:

Notes

Check No.	P'mt Type	Make/Model	Year	Mileage
	Visa	Cobra		

Item Code	Description	Quantity	Unit Price	Amount
EV117	EV117 MOOG Tie Rod	2	47.00	94.00
K719	K719 Moog Ball Joint	1	62.00	62.00
*301	Hourly Rate: Mechanic's Labor	1.8	80.00	144.00
*206	Corner Weight and 4 Wheel Alignment	1	200.00	200.00
/AAA Unkno...	tire	1	1,022.00	1,022.00
1550719	Continental Extreme Contact Sport P255/35R18	2	0.00	0.00
1550746	Continental Extreme Contact Sport P325/30R19	2	0.00	0.00
*110	Standard Vehicle Computerized Spin Balance	4	0.00	0.00
	Sales Tax		5.10%	77.62
PAID				

Total	\$1,599.62
--------------	------------

BIG BEAR TIRE REMINDS YOU TO LET US
KNOW IF YOU'RE NOT ABSOLUTELY
POSITIVELY 100% SATISFIED

BIG BEAR TIRE

Work Order: 8

R002562

Date:

8/3/17 8:14 AM

Cody
Ford : Mustang : 1964-66 : 8 Cylinder (Modified Specification)
ExpressAlign Total Alignment

Front : Left

Actual	Before	Specified Range
-1.5°	-1.4°	-2.8° -1.3°
4.9°	6.5°	3.0° 5.0°
0.05in	-0.01in	-0.02in 0.10in
19.4°	19.5°	
17.9°	18.1°	

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-1.5°	-1.5°	-2.8° -1.3°
4.9°	4.9°	3.0° 5.0°
0.03in	-0.05in	-0.02in 0.10in
20.0°	20.0°	
18.5°	18.5°	

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	Before	Specified Range
0.0°	0.1°	
0.1°	1.6°	
-0.6°	-0.5°	
0.08in	-0.06in	-0.05in 0.21in

Rear : Left

Actual	Before	Specified Range
0.0°	0.0°	
0.07in	0.07in	

Camber
Toe

Rear : Right

Actual	Before	Specified Range
-0.2°	-0.2°	
-0.16in	-0.15in	

Rear

Cross Camber
Total Toe
Thrust Angle

Actual	Before	Specified Range
0.3°	0.2°	
-0.09in	-0.08in	
0.23°	0.22°	

