

Syncro Car Care

850 Mountain Industrial Drive Northwest Suite 120, Marietta, GA 30060
(770) 693-0271 Service@syncrocarcare.com



[Invoice](#) [Visit Details](#)

AMOUNT DUE

\$0.00

Approved Jobs

✓ **Syncro Digital Vehicle Inspection - see results in Inspection tab**
Tech: T J

Labor

Inspect vehicle for safety and reliability concerns and advise on required immediate and upcoming repairs/maintenance

✓ Authorized on April 24, 2026 at 03:48 PM

Job Total
\$0.00

✓ **Syncro Free 15 Minute Inspection - Check pedals and bushings**
Tech: T J

Labor

Inspect customer concern(s) and advise on required repairs or if additional testing is required. Document fault codes if applicable

✓ Authorized on April 24, 2026 at 03:48 PM

Job Total
\$0.00

Note:

- the clutch pedal feels to have a little play i would suggest installing customer supplied rebuild parts

✓ **Syncro Oil and Filter Service - Full Synthetic**
Tech: T J

Labor

Renew engine oil and filter

Reset service interval reminder (if applicable)

Labor

Check Tire pressures, top up washer fluid.

Part**Qty**

Oil Filter Kit

1

Full Synthetic Engine Oil

6.5

☒ Authorized on April 24, 2026 at 03:48 PM

Subtotal
\$118.93
Est. Tax
\$3.73
Job Total
\$122.66
☒ **Install clutch pedal with all new hardware "customer supplied parts"**
 Tech: T J
Labor

Install clutch pedal with all new hardware "customer supplied parts"

Install bronze clutch pedal bushings

Part**Qty**

Clutch Pedal Spring Locking Pin - Dark Gray

1

Clutch Pedal Spring Locking Pin - Black

1

☒ Authorized on April 27, 2026 at 10:42 AM

Subtotal
\$502.56
Est. Tax
\$7.65
Job Total
\$510.21
☒ **Front brake service**
 Tech: T J
Labor

Perform front brake service

Part**Qty**

Brake Disc (315 X 28 mm)

1

Brake Disc (315 X 28 mm)

1

, EURO Ultra-Premium Ceramic, Ceramic Disc Brake Pad Set

1

, Electronic Disc Brake Pad Wear Sensor

1

☒ Authorized on April 27, 2026 at 10:42 AM

Subtotal
\$685.61
Est. Tax
\$18.08
Job Total
\$703.69

**Rear brake service**

Tech: T J

Labor

Perform rear brake service

Part

Qty

, EURO Ultra-Premium Ceramic, Ceramic Disc Brake Pad Set

1

, Electronic Disc Brake Pad Wear Sensor

1

Brake Disc (312 X 20 mm)

1

Brake Disc (312 X 20 mm)

1



Authorized on April 27, 2026 at 10:42 AM

Subtotal
\$574.59Est. Tax
\$13.72Job Total
\$588.31**Replace oil filter housing gasket and vanos line**

Tech: T J

Labor

Replace oil filter housing gasket and vanos line

Part

Qty

Engine Oil Filter Housing Gasket

1

, Conti-TCH Engine Oil Line

1



Authorized on April 27, 2026 at 10:42 AM

Subtotal
\$786.59Est. Tax
\$6.85Job Total
\$793.44**Replace serp belts due to cracking "also check all pulleys and tensioners possible rebuild"**

Tech: T J

Labor

Replace serp belts due to cracking "also check all pulleys and tensioners possible rebuild"

Part

Qty

ContiTech, Multi-Rib Serpentine Belt Accessory Drive Belt

1

ContiTech, Multi-Rib Serpentine Belt Accessory Drive Belt

1

, Shock Damper Accessory Drive Belt Tensioner Assembly

1

Part

Qty

Accessory Drive Belt Tensioner Pulley

1



Authorized on April 27, 2026 at 10:42 AM

Subtotal
\$578.34Est. Tax
\$17.41Job Total
\$595.75

Front control arm bushings

Tech: T J

Labor

Replace front control arm bushings

Part

Qty

Bushings Set for Control Arms

2



Authorized on April 27, 2026 at 02:45 PM

Subtotal
\$590.35Est. Tax
\$6.60Job Total
\$596.95

Rear control arms (Diff out)

Tech: T J

Labor

Replace rear lower control arms due to being bent

Part

Qty

Control Arm

2

Eccentric Bolt

2



Authorized on April 27, 2026 at 02:45 PM

Subtotal
\$579.26Est. Tax
\$11.70Job Total
\$590.96

Remove rear diff and reseal also replace diff bushings

Tech: T J

Labor

Remove rear diff and reseal also replace diff bushings

Part

Qty

Differential Mount - Differential Cover

2

Seal - Differential Output Flange (44 X 67 X 10)

2

Part	Qty
Subframe Mount	1
Seal - Differential Pinion Shaft (45 X 75 X 10 mm)	1
, Full Synthetic, GEAR COMP 75W140 1L Differential Oil	2
☒ Authorized on April 27, 2026 at 02:45 PM	
Subtotal	Est. Tax
\$1,594.29	\$26.49
Job Total	
\$1,620.78	

**Tie rods**

Tech: T J

Labor

Replace both left and right tie rods

Part	Qty
Steering Tie Rod Assembly	1
Steering Tie Rod Assembly	1
Rack and Pinion Bellows	2



Authorized on April 27, 2026 at 02:45 PM

Subtotal	Est. Tax	Job Total
\$757.32	\$10.85	\$768.17

**Syncro Four Wheel European Vehicle Alignment**

Tech: T J

Labor

Align four wheels to factory specification, advise if additional time or repairs are required to meet factory specification



Authorized on April 27, 2026 at 02:45 PM

Job Total
\$168.00

**Clutch and rear crank seal**

Tech: T J

Labor

Remove transmission and replace clutch components

Bleed clutch hydraulics

Replace rear crank seal and bridge seal while transmission is removed from the vehicle

Part	Qty
Clutch Kit	1
Dual-Mass Flywheel	1
Crankshaft Seal (90 X 110 X 12)	1
Gasket - Crankshaft Seal Housing	1
Flywheel Bolt (12 X 50 mm)	8
APA/, Premium, Brass Pin Upgrade Clutch Pivot Ball	1
Clutch Release Arm	1
Clutch Release Arm Spring	1
Transmission Clutch Pressure Plate Bolt	6
, Heavy Duty, W/NUTS+BOLTS Drive Shaft Flex Joint	1
Back-Up Light Switch (2 Blade Square Connector)	1
Seal - Manual Trans Selector Rod (15 X 21 X 5 mm)	2
Shift Rod Joint - Manual Transmission	1
☒ Authorized on May 06, 2026 at 01:40 PM	
Subtotal	\$4,028.98
Est. Tax	\$155.28
Job Total	\$4,184.26

▼ **Replace drive shaft flex disc and shift shaft seal (Trans out of vehicle)**

Tech: T J

Labor

Replace drive shaft flex disc and shift shaft seal

Part	Qty
, Heavy Duty, W/NUTS+BOLTS Drive Shaft Flex Joint	1
Manual Transmission Shift Shaft Seal	1
☒ Authorized on May 07, 2026 at 09:44 AM	
Subtotal	\$339.14
Est. Tax	\$8.82
Job Total	\$347.96

Repair Order Summary

Description	Amount
Total Jobs	\$11,302.20
Total Fees	\$1.76
Subtotal	\$11,303.96
Taxes	\$287.18
Grand Total	\$11,591.14
BALANCE DUE	\$0.00

AMOUNT DUE

\$0.00

Completed Transactions

Date	Name	Payment Method	Payment Info	Amount	Status
May 07, 2026 02:14 PM	Ross Harrell	 Card Not Present	****1006 Auth: 255903	\$11,591.14	Succeeded

Disclaimers

- Payment in full is due prior to collection of vehicle and within 5 days of service completion.
- As we have limited space, the client's vehicle must be picked up within 5 days. Thereafter, a storage fee of 40 dollars per day will be assessed. (Unless prior arrangements have been made)
- Items left at Syncro will become the shop's property after 10 days without prior arrangement.
- Our standard warranty is 3-years /36k miles on parts and labor, applicable on jobs wherein all parts are supplied by Syncro, unless otherwise stated. This is valid only when related components have not been tampered with or modified by other parties. Tires are not covered under our standard warranty but may have manufacturer warranty coverage- please check with the manufacturer or ask us for details.

- Special orders and custom items must be paid for in advance. A restocking fee, up to the cost of the part may be assessed. (esp if non-returnable)
- Customer supplied parts are not covered by our warranty, including labor. Additional service charges may be incurred for use of and issues arising from customer-supplied parts.
- Details on our nationwide warranty can be found here:
<https://members.technetprofessional.com/members/s/nationwide-36-warranty>

I hereby authorize the repair work listed hereon, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. Syncro will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to all collection cost and/or attorney's fees in the event default is made in any payment due. If automobile is returned to customer without repair service being performed, a diagnostic and handling charge (including reassembling) will be made.

NOTICE PURSUANT TO

GEORGIA PROPERTY CODE § 44-14-361

I am the person or agent acting on behalf of the person who is obligated to pay for the repair of the motor vehicle, subject to the repair agreement.

I understand that the vehicle is subject to repossession in accordance with Georgia Business and Commerce Code. If payment for the repair of the motor vehicle by a check, money order or a credit card transaction is stopped, dishonored because of insufficient funds, no funds or because the maker or drawer of the order or the credit card holder has no account or the account upon which it is drawn or the credit card account has been closed.

Declined Jobs

Re-seal engine oil pan

 Declined on April 27, 2026 at 10:44 AM

Subtotal	Est. Tax	Job Total
\$1,190.84	\$2.28	\$1,193.12

Exterior door handle body seals

 Declined on April 27, 2026 at 10:44 AM

Subtotal	Est. Tax	Job Total
\$1,076.48	\$6.99	\$1,083.47

Need a copy for your records?

 Print

Questions? Contact Us.

 Call

 Email



Detail Service Record

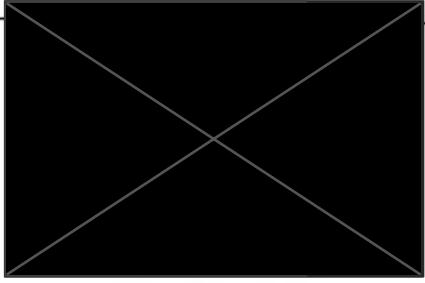
Work/Repair Order: 15923747

Shop Management System Invoice Number: dms-255410949

Service Writer: System User

Department:

Invoice date: 09/16/2025 last updated: 09/18/2025

Rocco's European Garage East Cobb ATTN: Daniel Sandler 2245 Roswell Road Marietta, GA 30062 229-306-5939	 1997 Bmw M3 WBSCD9328VEE06519
---	---

Type	Qty	Code	Description	Price
labor	7.000		Remove And Replace Lower Oil Pan Gasket: Remove And Replace Lower Oil Pan Gasket	\$1,471.54
Part	1.000	PART	Remove And Replace Lower Oil Pan Gasket: Oil Pan Gasket -	\$49.15
Part	21.000	PART	Remove And Replace Lower Oil Pan Gasket: Engine Oil Pan Bolt -	\$37.17
labor	1.000		Alignment : Perform 4-wheel Vehicle Alignment	\$150.00
labor	5.000		Remove And Replace Front Shocks : Remove And Replace Front Shocks	\$1,051.10
Part	1.000	PART	Remove And Replace Front Shocks : Strut -	\$523.66
Part	2.000	PART	Remove And Replace Front Shocks : Coil Spring Shim -	\$92.86
Part	2.000	PART	Remove And Replace Front Shocks : Protection Boot For Strut/shock Absorber -	\$17.44
Part	2.000	PART	Remove And Replace Front Shocks : Foam Bump Stop For Strut/shock -	\$85.36
Part	2.000	PART	Remove And Replace Front Shocks : Spring Pad -	\$42.68
Part	2.000	PART	Remove And Replace Front Shocks : Spring Seat -	\$202.04
Part	2.000	PART	Remove And Replace Front Shocks : Strut Mount Washer -	\$24.78
Part	1.000	PART	Remove And Replace Front Shocks : Strut Mount -	\$381.18
Part	2.000	PART	Remove And Replace Front Shocks : Reinforcement Plate - Strut Mount -	\$57.90
Part	2.000	PART	Remove And Replace Front Shocks : Strut Mount Gasket -	\$7.74
labor	1.000		Low Coolant Warning. Perform Cooling System Pressure Test.: Perform Initial Visual Inspection For Coolant Leak, Fill Coolant System With Coolant And Perform Cooling System Pressure Check To Identify Coolant Leak Source.	\$175.60
labor	0.000		Remove And Replace Front Sway Bar Links (Labor Free If Done With Shocks): Remove And Replace Front Sway Bar Links	\$0.00
Part	2.000	PART	Remove And Replace Front Sway Bar Links (Labor Free If Done With Shocks): Sway Bar End Link -	\$148.56
labor	3.000		Remove And Replace Rear Shock Absorbers (optional): Remove And Replace Rear Shock Absorbers	\$630.66
Part	2.000	PART	Remove And Replace Rear Shock Absorbers (optional): Shock Absorber -	\$538.70

Type	Qty	Code	Description	Total
Part	2.000	PART	Remove And Replace Rear Shock Absorbers (optional): Protection Boot For Shock Absorber -	\$28.98
Part	2.000	PART	Remove And Replace Rear Shock Absorbers (optional): Foam Bump Stop - Shocks -	\$60.20
Part	2.000	PART	Remove And Replace Rear Shock Absorbers (optional): Washer/shim For Shock Mount -	\$7.70
Part	2.000	PART	Remove And Replace Rear Shock Absorbers (optional): Spacer Plate For Shock Mount -	\$12.76
Part	2.000	PART	Remove And Replace Rear Shock Absorbers (optional): Shock Mount -	\$143.92
Part	2.000	PART	Remove And Replace Rear Shock Absorbers (optional): Shock Mount Gasket - Shock Mount To Body -	\$23.14
labor	0.500		Full Synthetic European Engine Oil & Filter Service: Drain Oil From Engine And Replace Oil Drain Plug And/or Oil Drain Plug Seal, Replace Engine Oil Filter, Fill Engine With New Synthetic Oil And Moa Oil Treatment, Reset Service Reminder, Perform Comprehensive Vehicle Inspection And Test Drive.	\$75.17
Part	1.000	PART	Full Synthetic European Engine Oil & Filter Service: 44k Fuel System Cleaner -	\$37.00
Part	1.000	PART	Full Synthetic European Engine Oil & Filter Service: Moa Oil Fortifier -	\$24.86
Part	6.900	PART	Full Synthetic European Engine Oil & Filter Service: Synthetic 5w-40 Leichtlauf -	\$82.80
Part	1.000	PART	Full Synthetic European Engine Oil & Filter Service: Oil Filter Kit -	\$42.94
labor	1.000		Remove And Replace Engine And Transmission Mounts (regular Cost 2201.50): Remove And Replace Engine And Transmission Mounts	\$210.22
Part	2.000	PART	Remove And Replace Engine And Transmission Mounts (regular Cost 2201.50): Engine Mount -	\$420.52
Part	2.000	PART	Remove And Replace Engine And Transmission Mounts (regular Cost 2201.50): Transmission Mount - Manual Transmission -	\$69.80
Part	1.000	PART	Remove And Replace Engine And Transmission Mounts (regular Cost 2201.50): Intake Boot - Air Flow Meter To Throttle Body -	\$61.56
labor	1.000		Bg Brake System Service: Removes Old & Contaminated Brake Fluid From Master Cylinder, Brake Lines, Abs Module & Calipers. The Service Effectively Extracts And Replaces Brake Fluid From The Vehicle, Replacing The Old Fluid With Bg Premium Brake Fluid. Service Is Performed According To Oem Procedures. Upon Completion, The System Is Inspected For Leaks, And Test Driven.	\$150.34
Part	1.000	PART	Bg Brake System Service: Dot 5.1 Brake Fluid -	\$29.50
labor	2.000		Drain And Fill Transmission Fluid: Drain And Fill Transmission Fluid	\$300.68
Part	7.000	PART	Drain And Fill Transmission Fluid: Auto Trans Fluid, Toptec 120011, Full Synthetic -	\$163.80
Part	1.000	PART	Drain And Fill Transmission Fluid: O-ring - Engine Oil Dipstick Tube To Oil Pan (19.5 X 3 Mm) -	\$5.91
fee	1.000		Drain And Fill Transmission Fluid: Shop Supplies	\$85.00
fee	1.000		Drain And Fill Transmission Fluid: Hazmat	\$2.00
discount	1.000		Drain And Fill Transmission Fluid: Customer Satisfaction	\$-850.00
Subtotal				\$7,726.92
Discount				\$-850.00
Total				\$6,876.92

Notes		Points	
Data match record	Points Redeemed		0
	Points Rewarded		6,792
	Promotions Redeemed		
	Bonuses Redeemed		