


31324

Org. Est. # 049783

Reg# 7087710

INVOICE

Date: 06/03/2021

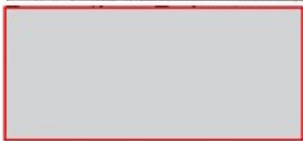

1978 Mercury - Cougar XR7 - 5.8L, V8 (351CI) VIN(H)

Lic #:

Odometer In : 66190

VIN #: 8H93H667794

Part Description / Number	Qty	Sale	Ext	Labor Description	Hours	Ext
Ford transmission fluid	6.00	15.00	90.00	Diagnose slipping transmission. Found fluid low. Found bad vacuum modulator sucking in transmission fluid & burning	2.40	300.00
-				Labor replace vacuum modulator, replace filter & gasket, fill transmission fluid & road test.		
Brake fluid	2.00	15.00	30.00			
-						
Rear brake hose	1.00	39.28	39.28	Labor replace idler arm, sway bar links, power steering pump & pressure hose & check suspension.	1.20	150.00
ADV						
Transmission filter kit	1.00	22.85	22.85	Labor remove engine in order to replace rear main seal.	26.44	3,300.00
ADV						
Vacuum modulator	1.00	44.89	44.89	Remove & install engine. Remove & install oil pan gasket & rear main seal. Labor replace valve cover gaskets. Labor install tune-up parts, set engine to proper specs, fill all fluids & road test.		
BRI						
Idler arm	1.00	81.20	81.20	Wheel Alignment		149.95
-						
PS Fluid	1.00	15.00	15.00	Labor check driver window for hard to open & close.	1.20	150.00
-						
Oxygen & actylene use	1.00	15.00	15.00	Remove door panel to check window regulator for binding. Lube all points on window regulator & install door panel		
-						
10W-30 Valvoline High Zinc Oil	5.00	14.00	70.00	Cut front rotors	0.24	30.00
-						
Oil Filter	1.00	12.95	12.95	Labor replace all brake hoses, master cylinder, front pads, replace & pack front wheel bearings, adjust rear brakes & power flush brake system	6.01	750.00
-						
Rear main seal kit	1.00	18.28	18.28	Tire Rotation & balance NO CHARGE		nc
-						
Valve cover gasket set	1.00	51.20	51.20	Labor evacuate, vacuum & recharge AC & convert system	1.80	225.00
ADV						
Oil Pan Gasket	1.00	54.49	54.49	Labor remove POA Valve, clean & lubricate & reinstall	1.20	150.00
BRI						
Distributor cap	1.00	19.08	19.08	Hazmat Fee		2.47
-						
Spark plugs	8.00	5.20	41.60			
ADV						
Ignition rotor	1.00	13.12	13.12			
-						
Motorcraft Ignition Wires	1.00	64.55	64.55			
WP						
Ford engine paint	1.00	14.37	14.37			
-						
Fuel filter	1.00	4.21	4.21			
-						
Air filter	1.00	8.96	8.96			
-						
Power steering pressure hose	1.00	44.58	44.58			
-						

FSGTF Inc- Auto Center

480 Bedford Rd
 Chappaqua, NY. 10514
 Phone: 914-244-5136 Fax: 914-471-4570
 WWW.AUTOCENTERCC.COM


INVOICE

31324

Org. Est. # 049783
 Reg# 7087710

INVOICE

Date: 06/03/2021

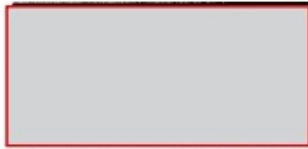

1978 Mercury - Cougar XR7 - 5.8L, V8 (351CI) VIN(H)

Lic # :

Odometer In : 66190

VIN # : 8H93H667794

Part Description / Number	Qty	Sale	Ext	Labor Description	Hours	Ext
Rebuilt power steering pump assembly ADV	1.00	97.26	97.26			
Green coolant -	2.50	21.00	52.50			
Sway bar links ADV	2.00	9.88	19.76			
Oil filler cap kit -	1.00	42.55	42.55			
New Master Cylinder ADV	1.00	54.29	54.29			
Outer wheel bearings -	2.00	19.46	38.92			
Inner wheel bearings -	1.00	19.92	19.92			
Front grease seals -	2.00	8.68	17.36			
PCV Valve -	1.00	7.39	7.39			
Shop supplies (cleaners, sand blast, hardware, etc) -	1.00	65.00	65.00			
Used battery holddown & j hooks -	1.00	10.00	10.00			
134A Freon -	4.00	38.00	152.00			
AC Oil & Dye -	1.00	19.95	19.95			
R12-134A Conversion Kit -	1.00	25.00	25.00			

FSGTF Inc- Auto Center
 480 Bedford Rd
 Chappaqua, NY. 10514
 Phone: 914-244-5136 Fax: 914-471-4570
 WWW.AUTOCENTERCC.COM


INVOICE

31324

Org. Est. # 049783
 Reg# 7087710

INVOICE

Date: 06/03/2021

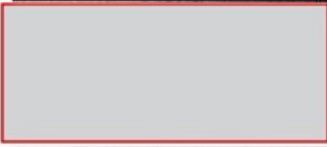

1978 Mercury - Cougar XR7 - 5.8L, V8 (351CI) VIN(H)
 Lic # : Odometer In : 66190

VIN # : 8H93H667794

Part Description / Number	Qty	Sale	Ext	Labor Description	Hours	Ext
---------------------------	-----	------	-----	-------------------	-------	-----

Org. Estimate 7,136.21 Revisions 0.00 Current Estimate 7,136.21

Labor:	5,055.00
Parts:	1,377.51
Sublet:	149.95
HazMat:	2.47
SubTotal:	6,584.93
Tax:	551.28
Total:	7,136.21
Bal Due:	\$7,136.21

[Payments -]

Serving the public for over 30 years

Vehicle Received: 6/3/2021

Customer Number : 3950

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. There may be an Additional \$10.00 Charge for Idenafix or Mitchell on Demand online Diagnostic Service to Diagnose vehicle repairs. There may be a 1/2 hr diagnostic fee.

Signature _____ Date _____

Visit us on the web: www.autocentercc.com

Email Address: Autocentercc@gmail.com