

INVOICE

SONNEN PORSCHE

900 REDWOOD HIGHWAY • MILL VALLEY, CA 94941
415-380-8000

BAR # AA 219898
EPA # CAL 000234633

CUSTOMER NO. 87065007	ADVISOR NICK RAMPONI	1039	TAG NO. 689	INVOICE DATE 08/16/05	INVOICE NO. POCP154991
X	LABOR RATE	LICENSE NO. 4XLM524	MILEAGE 41,393	COLOR BLACK/	STOCK NO.
	YEAR / MAKE / MODEL 99/PORSCHE/911/2 DOOR CABRIOLET			DELIVERY DATE	DELIVERY MILES 25
	VEHICLE I.D. NO. WP0CA2998XS651687			SELLING DEALER NO. 532	PRODUCTION DATE 08/04/98
	F. T. E. NO.		P. O. NO.		R. O. DATE 08/08/05
COMMENTS					MO: 41393

JOB# 1 CHARGES-----

LABOR-----
J# 1 61POZ CONVERTIBLE/HARD TOP TECH(S):484 WARRANTY
CUSTOMER STATES THE CAB TOP PLASTIC WINDOW IS LOOSE AT RIGHT LOWER CORNER AND LEFT UPPER CORNER. PLEASE CHECK AND ADVISE REAR WINDOW IS DEFECTIVE AND REQUIRES REPLACEMENT. REPLACED REAR WINDOW. PARTS WARRANTY ISSUE.

PARTS-----	QTY----	FP-NUMBER-----	DESCRIPTION-----	UNIT PRICE-----	
	1	996-561-111-00	REAR WINDOW .33		WARRANTY
				TOTAL - PARTS	0.00

JOB# 1 TOTALS-----
JOB# 1 JOURNAL PREFIX POCP JOB# 1 TOTAL 0.00

JOB# 2 CHARGES-----

LABOR-----
J# 2 02POZ DETAIL TECH(S):484 INTERNAL
CUSTOMER STATES THERE IS A FILM ON THE PLASTIC WINDOW, PLEASE CHECK AND ADVISE REAR WINDOW WAS REPLACED.

JOB# 2 TOTALS-----
JOB# 2 JOURNAL PREFIX POCP JOB# 2 TOTAL 0.00

JOB# 3 CHARGES-----

LABOR-----
J# 3 61POZZ CONVERTIBLE TOP TECH(S):484 INTERNAL
CUSTOMER STATES THE RIGHT SIDE ROOF SEAL IS COMING OUT, PLEASE CHECK AND ADVISE SECURED SEAL.

JOB# 3 TOTALS-----
JOB# 3 JOURNAL PREFIX POCP JOB# 3 TOTAL 0.00

ESTIMATE-----
CUSTOMER HEREBY ACKNOWLEDGES RECEIVING ORIGINAL ESTIMATE OF \$0.00 (+TAX)

Copyright © 1999 The Reynolds and Reynolds Company EPRINT S114E GM-246590 (10/02)

INVOICE

Sonnen Porsche
 EDWOOD HIGHWAY • MILL VALLEY, CA 94941
 415-380-8000

BAR # AA 219898
 EPA # CAL 000234633

CUSTOMER NO. 87065007	ADVISOR NICK RAMPONI	1039 TAG NO. 686	INVOICE DATE 12/01/04	INVOICE # POCP137487
X	LABOR RATE	LICENSE NO. 4XLM524	MILEAGE 39,433	COLOR BLACK/
	YEAR / MAKE / MODEL	99/PORSCHE/911/2 DOOR CABRIOLET		DELIVERY DATE 11/23/98
	VEHICLE I.D. NO. WP0CA2998XS651687	SELLING DEALER NO. 532	PRODUCTION DATE 08/04/98	
	F. T. E. NO.	P. O. NO.	R. P. DATE 11/30/04	
COMMENTS				MO: 39435

JOB# 1 CHARGES

LABOR-----
J# 1 20POZZ01 CHECK ENGINE LIGHT TECH(S):215 318.00
 OWNER STATES CHECK ENGINE LIGHT CAME ON WHILE DRIVING
 OPEN CIRCUIT IN AIR MASS SENSOR
 REPLACE AIR MASS SENSOR,CLEAR FAULT CODES,ROAD TEST.

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----UNIT PRICE-
 1 996-606-123-00 AIR MASS SENSOR 442.05 442.05
 TOTAL - PARTS 442.05

JOB# 1 TOTALS-----
 LABOR 318.00
 PARTS 442.05
 JOB# 1 JOURNAL PREFIX POCP JOB# 1 TOTAL 760.05

ESTIMATE-----
 CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
 ORIGINAL ESTIMATE OF \$760.05 (+TAX)

TOTALS-----

 * TOTAL LABOR... 318.00
 * TOTAL PARTS... 442.05
 * [] CASH [] CHECK CK NO. [] * TOTAL SUBLET... 0.00
 * [] VISA [] MASTERCARD * TOTAL G.O.G.... 0.00
 * [] OTHER [] CHARGE * TOTAL MISC CHG. 0.00
 * * TOTAL MISC DISC 0.00
 * * TOTAL TAX..... 32.05

TOTAL INVOICE \$ 792.10

CUSTOMER SIGNATURE

Copyright © 1998 The Reynolds and Reynolds Company EPAINTS14E GM-246569Q (1/02)

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
 Novato, CA. 94949
 Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

5228

Org. Est. # 009088


BAR# AJ142149

EPA# CAL000047023

Customer Satisfaction A Must !

INVOICE

Print Date : 06/07/2005

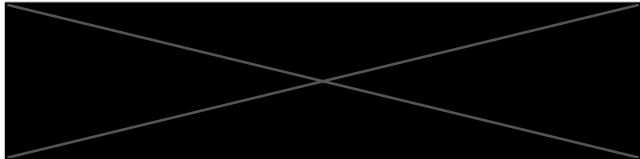

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 40427

Unit # :

Vin # : WPOCA2998XS651687

Hat # : 925

Cust ID : 1685

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Hours	Extended
BRAKE FLUID				NO BRAKES - CHECK BRAKE SYSTEM	2.50	250.00
BRAKE FLUID	3.00	7.00	21.00	TRACE PROBLEM TO BRAKE		
BRAKE MASTER CYLINDER				MASTER CYLINDER		
99635591000	1.00	430.00	430.00	REPLACE BRAKE MASTER		
				CYLINDER		
				BLEED BRAKE SYSTEM		
				TEST DRIVE		

[Technicians : SPRANG, SHEPARD]

Org. Estimate \$735.95 Revisions \$0.00 Current Estimate \$ 735.95 Additional Cost Revised Estimate

Labor:	\$250.00
Parts:	\$451.00
Sublet:	\$0.00
Sub:	\$701.00

Tax:	\$34.95
Total:	\$735.95
Bal Due:	\$735.95

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.

Warranty on parts is 12 months/12,000 miles whichever comes first.

Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

SPINELLI, PETRA

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
 Novato, CA. 94949
 Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

5310

Org. Est. # 009257

BAR# AJ142149

EPA# CAL000047023

Customer Satisfaction A Must !

INVOICE

Work Completed Date : 07/14/2005

Print Date : 07/14/2005

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 40647


Unit # :

Vin # : WPOCA2998XS651687

Hat # : 899

Cust ID : 1685

Ref # :

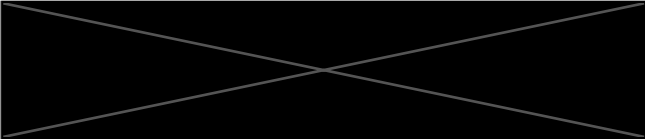

Part Description / Number	Qty	Sale	Extended	Labor Description	Hours	Extended
BRAKE FLUID				NO BRAKES	2.50	250.00
BRAKE FLUID	2.00	7.00	14.00	TRACE PROBLEM TO BRAKE FLUID		
IGNITION SWITCH				LEAKING INTO ABS CONTROL UNIT		
4A0 905 849B	1.00			FROM ABS PUMP		
ABS HYDRAULIC UNIT				REPLACE ABS HYDRAULIC UNIT &		
99635595504	1.00	1,750.00	1,750.00	BLEED BRAKES		
				CLEAR ALL CODES		
				TEST DRIVE		
				CAR WILL NOT SHUT OFF	N/A	N/C
				CAR SHUTS OFF W/IGNITION OFF		
				AND BRAKE PEDAL DEPRESSED		
				REPLACE IGNITION SWITCH (
				Common Failure on These Models)		
				CHECK SPOILER OPERATION	N/A	N/C
				BATTERY WENT DEAD/SPOILER UP		
				CHECK SPOILER OPERATION -		
				@75MPH UP -DOWN @40MPH		
				SMALL CRACK IN SPOILER		
				BELLOWS		
				CHECK FOR RATTLE	N/A	N/C
				TRACE TO LOOSE LEFT SUNVISOR		
				BOLT & BROKEN THREADS		
				REMOVE BOLT & SECURE LOOSE		
				PIECE		
				**** Recommendations ****		
				STILL ORIGINAL BATTERY IN A		
				CAR - RECOMMENDING		
				REPLACEMENT		
				SMALL CRACK IN SPOILER		
				BELLOWS		

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
Novato, CA. 94949

Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

5310

Org. Est. # 009257

BAR# AJ142149

EPA# CAL000047023

Customer Satisfaction A Must !

Work Completed Date : 07/14/2005

Print Date : 07/14/2005

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 40647

Unit # :

Vin # : WPOCA2998XS651687

Hat # : 899

Cust ID : 1685

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Hours	Extended
[Technicians : SPRANG, SHEPARD]						

Org. Estimate \$2,150.71 Revisions \$0.00 Current Estimate \$ 2,150.71 Additional Cost Revised Estimate

Labor:	\$250.00
Parts:	\$1,764.00
Sublet:	\$0.00
Sub:	\$2,014.00

Tax:	\$136.71
Total:	\$2,150.71
Bal Due:	\$0.00

[Payments - Visa - \$ 2150.71]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.

Warranty on parts is 12 months/12,000 miles whichever comes first.
Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....
SPINELLI, PETRA

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B

Novato, CA. 94949

Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

5943

Org. Est. # 010581


BAR# AJ142149

EPA# CAL000047023

Customer Satisfaction A Must !

INVOICE

Print Date : 04/07/2006

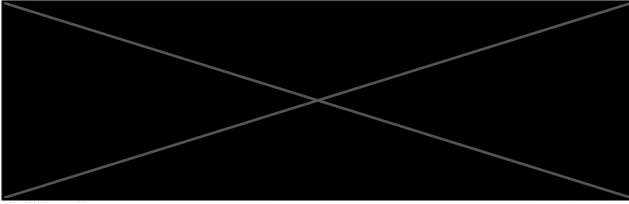

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 42568

Unit # :

Vin # : WPOCA2998XS651687

Hat # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Hours	Extended
OIL FILTER 99610722552	1.00	15.00	15.00	MINOR SERVICE	1.50	180.00
MOBIL 1 15W/50	10.00	7.00	70.00	CHANGE OIL AND FILTER, CHECK BRAKES, TIRES AND TIRE PRESSURE, CHECK FAN BELTS AND WATER HOSES, CHECK CLUTCH ADJUSTMENT, CHECK AND TOP OFF ALL FLUID LEVELS, CHECK DRIVELINE, RESET ALL COMPUTERS AND SERVICE LIGHT BOARDS, AND UPDATE SERVICE BOOK		
				Hazardous Materials		4.50
				**** Recommendations **** STILL ORIGINAL BATTERY IN A CAR - RECOMMENDING REPLACEMENT SMALL CRACK IN SPOILER BELLOWS SMALL CRACK IN WINDSHIELD CLUTCH SLIGHTLY STIFF		

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
Novato, CA. 94949

Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

5943

Org. Est. # 010581


BAR# AJ142149

EPA# CAL000047023

Customer Satisfaction A Must !

Print Date : 04/07/2006

INVOICE

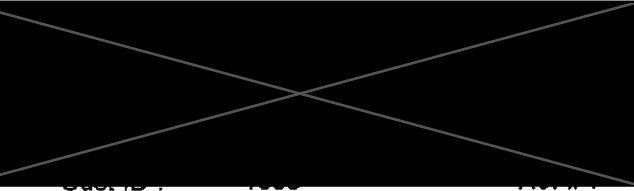

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 42568

Unit # :

Vin # : WPOCA2998XS651687

Hat # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Hours	Extended
---------------------------	-----	------	----------	-------------------	-------	----------

[Technicians : SPRANG, SHEPARD]

Org. Estimate \$276.51	Revisions \$0.00	Current Estimate \$ 276.51	Additional Cost	Revised Estimate
------------------------	------------------	----------------------------	-----------------	------------------

Labor:	\$184.50
Parts:	\$85.00
Sublet:	\$0.00
Sub:	\$269.50

Tax:	\$7.01
Total:	\$276.51
Bal Due:	\$276.51

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.

Warranty on parts is 12 months/12,000 miles whichever comes first.

Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

SPINELLI, PETRA

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
 Novato, CA. 94949
 Phone - 415-883-1684 Fax - 415-883-4663

INVOICE


7068

BAR# AJ142149
 EPA# CAL000047023

Customer Satisfaction A Must !

INVOICE

Print Date : 07/18/2007

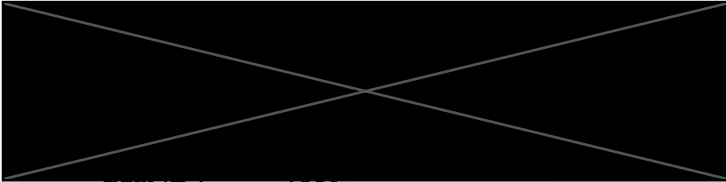

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 45264

Unit # :

Vin # : WPOCA2998XS651687

Hat # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Hours	Extended
MOBIL 1 15W/50	10.00	7.50	75.00	OIL CHANGE REPLACE ENGINE OIL & FILTER	0.75	93.75
OIL FILTER 99610722552	1.00	15.00	15.00	Hazardous Materials **** Recommendations **** STILL ORIGINAL BATTERY IN A CAR - RECOMMENDING REPLACEMENT SMALL CRACK IN SPOILER BELLOWS SMALL CRACK IN WINDSHIELD CLUTCH SLIGHTLY STIFF		4.50

[Technicians : KUEHN, MICHAEL]

Org. Estimate \$195.23 Revisions \$0.00 Current Estimate \$ 195.23 Additional Cost Revised Estimate

Labor:	\$98.25
Parts:	\$90.00
Sublet:	\$0.00
Sub:	\$188.25

Tax:	\$6.98
Total:	\$195.23
Bal Due:	\$195.23

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.
 Warranty on parts is 12 months/12,000 miles whichever comes first.
 Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....
 SPINELLI, PETRA

SONNEN PORSCHE

REDWOOD HIGHWAY • MILL VALLEY, CA 94941

415-380-8000

INVOICE

BAR # AA 219898
EPA # CAL 000234633

ADVISOR CK RAMPONI	1039	TAG NO. 9793	INVOICE DATE 12/28/07	INVOICE NO. POCP220690
LABOR RATE	LICENSE NO. 4XLM524	MILEAGE 46,863	COLOR BLACK/	STOCK NO.
YEAR / MAKE / MODEL 0/PORSCHE/911/2 DOOR CABRIOLET			DELIVERY DATE	DELIVERY MILES 25
VEHICLE I.D. NO. P O C A 2 9 9 8 X S 6 5 1 6 8 7 532			SELLING DEALER NO.	PRODUCTION DATE 08/04/98
F. T. E. NO.		P. O. NO.	R. O. DATE 12/28/07	
COMMENTS				MO: 46864

TOTALS

*
* [] CASH [] CHECK CK NO. [] *
*
* [] VISA [] MASTERCARD *
*
* [] OTHER [] CHARGE *
*

TOTAL LABOR.... 419.85
TOTAL PARTS.... 502.85
TOTAL SUBLET... 0.00
TOTAL G.O.G.... 0.00
TOTAL MISC CHG. 0.00
TOTAL MISC DISC 0.00
TOTAL TAX..... 38.97

TOTAL INVOICE \$ 961.67

CUSTOMER SIGNATURE

- SAN FRANCISCO (415) 922-2808
- MARIN TIRE (415) 456-2324
- SANTA ROSA (707) 542-3388
- CORTE MADERA (415) 924-8810
- TERRA LINDA (415) 479-3300
- VALLEJO (707) 643-8271
- IGNACIO (415) 883-8473



TIME IN:	TIME PROMISE:
----------	---------------

INVOICE DATE	CUST. NO.	ORDER NO.	PAGE	INVOICE NO.
09/04/08	1	11442	1	90661
License: 4XLM524		Mileage: 001 99 PORSC 911		

URGENTIVE
1475 CA
90666

SHIP TO

Customer to have other tire mounted Sat

OTHER PHONE	SHIP VIA
-------------	----------



ITEM NO.	DESCRIPTION	QTY ORDERED	QTY SHIPPED	UNIT	PRICE	NET EXTENSION
	*LOOSE PORSCHE TIRE					
VIB	ATD 26535ZR18 FUZION	2	2		0.00	183.50
NTPP	DECLINE TYP ROAD HAZARD PROTECTION	1	1			0.00
BALI	HI-SPEED COMPUTER BALANCE STD WHEEL	2.00	2.00			13.50
STEM	RUBBER VALVE STEMS	2	2			3.75
CAL	CAL STATE TIRE RECYCLE FEE (AB923)	2	2			1.75
EPA	ENVIRONMENTAL TIRE DISPOSAL FEE	2	2			2.15
DSC	DRIVER'S SECURITY CARD	1	1			0.00
DSCID#	ENTER DSC ID. #_B4029_	1	1			0.00
*****INCLUDED 8 FREE SERVICES*****						
*****PREFERRED CUSTOMER STATUS*****						
AND VALUABLE AUTO REPAIR DISCOUNTS						
ROTATE TIRES EVERY 8,000 MILES!						
WT	LUG NUTS TORQUED AT _____ LBS	1	1			0.00
*ENTER YOUR INITIALS ED						

We work hard to make you our customer.

We will work twice as hard to keep you as our customer.

If for any reason, you feel you need to go elsewhere, please give us a call first, at our customer satisfaction / information line (415) 455-8473

Sincerely,
Ken & Vince

ORIGINAL ESTIMATE OF REPAIRS: \$ _____ PLUS TAX
 - Includes all parts, labor, handling and diagnosis. If on closer analysis it is found that additional repairs are necessary, you will be contacted for authorization pursuant to Division 3, Chapter 20.3, article 3, Sec. 9884.9 of the California Business and Professions Code
 - All Parts are New unless specified otherwise.
 - There is no bailment created by this contract. Be sure to remove any items of value from your vehicle, before leaving it with us for service. We are not responsible for items left in and or attached to vehicle that do not pertain to the vehicle operation.
 - Old parts are discarded, if not requested prior to repairwork being performed. On some requested parts, core charges apply.
 Old Parts requested? Yes No
 - Repair invoice will include charges for Hazardous Waste Management.
 - I have read and understand the above estimate and terms, I authorize service to be performed including sublet work, road test and acknowledge receipt of this estimate.
 - I am aware that the above repairwork is covered by a warranty that is detailed on the reverse side of this invoice.

Cust. Sign _____ Date _____

Acknowledgement Of Notice And Consent

Date:	Date:
Time:	Time:
By:	By:
Phone#:	Phone#:
Reason:	Reason:
Revised Est. amount: \$	Revised Est. amount: \$

I acknowledge notice and oral approval of an increase in the original estimate price to the amount noted above.

X _____ Date _____

J PORSCHE

INVOICE

15) 380-8000

PORSCHE

415-380-8000

BAR # AA 219898

CPA # CA1006376339

ADVISOR GARY WRIGHT	TAG NO. 942 2876	INVOICE DATE 04/03/10	INVOICE NO. POCS274335
LICENSE NO. 4XLM524	MILEAGE 48,255	COLOR BLACK/	STOCK NO.
YEAR / MAKE / MODEL 99/PORSCHE/911/2 DOOR CABRIOLET		DELIVERY DATE	DELIVERY MILES 25
VEHICLE I.D. NO. W P O C A 2 9 9 8 X S 6 5 1 6 8 7		SELLING DEALER NO. 532	PRODUCTION DATE 08/04/98
F.T.E. NO.	P.O. NO.	R.O. DATE 04/03/10	
COMMENTS			MO: 48257

JOB# 1 CHARGES

LABOR
JOB# 1 03POZ003 MARCH SPECIAL TECH(S):1284 179.50

PERFORM OIL & FILTER CHANGE AS PER MARCH 2010 COUPON
CHECK AND ADJUST ALL FLUIDS AND TIRES AS NEEDED
PERFORMED OIL & FILTER SERVICE AS REQUESTED
CHECKED AND ADJUSTED ALL FLUIDS AND TIRES TO SPECIFICATION
SMALL OIL LEAK FROM BANK #2 VALVE COVER.
CUSTOMER INFORMED.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
	1	996-107-225-53	OIL-FILTER INSER	24.48	24.48
	1	900-123-106-30	ALUM SEAL RING	2.26	2.26
				TOTAL - PARTS	26.74

G.O.G. & SUPPLIES					
	7.5	SPECIAL - MOBIL 1 0W-40 @	5.000 /UNIT		37.50
				TOTAL - GOG	37.50

MISC	CODE	DESCRIPTION	CONTROL NO		
	P-WOF	PORSCHE HAZ WASTE/OIL & FILTER		4.50	
	P-MC	MARCH COUPON SPECIAL		-100.00	
				TOTAL - MISC	-95.50

JOB# 1 TOTALS

LABOR	179.50
PARTS	26.74
G.O.G.	37.50
MISC	-95.50

JOB# 2 CHARGES

JOB# 1 JOURNAL PREFIX POCS JOB# 1 TOTAL 148.24

LABOR
JOB# 2 02POZ DETAIL TECH(S):1284 0.00

DETAIL TO CLEAN CAR AND REAR PLASTIC WINDOW AS PER CUSTOMER REQUEST.
COMPLETED AS PER CUSTOMER REQUEST.

JOB# 2 TOTALS

JOB# 2 JOURNAL PREFIX POCS JOB# 2 TOTAL 0.00

ESTIMATE
CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
ORIGINAL ESTIMATE OF \$149.00 (+TAX)

THANK YOU

JOHN PORSCHE

HIGHWAY • MILL VALLEY, CA 94941

Ph: (415) 380-8000

415-380-8000

PORSCHE

INVOICE

BAR # AA 219898

CPA # CAL 0007876339

ADVISOR GARY WRIGHT		TAG NO. 2876	INVOICE DATE 04/03/10	INVOICE NO. POCS274335
LICENSE NO. 4XLM524	MILEAGE 48,255	COLOR BLACK/	STOCK NO.	
YEAR / MAKE / MODEL 09/PORSCHE/911/2 DOOR CABRIOLET		DELIVERY DATE	DELIVERY MILES 25	
VEHICLE I.D. NO. WP0CA2998XS651687		SELLING DEALER NO. 532	PRODUCTION DATE 08/04/98	
P.L.E. NO.		P.O. NO.	R.O. DATE 04/03/10	
COMMENTS				

MO: 48257

TOTALS

 * *
 * [] CASH [] CHECK CK NO. [] *
 * *
 * [] VISA [] MASTERCARD *
 * *
 * [] OTHER [] CHARGE *
 * *

TOTAL LABOR....	179.50
TOTAL PARTS....	26.74
TOTAL SUBLET...	0.00
TOTAL G.O.G....	37.50
TOTAL MISC CHG.	4.50
TOTAL MISC DISC	-100.00
TOTAL TAX.....	5.78
TOTAL INVOICE \$	154.02

CUSTOMER SIGNATURE

THANK YOU

The Porsche Multi-Point Inspection Report

The Porsche Multi-Point Inspection Report is a series of thorough vehicle "health checks" performed by factory-trained Porsche technicians. It is designed to keep your Porsche operating in top condition and to minimize your chances of being inconvenienced on the road. If additional service is recommended on any listed item, your Porsche Service Advisor will be happy to speak with you about your options.



Name: _____
 Tag: 274335 Mileage: 43,225

Year/Model: 1999 C2 Cab Engine Size: 3.4L
 VIN: WP0CA2998XS651687 Date: 1/3/10

Checked and Okay at this Time

May Require Future Attention

Requires Immediate Attention

Check Fluid Levels and Fill


OK	FILL	OK	FILL
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Engine Oil		Brake Reservoir	
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Windshield Washer		Headlamp Washer	
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Power Steering		Coolant Recovery Reservoir	
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Transmission (if equipped w/ dipstick)			

Check Battery Condition

● Good Recharge ● Bad
 Comments: _____

Check Brakes

Measure Front / Rear Brake Linings

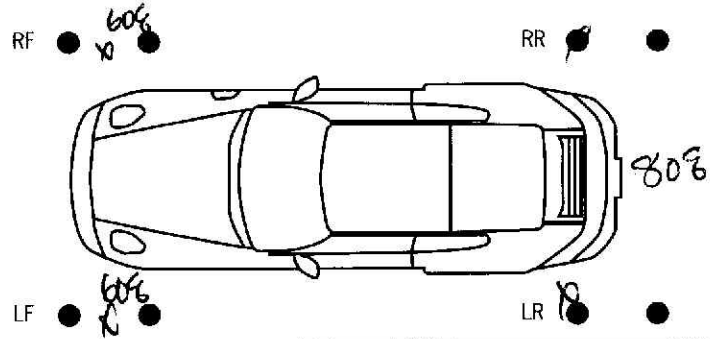

Over 5mm or 7/32"

3 to 5mm or 4/32" to 7/32"

Brake Measurements Not Taken This Service Visit

Comments: _____

Check Following Systems / Components

- Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps
- Visually inspect headlamp alignment
- Windshield washer spray, wiper operation and wiper blades
- Windshield cracks and/or chips
- Heating, ventilation and air conditioning check
- Engine air cleaner filter
- Oil and/or fluid leaks
- Constant velocity (CV) drive axle boots (if equipped)
- Exhaust system (leaks, damage, loose parts)
- Steering and steering linkages
- Shocks/struts, air suspension and other suspension components for leaks and/or damage
- Brake system (including lines, hoses and parking brake)
- Engine cooling system, hoses and clamps
- Radiator, heater and air conditioning hoses for leaks / damage
- Accessory drive belt(s)
- Clutch operation (if equipped)
- State inspection due (if applicable) _____ / _____ / _____
Month Day Year
- Your last completed maintenance _____ Mileage _____ ; _____ / _____
Mileage Month Year
- Your next factory scheduled maintenance is due at _____ Mileage _____ ; _____ / _____
Mileage Month Year

Comments:

Bank 2 camshaft cover leaking oil.

Check Tires

TREAD DEPTH

LF	TREAD DEPTH	RF
<input checked="" type="checkbox"/> ● 7/32" or Greater		<input checked="" type="checkbox"/> ● 7/32" or Greater
<input checked="" type="checkbox"/> ● 4/32" to 6/32" <u>4mm</u>		<input checked="" type="checkbox"/> ● 4/32" to 6/32" <u>4mm</u>
<input checked="" type="checkbox"/> ● 3/32" or Less		<input checked="" type="checkbox"/> ● 3/32" or Less
<input checked="" type="checkbox"/> ● 7/32" or Greater <u>7mm</u>		<input checked="" type="checkbox"/> ● 7/32" or Greater <u>7mm</u>
<input checked="" type="checkbox"/> ● 4/32" to 6/32"		<input checked="" type="checkbox"/> ● 4/32" to 6/32"
<input checked="" type="checkbox"/> ● 3/32" or Less		<input checked="" type="checkbox"/> ● 3/32" or Less
LR		RR

Wear Pattern / Damage RF ● ●
 Tire Wear Indicators RR ● ●

Alignment Check Recommended Wheel Balance Recommended

Comments: _____

This Courtesy Inspection Completed By Your Porsche Service Team

Service Advisor: Gary W.

Technician: AH

Customer Signature: _____

Tire Pressure Set to _____
 Factory Recommendations PSI 36 Front 44 Rear

MERCHAN

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
Novato, CA. 94949

Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

10272

BAR# AJ142149
EPA# CAL000047023

BALDWIN'S GERMA
101

Customer Satisfaction A Must !

Work Completed Date : 06/03/2011

Print Date : 06/03/2011

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524


Odometer In : 49211

Unit # :

Vin # : WP0CA2998XS651687

Hat # : 609

Ref # :



Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
CRCO5088				FRONT BRAKES @ SENSOR	290.00
PARTS KLEEN	1.00	4.98	4.98	REPLACE FRONT BRAKE ROTORS, PADS,	
BRAKE CLEAN				SENSORS & SHIMS	
BRAKE CLEAN	1.00	8.00	8.00		
GEAR OIL				OIL LEAK	362.50
201	3.00	11.00	33.00	REPLACE SPARK PLUG TUBES	
WINDOW REGULATOR - Right Front				REPLACE RIGHT CAMSHAFT SOLENOID	
996 542 076 04	1.00	290.00	290.00	SEAL	
BRAKE PAD SET				REPLACE PCV VALVE	
996 352 949 03	1.00	191.00	191.00	CLEAN UP AREA	
BRAKE PAD SHIM					
996 351 088 02	4.00	31.15	124.60	CHECK ENGINE LIGHT ON	N/C
OIL FILTER KIT				PULL & READ CODES	
996 107 225 53	1.00	15.00	15.00	P0305 - MISFIRE CYL. #5 STORED	
FUEL FILTER				SWAP COIL PACKS BETWEEN CYL. #5 AND 4	
996 110 253 01	1.00	55.00	55.00	CLEAR CODE & RESET CHECK ENGINE	
AIR FILTER				LIGHT	
996 110 131 52	1.00	42.00	42.00		
SPARK PLUG				REPAIR RIGHT WINDOW	435.00
999 170 207 91	6.00	13.00	78.00	REMOVE RIGHT FRONT DOOR PANEL	
DRIVE BELT				REMOVE & REPLACE POWER WINDOW	
996 102 151 66	1.00	60.00	60.00	REGULATOR	
O-RING				TRANSFER POWER WINDOW MOTOR	
999 707 215 40	6.00	4.00	24.00	LUBE ALL MOVING PARTS	
O-RING				REINSTALL IN REVERSE ORDER	
999 707 343 41	6.00	1.50	9.00	ADJUST WINDOW HEIGHT & NORMILIZE	
BRAKE PAD SENSOR					
996 612 365 00	2.00	18.00	36.00	MAJOR SERVICE + LUBE + REPLACE POWER	942.50
SPARK PLUG TUBE				STEERING AND TRANSMISSION FLUID	
996 105 325 52	6.00	9.00	54.00	CHANGE OIL, AIR, ACC CABIN, FUEL	
BRAKE DISC - Front				FILTER, SPARK PLUGS, POWER STEERING	
996 351 406 02	1.00	192.00	192.00	FILTER, V/C GASKET IF APPLICABLE,	
BRAKE DISC - Front				INSPECT AND ADJUST ALL FLUID LEVELS,	
996 351 405 02	1.00	192.00	192.00	BELTS, HOSES, TIRES, BRAKES, EXTERIOR	
BREATHER O-RING				AND INTERIOR LIGHTS	
999 707 154 40	1.00	4.20	4.20	ADJUST VALVES IF APPLICABLE	
WIPER BLADE SET				INSPECT FUEL SYSTEM, COOLING SYSTEM,	

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B

Novato, CA. 94949

Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

10272

BAR# AJ142149

EPA# CAL000047023

Customer Satisfaction A Must!

Work Completed Date : 06/03/2011

Print Date : 06/03/2011

INVOICE

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 49211

Unit # :

Vin # : WP0CA2998XS651687

Hat # : 609

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
996 628 901 99 ACC CABIN FILTER	1.00	68.00	68.00	IGNITION SYSTEM, CHECK OPERATION OF ALL WINDOWS, LOCKS, RADIO, HEATING AND AIR CONDITIONING SYSTEM, CHECK BATTERY, INSPECT MOTOR AND TRANSMISSION OPERATION RESET SERVICE LIGHTS CHECK HC & CO	
997 571 219 01 CRANKCASE VENT VALVE	1.00	55.00	55.00		
996 107 047 51 COVER PLATE	1.00	19.74	19.74		
996 105 223 52 SWEPCO PWR/STR - HYD OIL	1.00	19.00	19.00		
715	1.00	11.89	11.89		
				Hazardous Materials	4.50
				**** Recommendations **** STILL ORIGINAL BATTERY IN A CAR - RECOMMENDING REPLACEMENT SMALL CRACK IN SPOILER BELLOWS SMALL CRACK IN WINDSHIELD CLUTCH SLIGHTLY STIFF KEY REMOTE PORTION \$ 183.56 + CODING \$25.00 BARE KEY \$ 147.12 COOLANT LOW COOLING HOSES/WATER PUMP/RADIATOR LOOK ORIGINAL CLUTCH PEDAL SLIGHTLY FIRM WATER PUMP HOSE SCRAPED ENGINE OIL LEAK - RIGHT & LEFT REAR - RECHECK NEXT VISIT	

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
Novato, CA. 94949
Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

10272


BAR# AJ142149
EPA# CAL000047023

Customer Satisfaction A Must !

NVOICE

Work Completed Date : 06/03/2011

Print Date : 06/03/2011

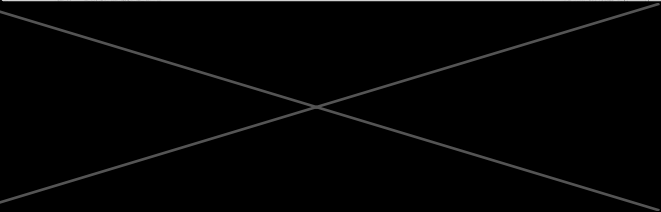

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 49211

Unit # :

Vin # : WP0CA2998XS651687

Hat # : 609

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
---------------------------	-----	------	----------	-------------------	----------

[Technicians : SPRANG, SHEPARD]

Org. Estimate	\$3,771.62	Revisions	\$0.00	Current Estimate	\$ 3,771.62	Additional Cost	Revised Estimate
---------------	------------	-----------	--------	------------------	-------------	-----------------	------------------

Labor:	\$2,034.50
Parts:	\$1,586.41
Sublet:	\$0.00
Sub:	\$3,620.91

Tax:	\$150.71
Total:	\$3,771.62
Bal Due:	\$3,771.62

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.

Warranty : parts 12months - 12,000 miles whichever comes first.

Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....
SPINELLI, PETRA

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
 Novato, CA. 94949
 Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

11176

BAR# AJ142149
 EPA# CAL000047023

Customer Satisfaction A Must !

Work Completed Date : 05/04/2012

Print Date : 05/04/2012

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 49839

Unit # :

Vin # : WP0CA2998XS651687

Hat # : 629

Ref # :



Part Description	Qty	Sale	Extended	Labor Description	Extended
BATTERY MAINTAINER	1.00	97.00	97.00	LEFT FRONT SEAT NOT WORKING	125.00
BATTERY	1.00	157.00	157.00	RAN DIAGNOSTIC SCAN - No Relevant Codes Stored	
BATTERY PROTECTOR	2.00	1.75	3.50	BATTERY DEAD OVER NIGHT RECHARGE & LOAD TEST BATTERY - Ok CHECK FOR DRAW - Ok RECODE POWER SEAT MODULE - POWER SEAT WORKING NOW	
				BATTERY KEEPS GOING DEAD REPLACE BATTERY INSTALL BATTERY CHARGER	145.00
				**** Recommendations **** SMALL CRACK IN SPOILER BELLOWS SMALL CRACK IN WINDSHIELD CLUTCH SLIGHTLY STIFF KEY REMOTE PORTION \$ 183.56 + CODING \$25.00 BARE KEY \$ 147.12 INSIDE FRONT TIRE WEAR FRONT HOOD STAYS WEAK	

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
Novato, CA. 94949

Phone - 415-883-1684 Fax - 415-883-4663

Customer Satisfaction A Must !


INVOICE

11176

BAR# AJ142149
EPA# CAL000047023

Print Date : 05/04/2012

DICE

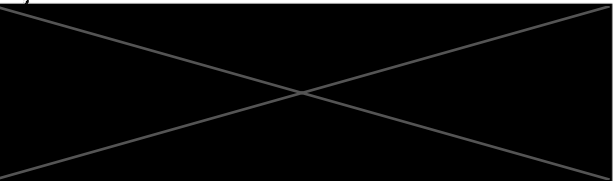

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A)

Lic # : 4XLM524

Odometer In : 49839

Unit # :

Vin # : WPOCA2998XS651687

Hat # : 629

Ref # :

Cust ID : 1000

Part Description	Qty	Sale	Extended	Labor Description	Extended
------------------	-----	------	----------	-------------------	----------

[Technicians : SPRANG, SHEPARD]

Org. Estimate \$549.39	Revisions \$0.00	Current Estimate \$ 549.39	Additional Cost	Revised Estimate
------------------------	------------------	----------------------------	-----------------	------------------

Labor:	\$270.00
Parts:	\$257.50
Sublet:	\$0.00
Sub:	\$527.50

Tax:	\$21.89
Total:	\$549.39
Bal Due:	\$549.39

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.
Warranty : 36 months or 36,000 miles parts and labor whichever comes first.
Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

SPINELLI, PETRA

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B
Novato, CA. 94949

Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

12035

BAR# AJ142149
EPA# CAL000047023

Customer Satisfaction A Must !

Print Date : 04/17/2013

1999 Porsche - 911 Carrera
3.4L, H6, VIN (A), TP 36/44

Lic # : 4XLM524

Odometer In : 50650

Unit # :

Vin # : WP0CA2998XS651687

Hat # : 737

Ref # :

Cust ID : 1000

Part Description	Qty	Sale	Extended	Labor Description	Extended
SYNTH. ENGINE OIL	10.00	8.25	82.50	OIL SERVICE	108.75
OIL FILTER	1.00	18.00	18.00	REPLACE ENGINE OIL & FILTER	
MAGNETIC OIL DRAIN PLUG	1.00	38.00	38.00	SAFETY & PREVENTIVE MAINTENANCE	
SWEPKO PWR/STR - HYD OIL	1.00	18.00	18.00	INSPECTION	
DYE	1.00	10.00	10.00	INSTALL MAGNETIC DRAIN PLUG	
ROOR CATCH CAP	1.00	21.00	21.00	CONVERTIBLE TOP NOT WORKING	580.00
				PROPERLY	
				REMOVE COVER	
				CHECK CONVERTIBLE PUMP FLUID LEVEL -	
				Low	
				TOP UP FLUID AND ADD DYE TO SYSTEM	
				BLEED SYSTEM	
				CHECK FOR LEAKS - NO MAJOR LEAK	
				FOUND	
				*SLIGHT SEEPAGE ON RIGHT HYDRAULIC	
				SHOCK*	
				FOUND "C" HINGE PIVOT PINS AND	
				HYDRAULIC SHOCKS MOUNTS LOOSE	
				SECURE & TIGHTEN	
				REAR LEFT TENSION CABLE BALL FELL OFF	
				PARTIALLY REMOVE REAR BOW TRIM &	
				REINSTALL	
				TEST CABRIO OPERATION	
				Hazardous Materials	4.50
				**** Recommendations ****	
				SMALL CRACK IN SPOILER BELLOWS	
				SMALL CRACK IN WINDSHIELD	
				CLUTCH SLIGHTLY STIFF	
				KEY REMOTE PORTION \$ 183.56 + CODING	
				\$25.00	
				BARE KEY \$ 147.12	
				INSIDE FRONT TIRE WEAR	
				CABRIO TOP PUMP NOISY @ TIMES	

Baldwin's German Autowerks, LLC

101 Roblar Dr. Suite B

Novato, CA. 94949

Phone - 415-883-1684 Fax - 415-883-4663

INVOICE

12035


BAR# AJ142149

EPA# CAL000047023

Customer Satisfaction A Must!

INVOICE

Print Date : 04/17/2013

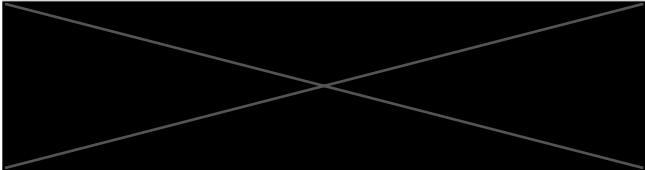

1999 Porsche - 911 Carrera

3.4L, H6, VIN (A), TP 36/44

Lic # : 4XLM524

Odometer In : 50650

Unit # :

Vin # : WP0CA2998XS651687

Hat # : 737

Ref # :

Cust ID : 1685

Part Description	Qty	Sale	Extended	Labor Description	Extended
------------------	-----	------	----------	-------------------	----------

[Technicians : SPRANG, SHEPARD]

Org. Estimate \$897.63 Revisions \$0.00 Current Estimate \$ 897.63 Additional Cost Revised Estimate

Labor:	\$693.25
Parts:	\$187.50
Sublet:	\$0.00
Sub:	\$880.75

Tax:	\$16.88
Total:	\$897.63
Bal Due:	\$897.63

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.

Warranty : 36 months or 36,000 miles parts and labor whichever comes first.

Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....
 SPINELLI, PETRA

BALDWIN'S GERMAN AUTO
400 ENFRENTA RD
NOVATO, CA 94949
415-883-1684

Baldwin's German Autowerks, LLC

400 Enfrente Rd.
Novato, CA. 94949
415-883-1684 Fax - 415-883-4663

INVOICE

13281

BAR# AJ142149
EPA# CAL000047023

Customer Satisfaction A Must!

Print Date : 08/25/2014

1999 Porsche - 911 Carrera
3.4L, H6, VIN (A), TP 36/44
Lic # : 4XLM524 Odometer In : 52505
Unit # :
Vin # : WP0CA2998XS651687
Hat # : 350 Ref # :

CARDMEMBER ACKNOWLEDGES RECEIPT OF
AND/OR SERVICES IN THE AMOUNT OF
TOTAL SHOWN HEREON AND AGREES TO
THE OBLIGATIONS SET FORTH IN
CARDMEMBER'S AGREEMENT WITH T

THANKS FOR USING !

CUSTOMER OF

Qty	Sale	Extended	Labor Description	Extended
-----	------	----------	-------------------	----------

			ALIGNMENT	175.00
--	--	--	-----------	--------

**** Recommendations ****


SMALL CRACK IN SPOILER BELLOWS
CABRIO TOP PUMP NOISY @ TIMES
SMALL CRACK IN WINDSHIELD
CLUTCH SLIGHTLY STIFF
KEY REMOTE PORTION \$ 183.56 + CODING
\$25.00
BARE KEY \$ 147.12
INSIDE FRONT TIRE WEAR - CAR ALIGNED
08/25/14
ORIGINAL WATER PUMP - Replacement
Recommended Every 3 Years
RECOMMEND POWER STEERING FLUSH
RECOMMEND BRAKE FLUID FLUSH
CLUTCH SLIGHTLY STIFF
RECOMMEND OIL FILTER UPGRADE
RECOMMEND IMS BEARING UPGRADE
IGNITION LOCK ASSEMBLY GETTING
STIFF

BALDWIN'S GERMAN AUTOWERKS

400 ENFRENTA RD.
NOVATO, CA 94949

Phone Number: 415-883-1684


Fax Number:

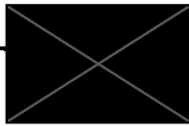

Customer:		Date:	8/25/2014 12:58:00 PM
Company:		VIN	WP0CA2998XS651687
License No:	4XLM524	Technician:	BB
Odometer:	52502	Order No.:	013281

Graphic Alignment Report

PORSCHE, 1999, 911 [996] Standard Suspension and Sport

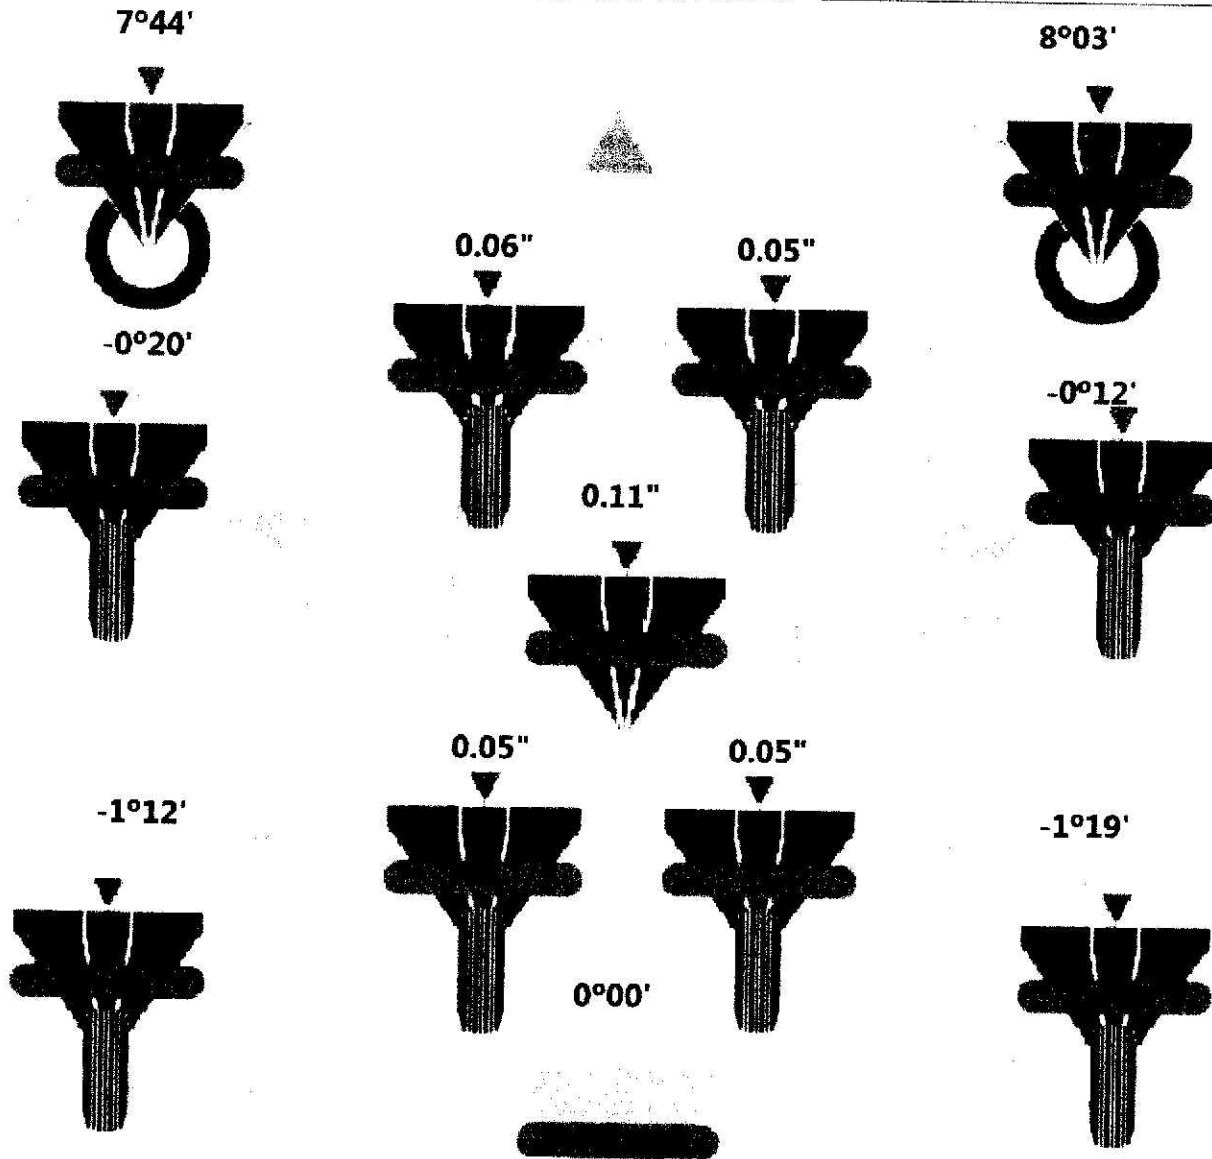

ierman Autowerks, LLC

00 Enfrente Rd.
 vato, CA. 94949
 i3-1684 Fax - 415-883-4663

INVOICE


13247

BAR# AJ142149
 EPA# CAL000047023

er Satisfaction A Must !

Print Date : 08/14/2014

INVOICE

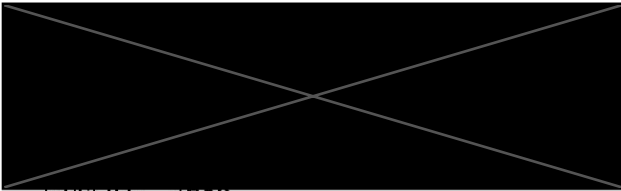

1999 Porsche - 911 Carrera
 3.4L, H6, VIN (A), TP 36/44
 Lic # : 4XLM524 Odometer In : 52488
 Unit # :
 Vin # : WP0CA2998XS651687
 Hat # : 327 Ref # :

Cust ID : 1689

Part Description	Qty	Sale	Extended	Labor Description	Extended
SYNTH. ENGINE OIL	10.00	8.35	83.50	OIL SERVICE REPLACE ENGINE OIL & FILTER	112.50
OIL FILTER	1.00	21.00	21.00	SAFETY AND PREVENTIVE MAINTENANCE INSPECTION CHECK TIRE PRESSURE RESET OIL SERVICE LIGHT	
				Hazardous Materials **** Recommendations **** SMALL CRACK IN SPOILER BELLOWS INSIDE FRONT TIRE WEAR CABRIO TOP PUMP NOISY @ TIMES SMALL CRACK IN WINDSHIELD CLUTCH SLIGHTLY STIFF KEY REMOTE PORTION \$ 183.56 + CODING \$25.00 BARE KEY \$ 147.12	7.00

Org. Estimate \$233.41 Revisions \$0.00 Current Estimate \$ 233.41 Additional Cost Revised Estimate

Labor:	\$119.50
Parts:	\$104.50
Sublet:	\$0.00
Sub:	\$224.00

Tax:	\$9.41
Total:	\$233.41
Bal Due:	\$233.41

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.
 Warranty: 24 months - 24 000 mile warranty whichever comes first.
 Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....
 SPINELLI, PETRA